




*RBW 100 kHz Marker 1 [T1]
VBW 300 kHz 110.15 dBμV
SWT 2.5 ms 2.401996000 GHz

Ref 117 dBμV

*Att 20 dB

1 PK
MAXH

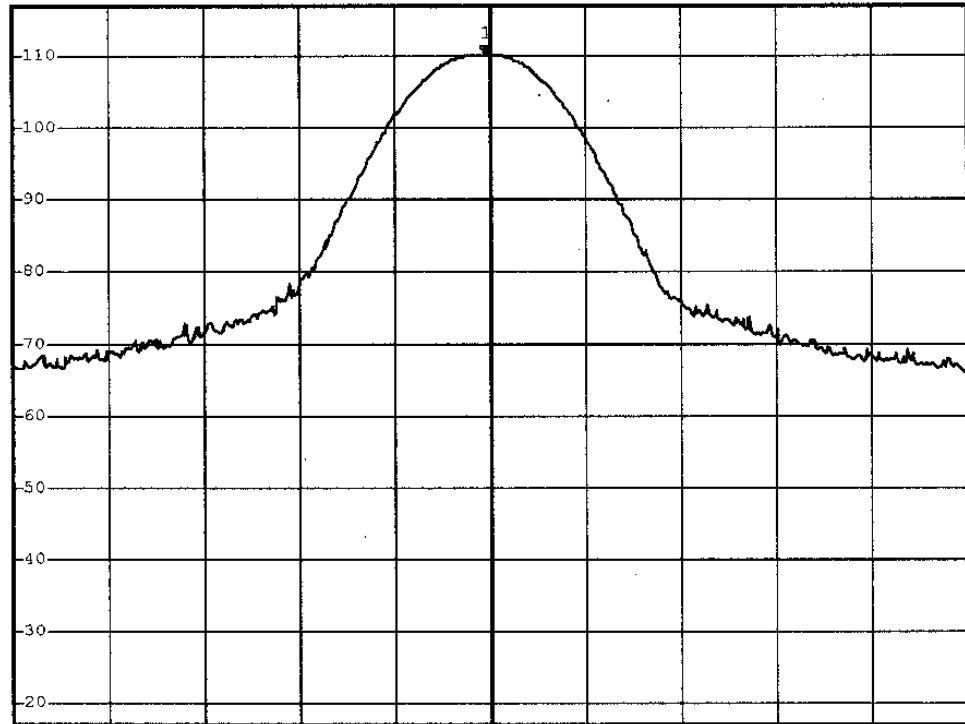

Comment A: Conducted spurious tx at low channelwareE▼
CL=1dB

Date: 17.SEP.2002 16:21:30




*RBW 100 kHz Marker 1 [T1]
VBW 300 kHz 48.77 dBuV
SWT 240 ms 665.160000000 MHz

Ref 97 dBuV

*Att 20 dB

1 PK
MAXH

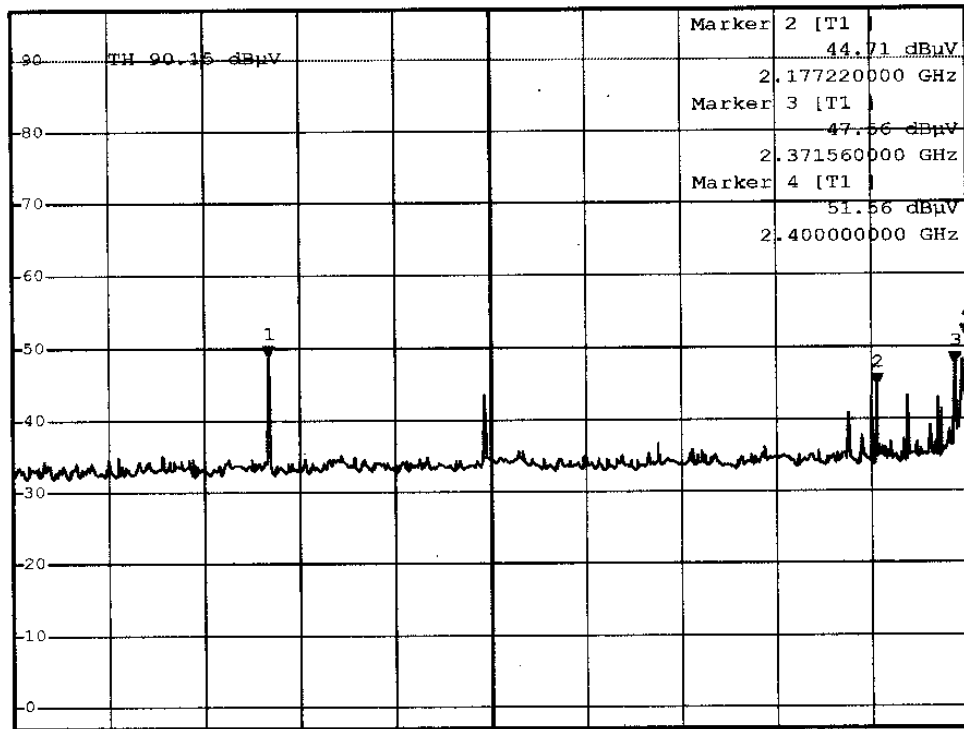

Start 30 MHz

237 MHz/

Stop 2.4 GHz

Comment A: Conducted spurious tx at low channel
CL=1dB

Date: 17.SEP.2002 16:25:14




*RBW 100 kHz Marker 2 [T1]
VBW 300 kHz 59.34 dBuV
SWT 2.3 s 25.000000000 GHz

Ref 97 dBuV

*Att 20 dB

1 PK
MAXH

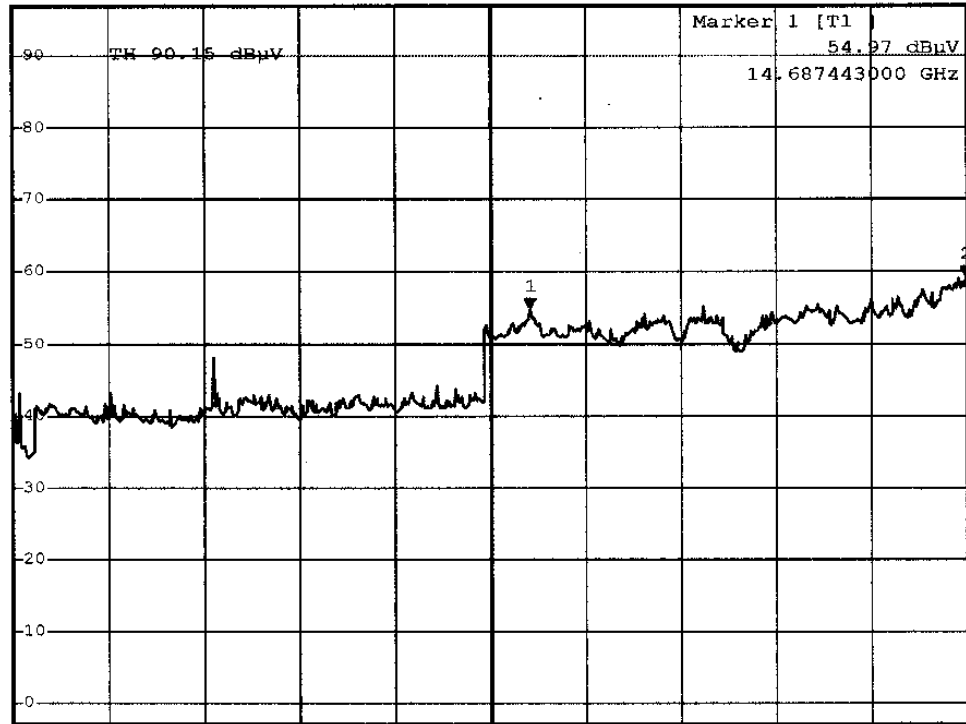

Start 2.4835 GHz

2.25165 GHz/


Stop 25 GHz

Comment A: Conducted spurious tx at low channelware
CL=1dB
Date: 17.SEP.2002 16:28:00



Ref 117 dBμV *Att 20 dB *RBW 100 kHz Marker 1 [T1]
VBW 300 kHz 110.43 dBμV
SWT 2.5 ms 2.440992000 GHz

1 PK
MAXH

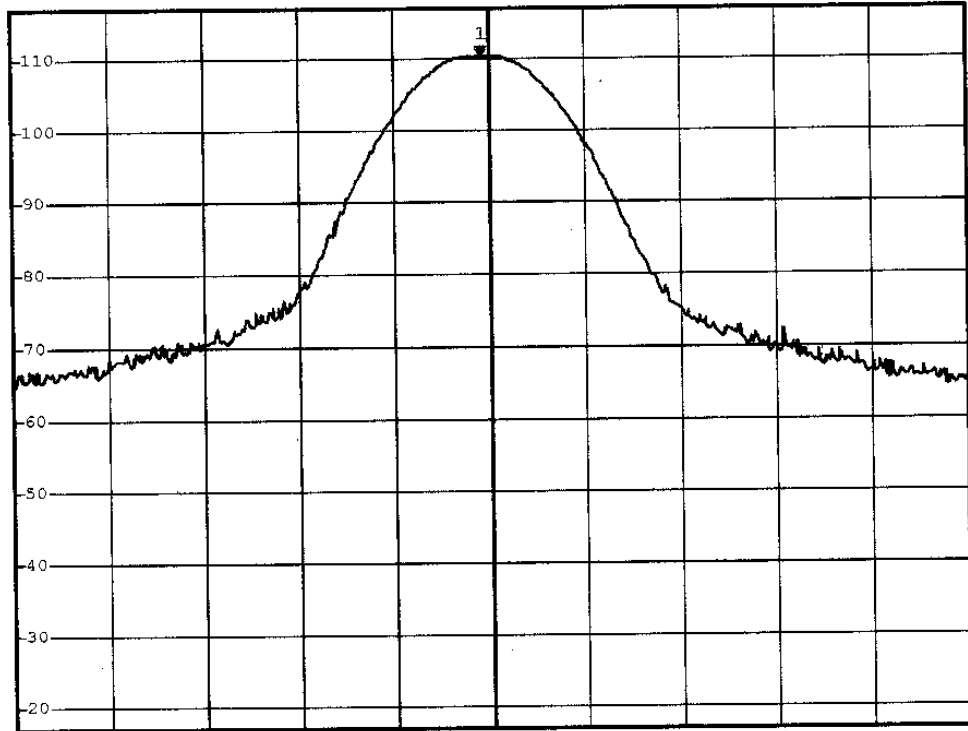


Center 2.441 GHz

100 kHz/

Span 1 MHz

Comment A: Conducted spurious tx at middle channel{
CL=1dB

Date: 17.SEP.2002 16:29:52

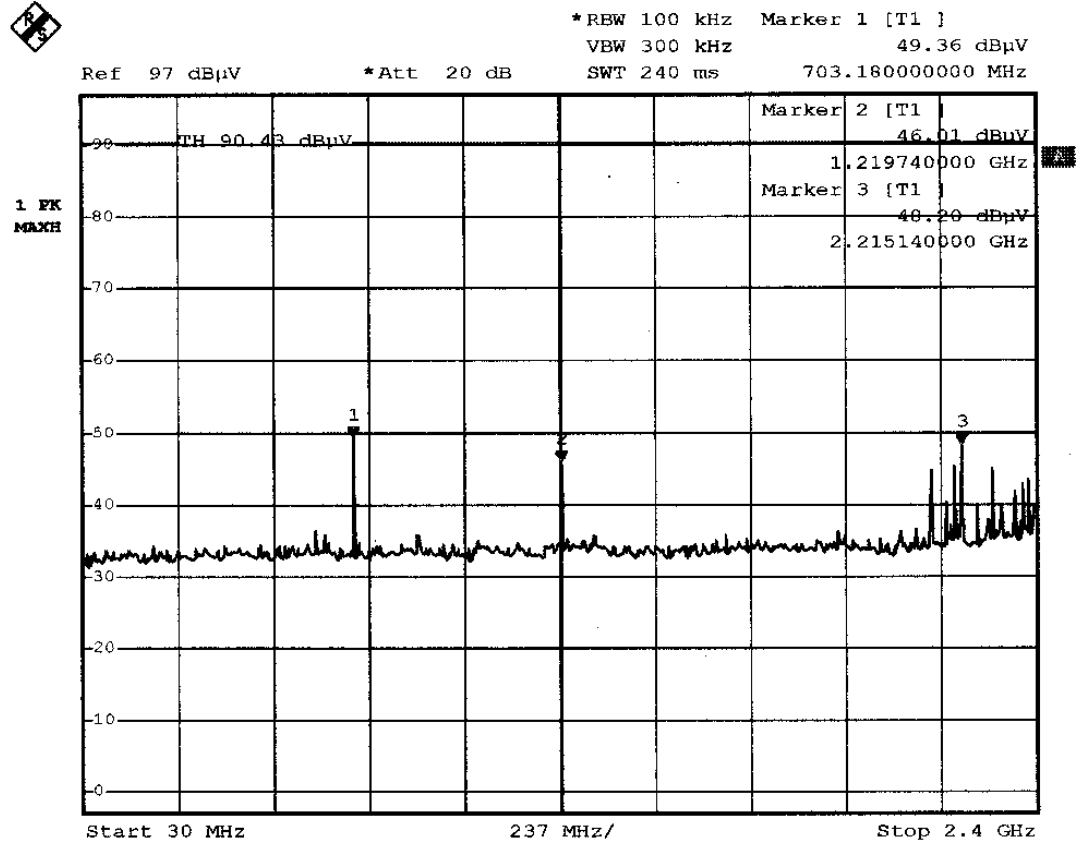

Comment A: Conducted spurious tx at middle channel(
CL=1dB

Date: 17.SEP.2002 16:33:04




*RBW 100 kHz Marker 1 [T1]
VBW 300 kHz 59.04 dBμV
SWT 2.3 s 24.594703000 GHz

Ref 97 dBμV

*Att 20 dB

1 PK
MAXH

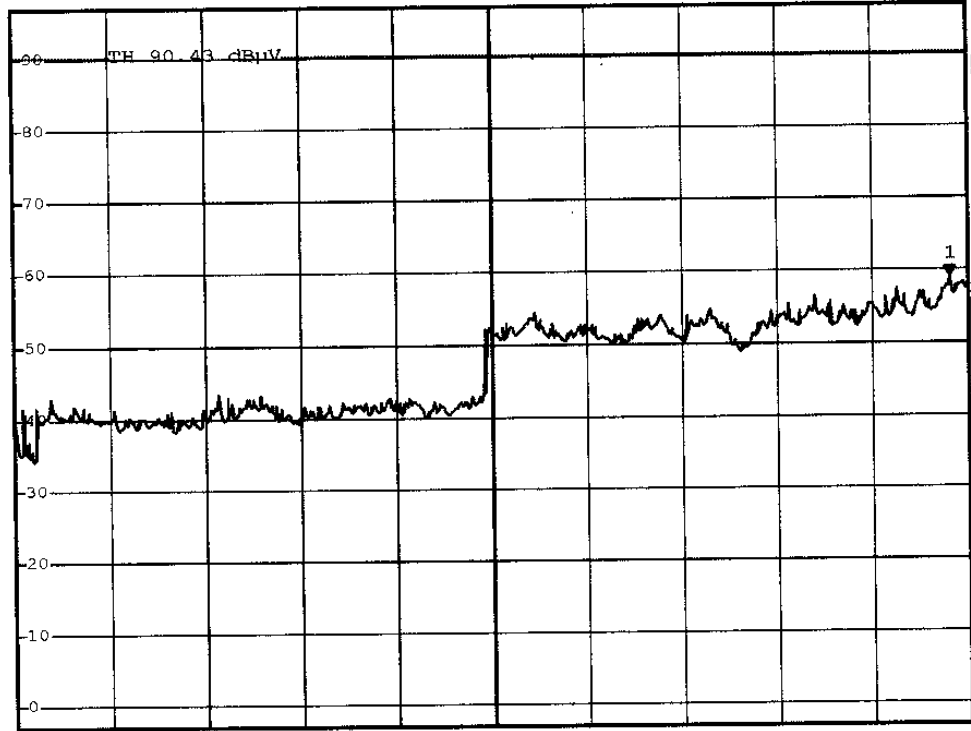

Start 2.4835 GHz

2.25165 GHz/

Stop 25 GHz

Comment A: Conducted spurious tx at middle channel{
CL=1dB

Date: 17.SEP.2002 16:34:42




*RBW 100 kHz Marker 1 [T1]
VBW 300 kHz 108.84 dBμV
SWT 2.5 ms 2.479992000 GHz

Ref 117 dBμV

*Att 20 dB

1 PK
MAXH

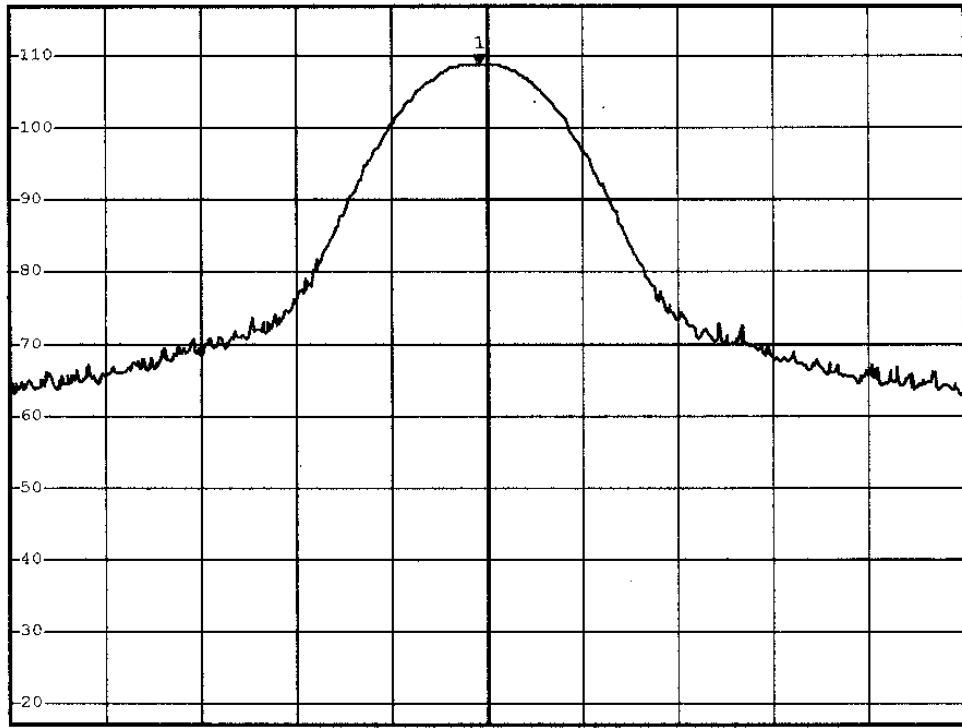

Center 2.48 GHz

100 kHz/

Span 1 MHz

Comment A: Conducted spurious tx at high channel

CL=1dB

Date: 17.SEP.2002 16:36:07




*RBW 100 kHz Marker 1 [T1]
VBW 300 kHz 48.65 dBuV
SWT 240 ms 2.172480000 GHz

Ref 97 dBuV

*Att 20 dB

1 FK
MAXH

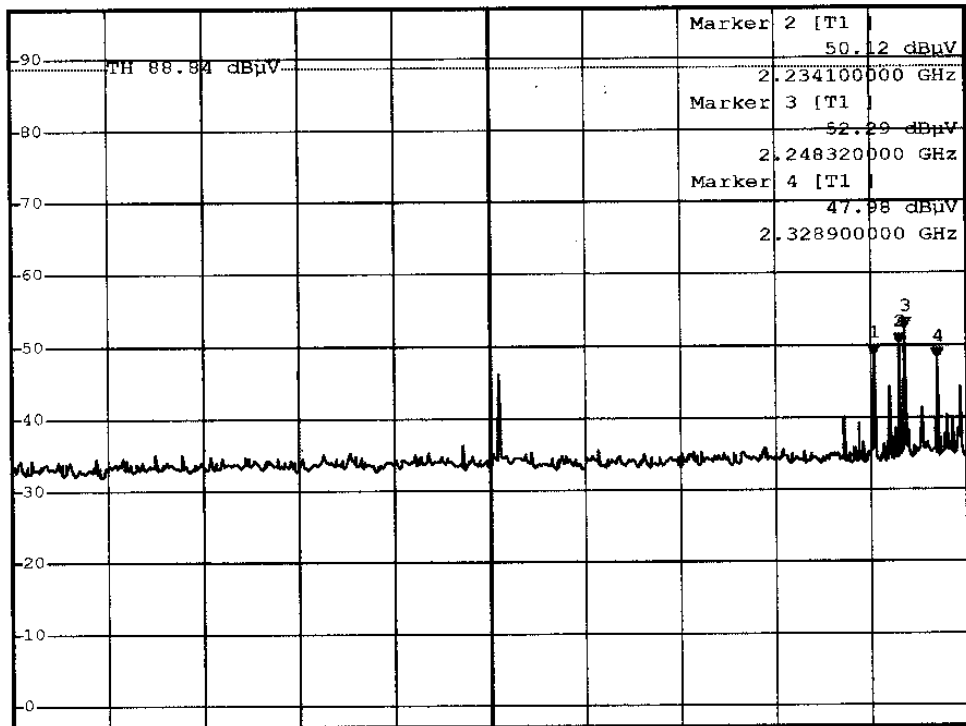

Start 30 MHz


237 MHz/

Stop 2.4 GHz

Comment A: Conducted spurious tx at high channel

CL=1dB

Date: 17.SEP.2002 16:38:46

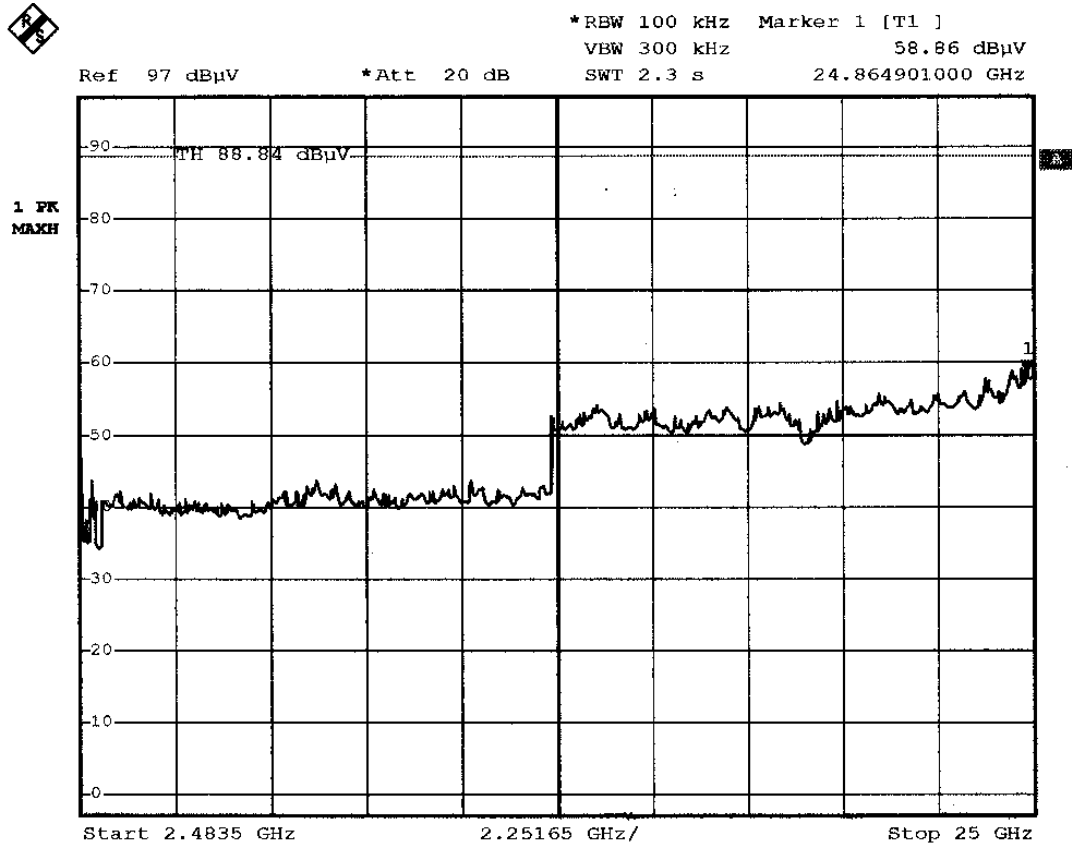

Comment A: Conducted spurious tx at high channel

CL=1dB

Date: 17.SEP.2002 16:39:51