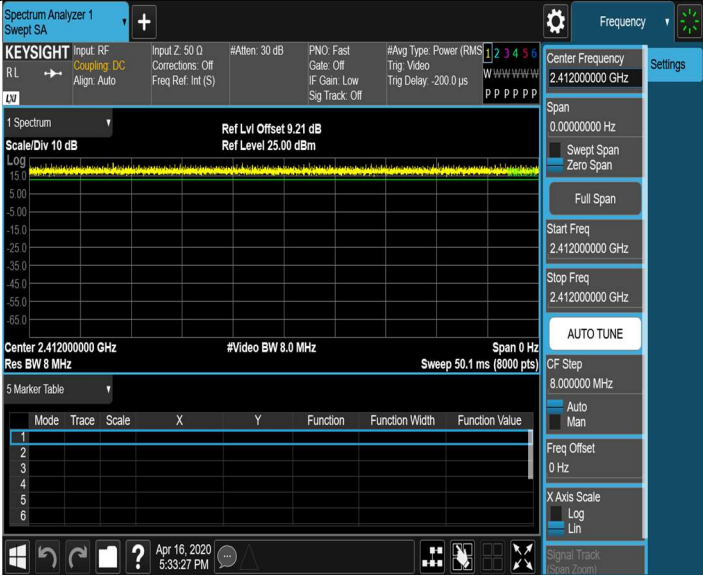


Appendix A: Duty cycle Test Result

Item	Duty Cycle
Mode	802.11b/g/n(HT20)/n(HT40)
Result	Duty Cycle:100%; Burst:50ms; Period:50ms
Graph:	 The screenshot shows a Keysight Spectrum Analyzer interface. The main display shows a flat spectrum line at 2.412 GHz with a level of 25.00 dBm. The interface includes various settings like Center Frequency, Span, and a Marker Table.
Graph:	 The screenshot shows a Keysight Spectrum Analyzer interface. The main display shows a flat spectrum line at 2.412 GHz with a level of 25.00 dBm. The interface includes various settings like Center Frequency, Span, and a Marker Table.

Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749



Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

Appendix B: 6dB bandwidth Test Result

Test Mode	Antenna	Channel	DTS BW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11B	Ant1	2412	10.120	2406.920	2417.040	≥ 0.5	PASS
		2437	9.840	2431.920	2441.760	≥ 0.5	PASS
		2462	9.680	2457.400	2467.080	≥ 0.5	PASS
11G	Ant1	2412	16.640	2403.680	2420.320	≥ 0.5	PASS
		2437	16.560	2428.720	2445.280	≥ 0.5	PASS
		2462	16.600	2453.720	2470.320	≥ 0.5	PASS
11N20	Ant1	2412	17.840	2403.080	2420.920	≥ 0.5	PASS
		2437	17.840	2428.080	2445.920	≥ 0.5	PASS
		2462	17.840	2453.080	2470.920	≥ 0.5	PASS
11N40	Ant1	2422	36.480	2403.760	2440.240	≥ 0.5	PASS
		2437	36.480	2418.760	2455.240	≥ 0.5	PASS
		2452	36.480	2433.760	2470.240	≥ 0.5	PASS

Test Graphs

11B_Ant1_2412



11B_Ant1_2437



11B_Ant1_2462

Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749



11G_Ant1_2412



11G_Ant1_2437

Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749



11G_Ant1_2462



11N20SISO_Ant1_2412

Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749



Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749






Appendix C: Conducted output power for DTS Test Result

Test Mode	Antenna	Channel	Conducted Power [dBm]	Conducted Limit [dBm]	Verdict
11B	Ant1	2412	12.72	<=30	PASS
		2437	13.06	<=30	PASS
		2462	13.08	<=30	PASS
11G	Ant1	2412	8.57	<=30	PASS
		2437	8.78	<=30	PASS
		2462	8.72	<=30	PASS
11N20SISO	Ant1	2412	6.61	<=30	PASS
		2437	6.73	<=30	PASS
		2462	6.67	<=30	PASS
11N40SISO	Ant1	2422	5.60	<=30	PASS
		2437	5.99	<=30	PASS
		2452	5.93	<=30	PASS

Appendix D: Power spectral density Test Result

Test Mode	Antenna	Channel	Result [dBm/3-100kHz]	Limit [dBm/3kHz]	Verdict
802.11b	Ant1	2412	-13.92	<=8	PASS
		2437	-13.66	<=8	PASS
		2462	-13.59	<=8	PASS
802.11g	Ant1	2412	-16.92	<=8	PASS
		2437	-16.62	<=8	PASS
		2462	-16.83	<=8	PASS
802.11n(HT20)	Ant1	2412	-22.27	<=8	PASS
		2437	-21.94	<=8	PASS
		2462	-22.27	<=8	PASS
802.11n(HT40)	Ant1	2422	-22.99	<=8	PASS
		2437	-17.05	<=8	PASS
		2452	-17.11	<=8	PASS

Test Graphs

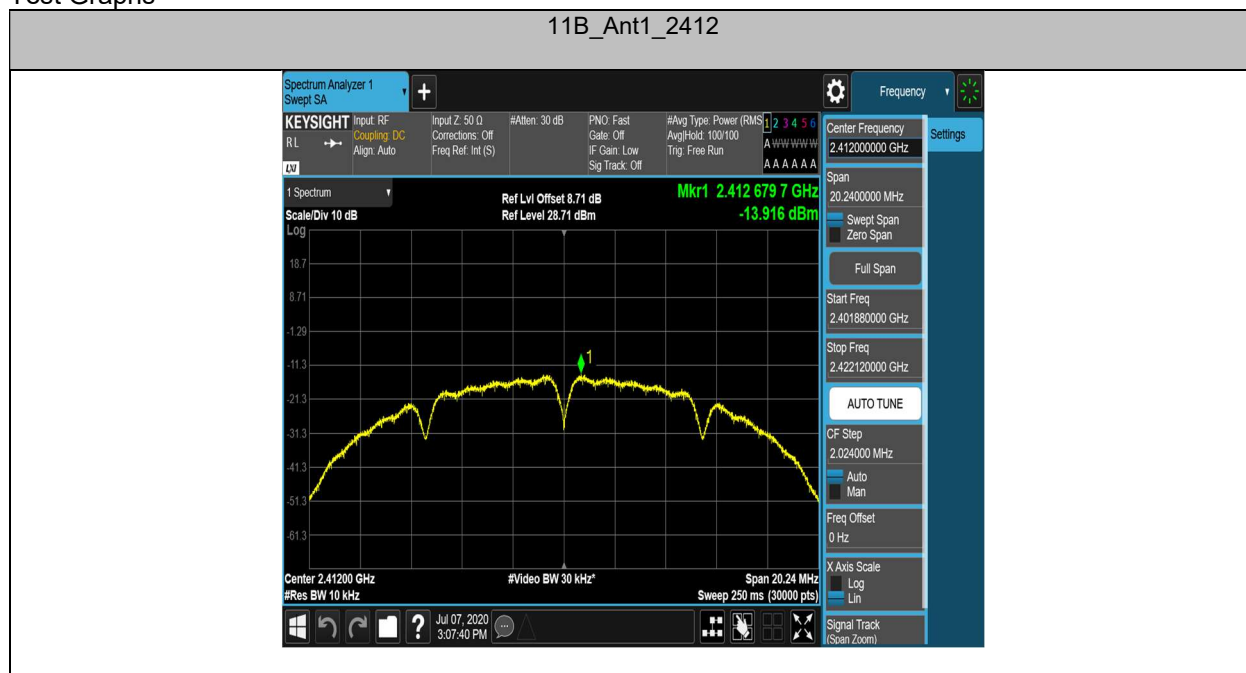

Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

11B_Ant1_2437



11B_Ant1_2462




11G_Ant1_2412

Test Report No.: EFGX20030111-IE-01-E01


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

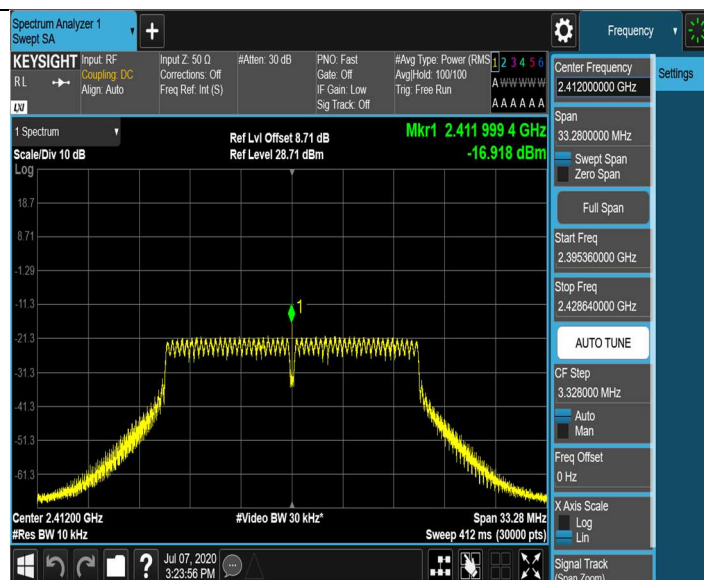

11G_Ant1_2437

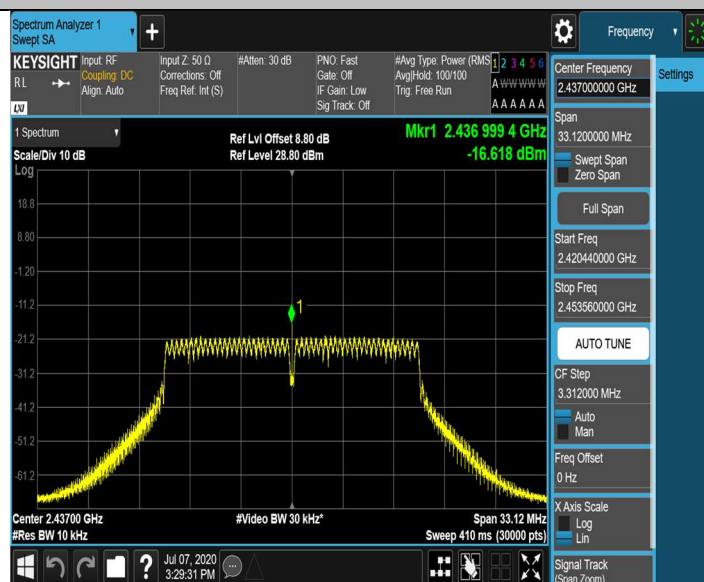


11G_Ant1_2462

Test Report No.: EFGX20030111-IE-01-E01


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

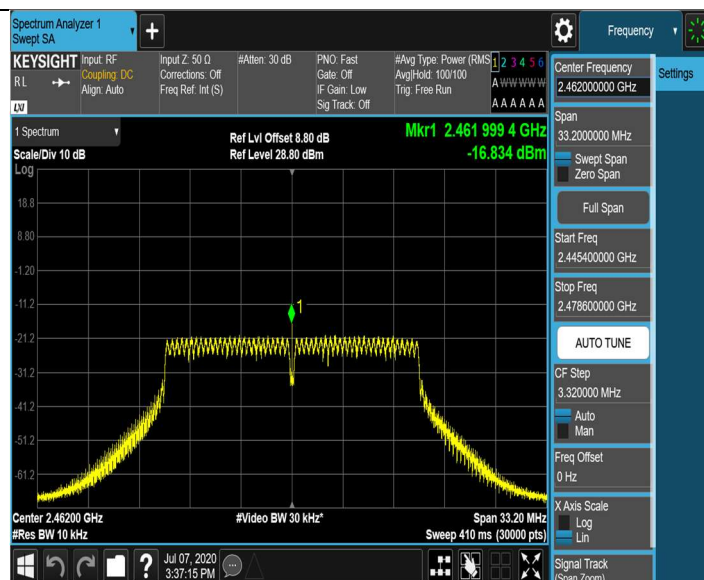

11N20SISO_Ant1_2412

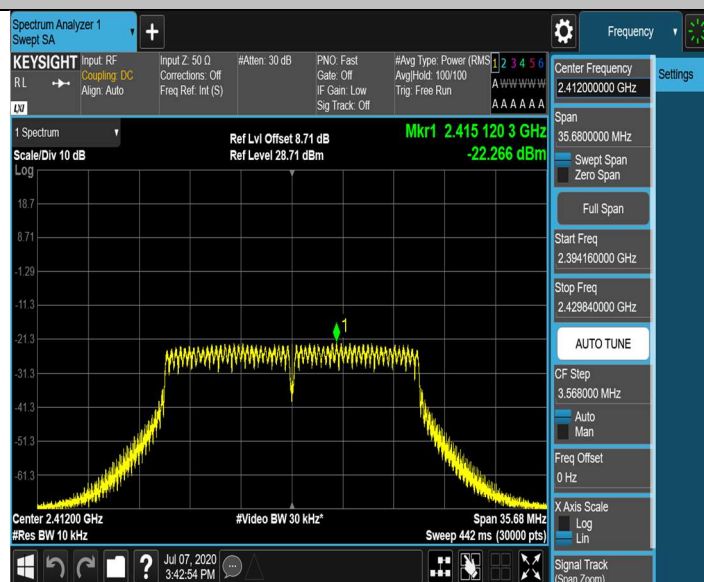


11N20SISO_Ant1_2437

Test Report No.: EFGX20030111-IE-01-E01


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

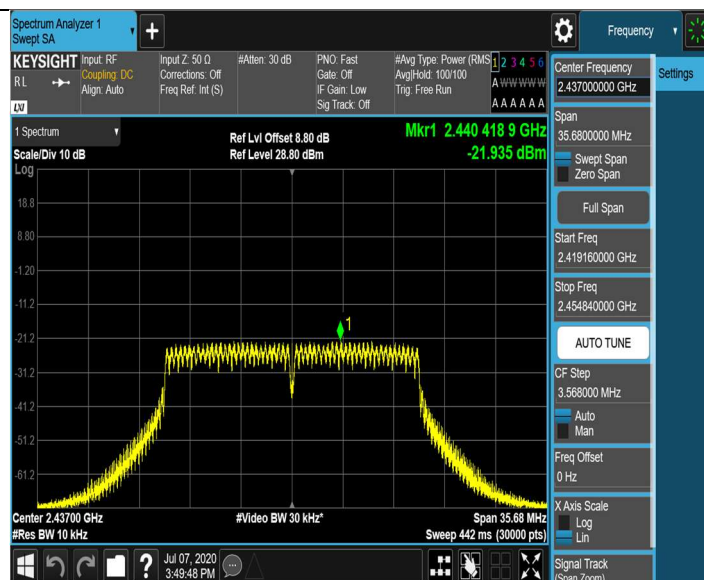

11N20SISO_Ant1_2462

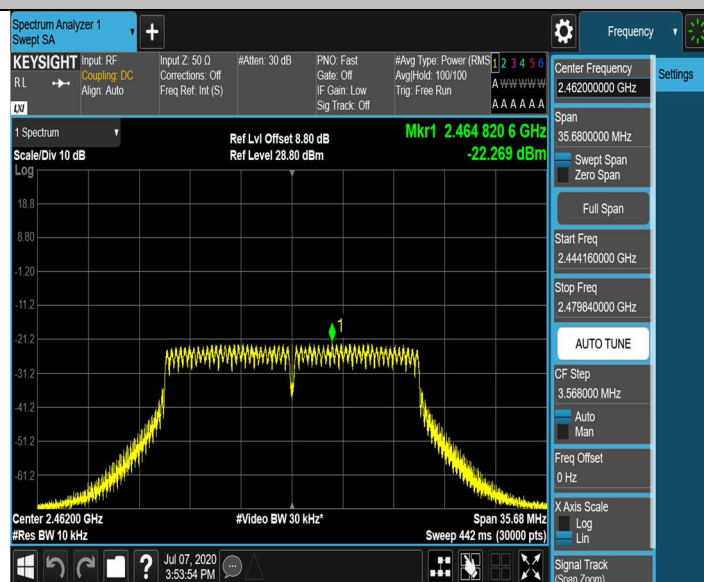


11N40SISO_Ant1_2422

Test Report No.: EFGX20030111-IE-01-E01


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

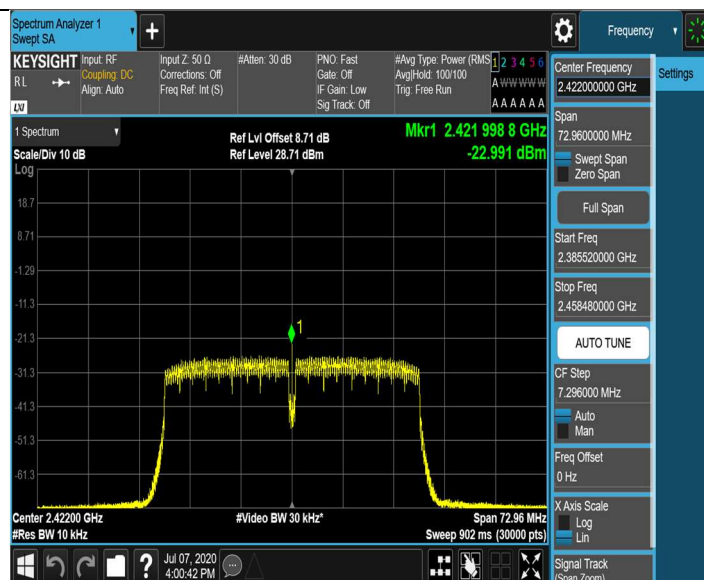

11N40SISO_Ant1_2437

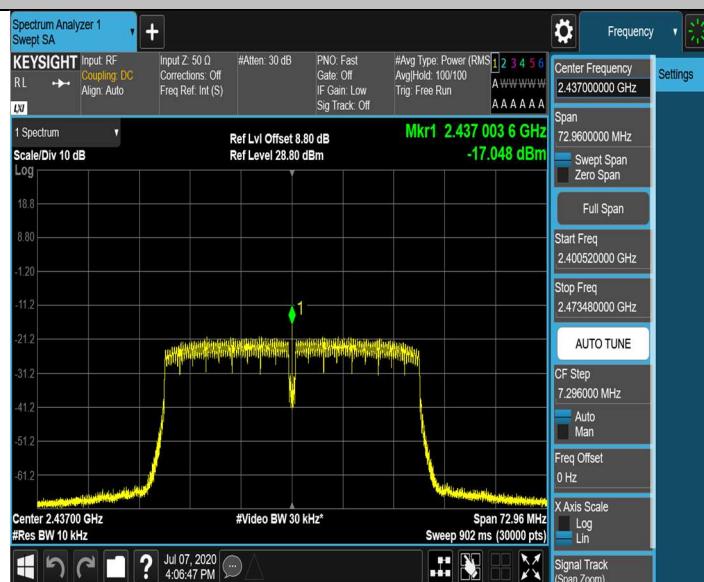


11N40SISO_Ant1_2452

Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.


P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

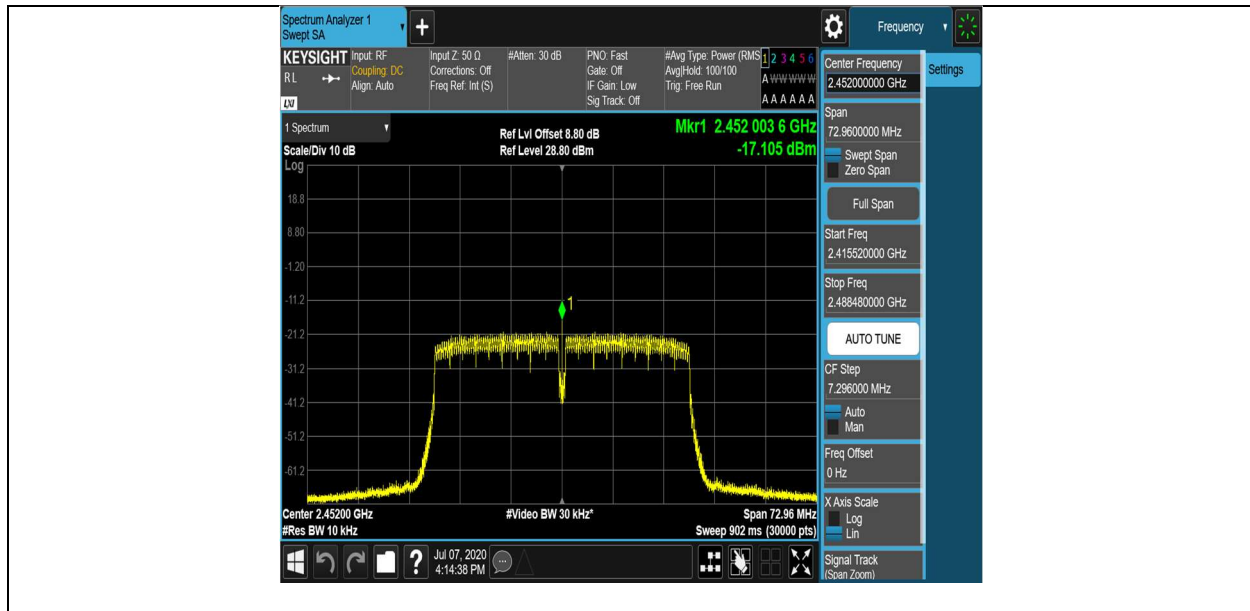

Appendix E: Band edge Test Result

Test Mode	Antenna	Ch Name	Channel	Ref Level[dBm]	Result[dBm]	Limit[dBm]	Verdict
802.11b	Ant1	Low	2412	2.95	-37.13	<=-27.05	PASS
		High	2462	3.26	-49.76	<=-26.74	PASS
802.11g	Ant1	Low	2412	-5.74	-38.57	<=-35.74	PASS
		High	2462	-5.54	-48.4	<=-35.54	PASS
802.11n(HT20)	Ant1	Low	2412	-7.33	-40.51	<=-37.33	PASS
		High	2462	-7.50	-49.28	<=-37.5	PASS
802.11n(HT40)	Ant1	Low	2422	-11.63	-49.49	<=-41.63	PASS
		High	2452	-11.08	-49.22	<=-41.08	PASS

Test Graphs

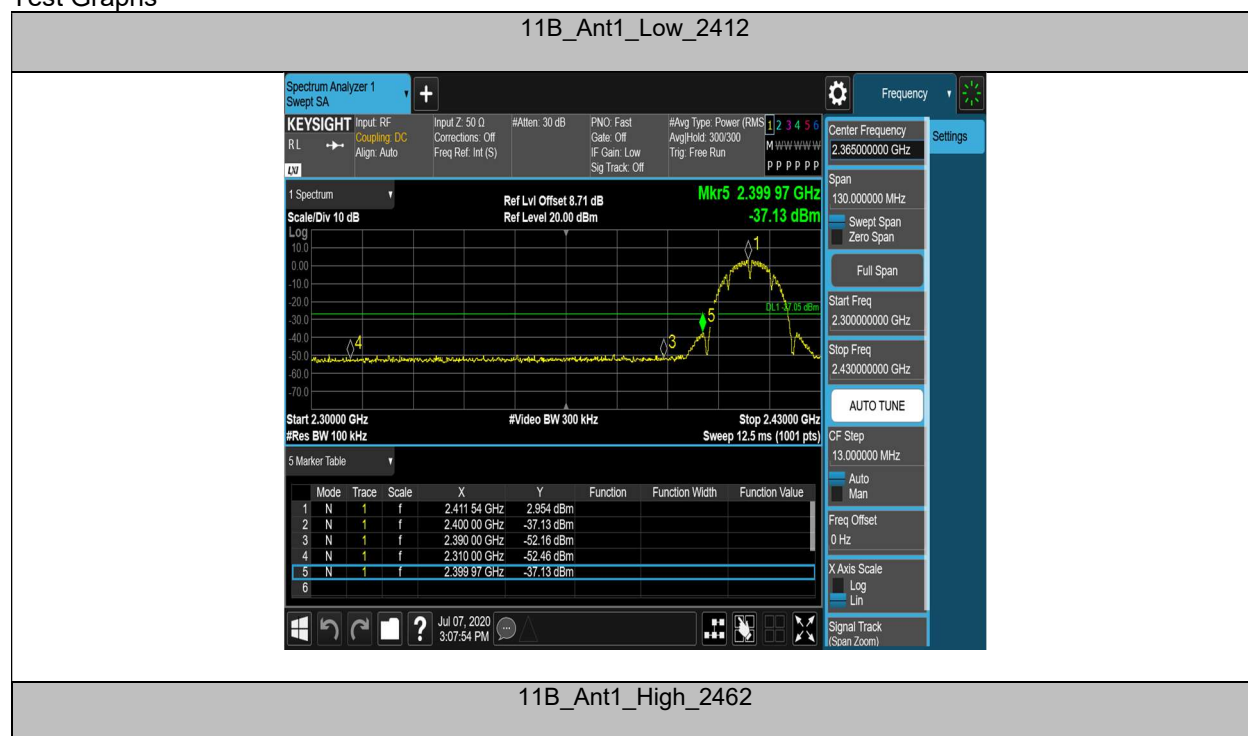

Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749



11G_Ant1_Low_2412




11G_Ant1_High_2462

Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

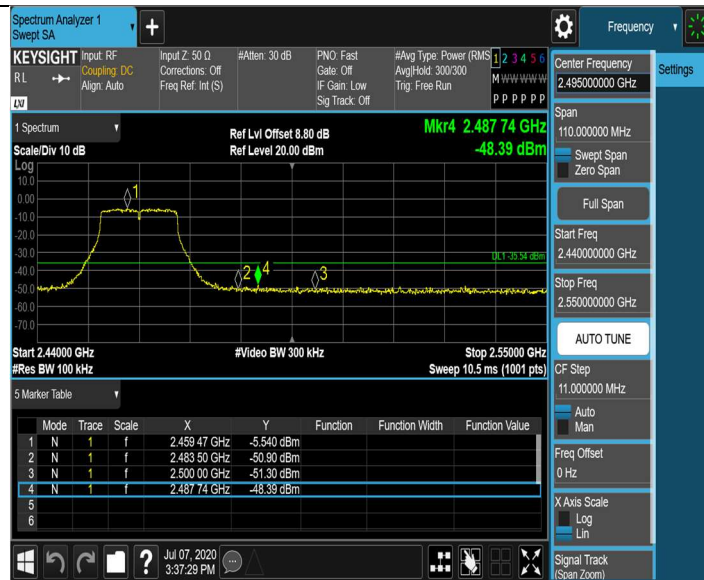

11N20SISO_Ant1_Low_2412




11N20SISO_Ant1_High_2462

Test Report No.: EFGX20030111-IE-01-E01


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

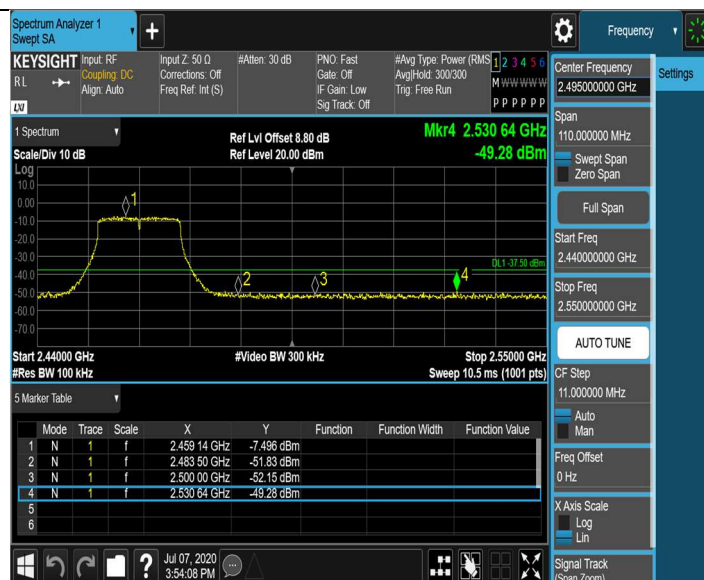

11N40SISO_Ant1_Low_2422

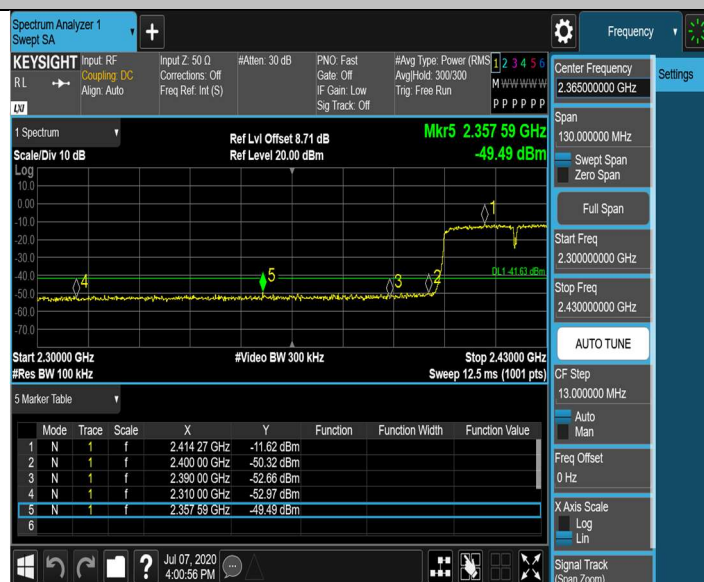


11N40SISO_Ant1_High_2452

Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

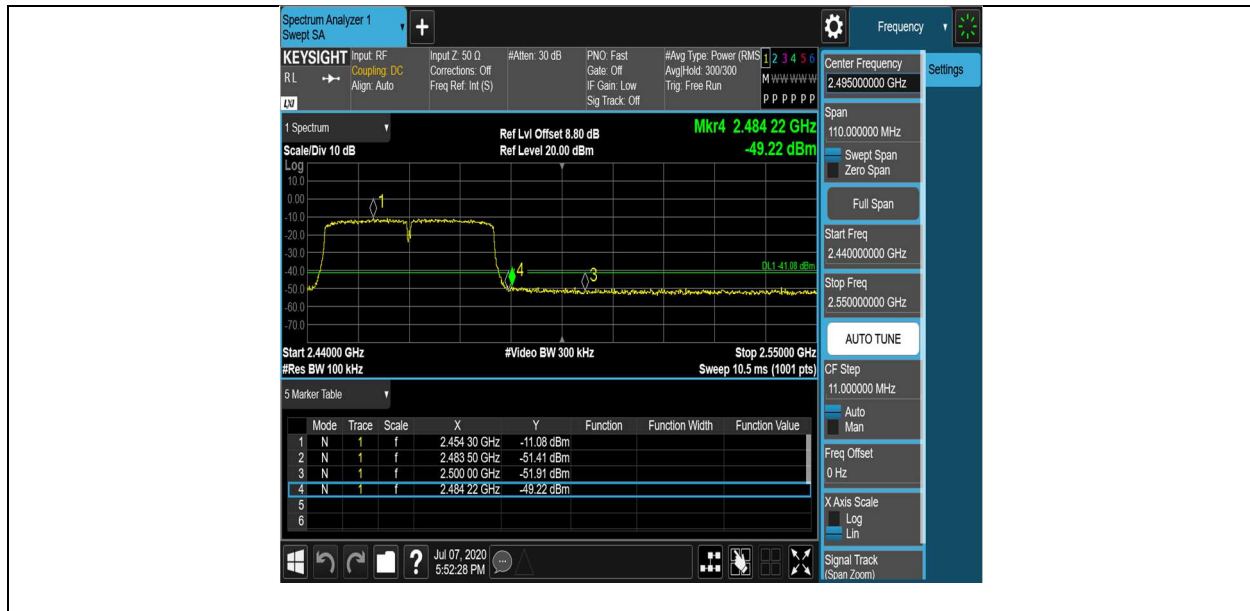

Appendix F: Emissions in Restricted Bands Test Result

TestMode	Antenna	ChName	Channel	Detector	Freq [MHz]	Result [dBm]	Limit [dBm]	Verdict
11B	Ant1	Low	2412	AV	2310.000	-48.51	<=-41.20	PASS
				AV	2390.000	-47.98	<=-41.20	PASS
				Peak	2310.000	-44.68	<=-21.20	PASS
				Peak	2390.000	-43.47	<=-21.20	PASS
		High	2462	AV	2483.500	-47.43	<=-41.20	PASS
				AV	2500.000	-47.59	<=-41.20	PASS
				Peak	2483.500	-41.58	<=-21.20	PASS
				Peak	2500.000	-44.23	<=-21.20	PASS
11G	Ant1	Low	2412	AV	2310.000	-48.27	<=-41.20	PASS
				AV	2390.000	-46.56	<=-41.20	PASS
				Peak	2310.000	-43.84	<=-21.20	PASS
				Peak	2390.000	-41.77	<=-21.20	PASS
		High	2462	AV	2483.500	-46.28	<=-41.20	PASS
				AV	2500.000	-47.02	<=-41.20	PASS
				Peak	2483.500	-42.75	<=-21.20	PASS
				Peak	2500.000	-42.14	<=-21.20	PASS
11N20SIS O	Ant1	Low	2412	AV	2310.000	-48.74	<=-41.20	PASS
				AV	2390.000	-47.81	<=-41.20	PASS
				Peak	2310.000	-44.26	<=-21.20	PASS
				Peak	2390.000	-42.59	<=-21.20	PASS
		High	2462	AV	2483.500	-47.66	<=-41.20	PASS
				AV	2500.000	-47.98	<=-41.20	PASS
				Peak	2483.500	-42.84	<=-21.20	PASS
				Peak	2500.000	-44.14	<=-21.20	PASS

Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749

11N40SIS O	Ant1	Low	2422	AV	2310.000	-49.08	<=-41.20	PASS
				AV	2390.000	-47.91	<=-41.20	PASS
				Peak	2310.000	-44.76	<=-21.20	PASS
				Peak	2390.000	-43.22	<=-21.20	PASS
		High	2452	AV	2483.500	-45.85	<=-41.20	PASS
				AV	2500.000	-47.61	<=-41.20	PASS
				Peak	2483.500	-41.08	<=-21.20	PASS
				Peak	2500.000	-46.88	<=-21.20	PASS

Note:

1. The Antenna Gain is compensated in the graph.
2. The limit in dBm for average detector is conversion from 54dBuV/m, according to 15.209(a). The limit in dBm for peak detector is 20dB above the limit of average detector in dBm.

Test Graphs

11B_Ant1_Low_2412_AV



11B_Ant1_Low_2412_Peak



11B_Ant1_High_2462_AV

Test Report No.: EFGX20030111-IE-01-E01


Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749



11B_Ant1_High_2462_Peak

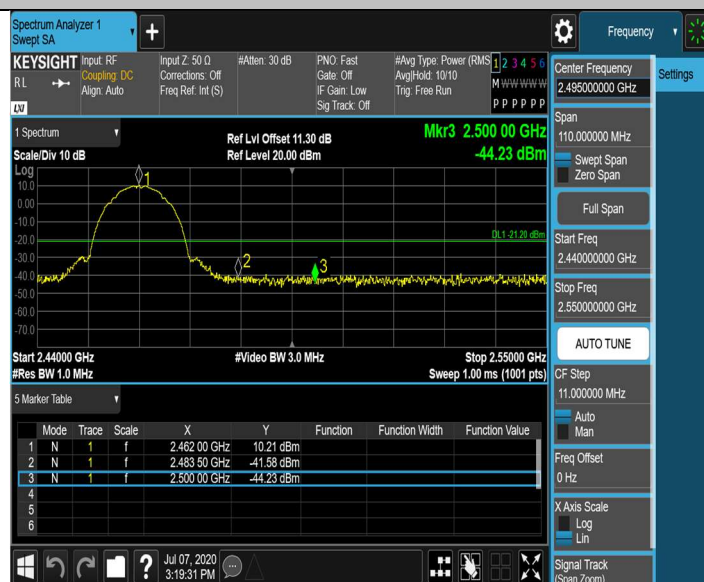

11G_Ant1_Low_2412_AV

Test Report No.: EFGX20030111-IE-01-E01

Eurofins Electrical Testing Service (Shenzhen) Co., Ltd.

1st Floor, Building 2, Chungu, Meisheng Huigu Science and Technology Park, No. 83 Dabao Road, Bao'an District, Shenzhen.

P.R.China. Telephone: +86-755-82911867, Fax : +86-755-82910749