


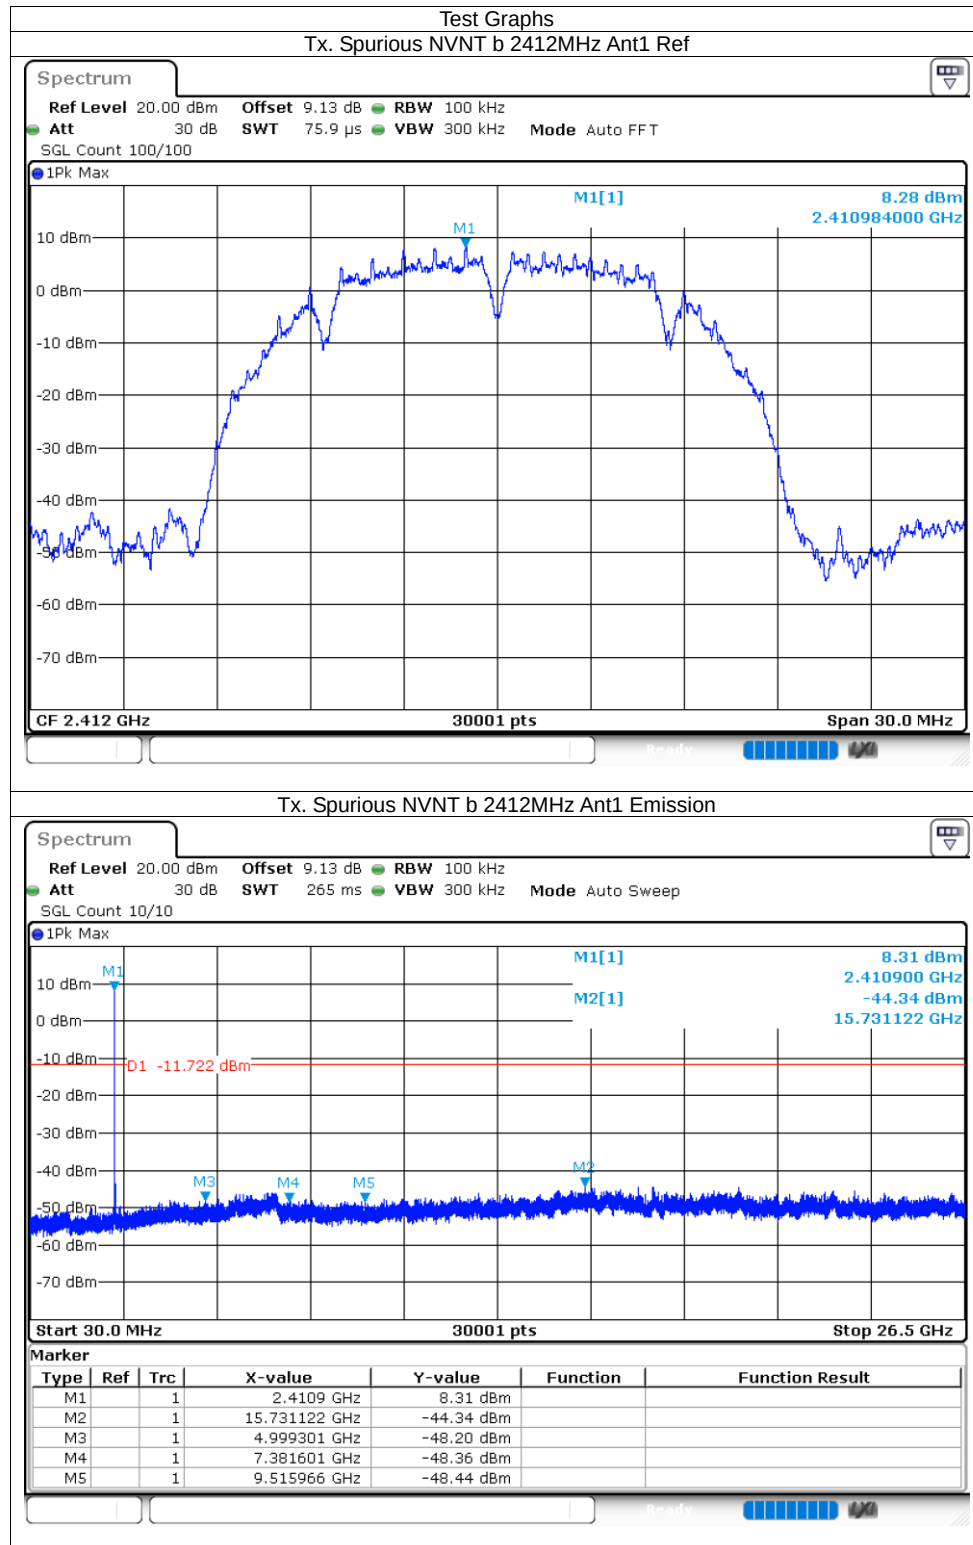
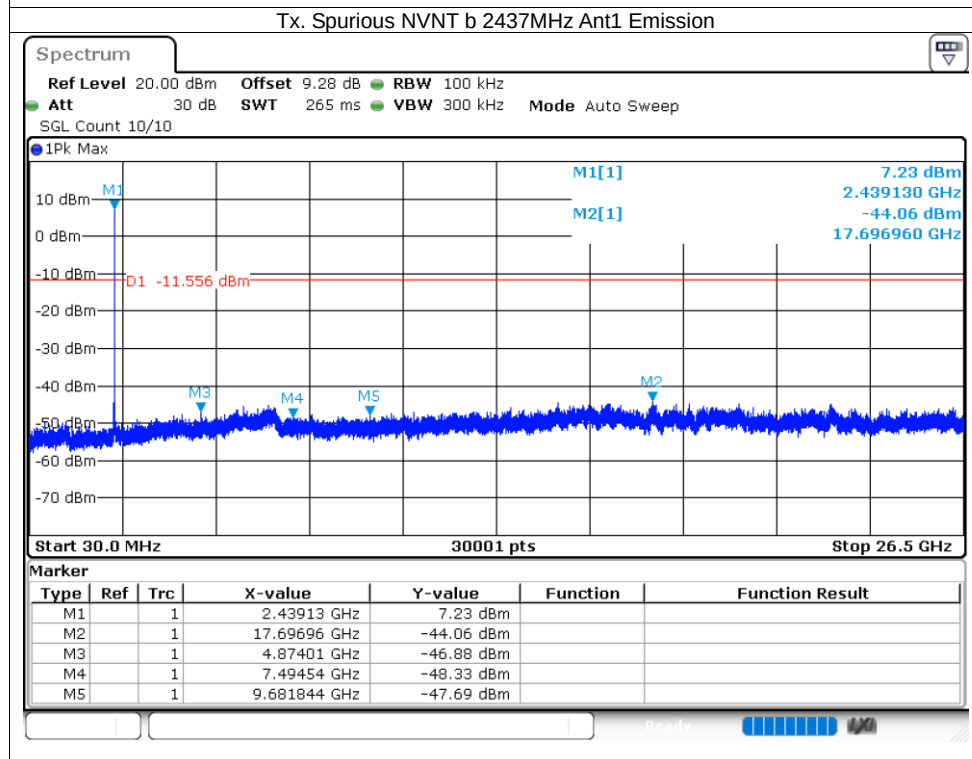




8.7 CONDUCTED RF SPURIOUS EMISSION



Condition	Mode	Frequency (MHz)	Antenna	Max Value (dBc)	Limit (dBc)	Verdict
NVNT	b	2412	Ant1	-52.62	-20	Pass
NVNT	b	2437	Ant1	-52.5	-20	Pass
NVNT	b	2462	Ant1	-52.51	-20	Pass
NVNT	b	2412	Ant2	-55.69	-20	Pass
NVNT	b	2437	Ant2	-56.3	-20	Pass
NVNT	b	2462	Ant2	-56.06	-20	Pass
NVNT	g	2412	Ant1	-45.14	-20	Pass
NVNT	g	2437	Ant1	-45.2	-20	Pass
NVNT	g	2462	Ant1	-46.23	-20	Pass
NVNT	g	2412	Ant2	-50.54	-20	Pass
NVNT	g	2437	Ant2	-53.26	-20	Pass
NVNT	g	2462	Ant2	-50.56	-20	Pass
NVNT	n20	2412	Ant1	-43.69	-20	Pass
NVNT	n20	2437	Ant1	-45.51	-20	Pass
NVNT	n20	2462	Ant1	-45.19	-20	Pass
NVNT	n20	2412	Ant2	-48.67	-20	Pass
NVNT	n20	2437	Ant2	-49.43	-20	Pass
NVNT	n20	2462	Ant2	-51.92	-20	Pass
NVNT	n40	2422	Ant1	-42.69	-20	Pass
NVNT	n40	2437	Ant1	-43.21	-20	Pass
NVNT	n40	2452	Ant1	-41.18	-20	Pass
NVNT	n40	2422	Ant2	-47.37	-20	Pass
NVNT	n40	2437	Ant2	-45.36	-20	Pass
NVNT	n40	2452	Ant2	-47.39	-20	Pass


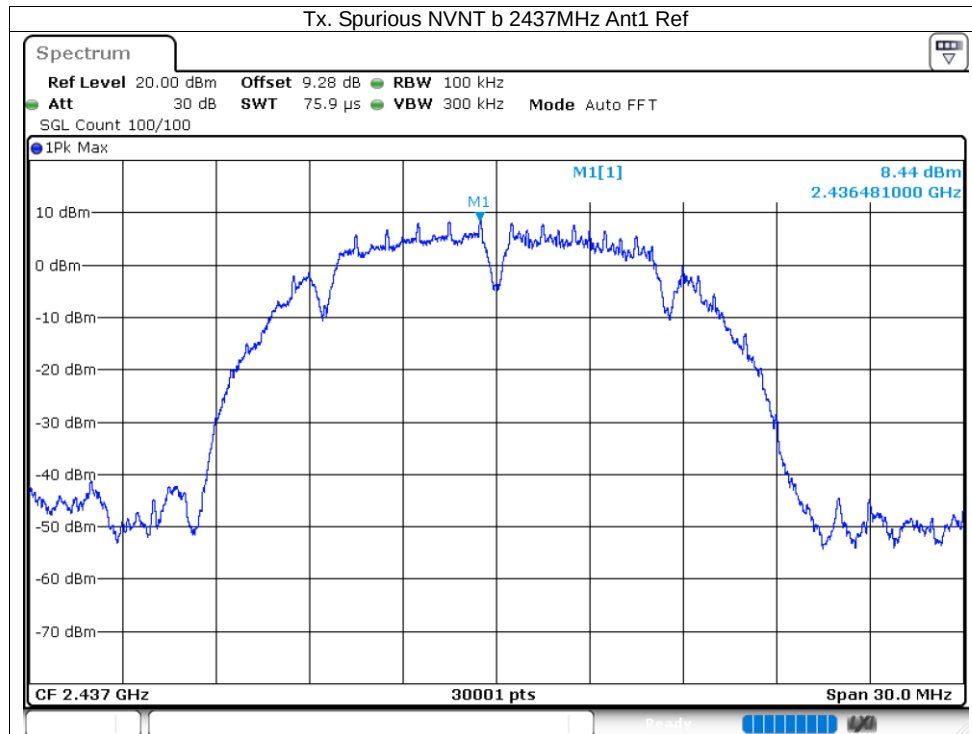



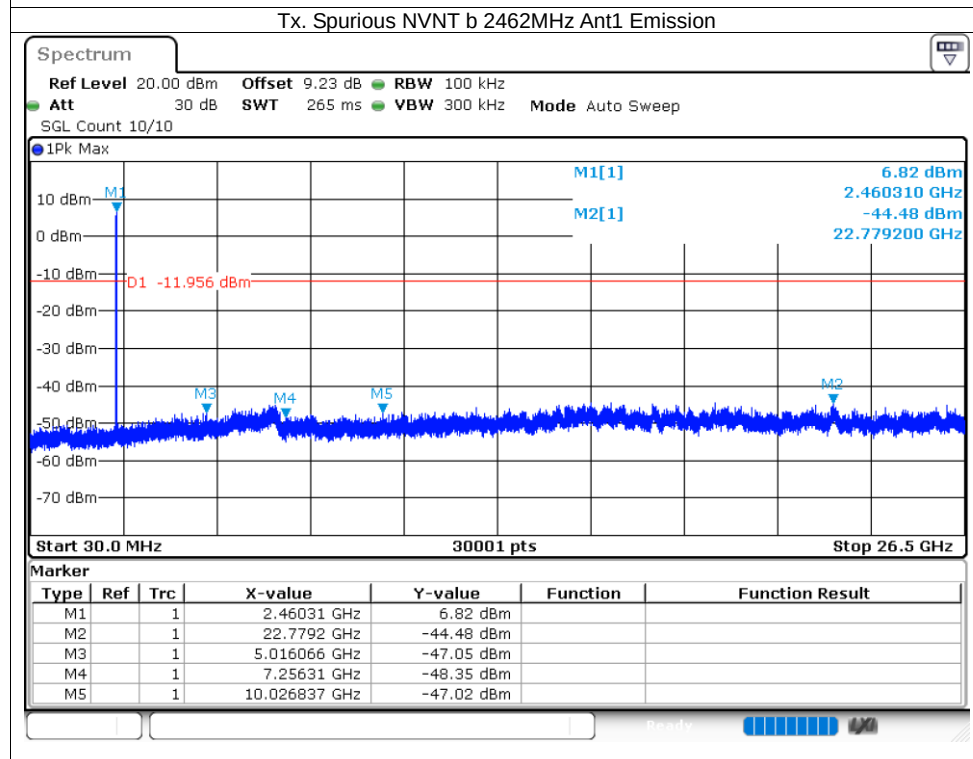



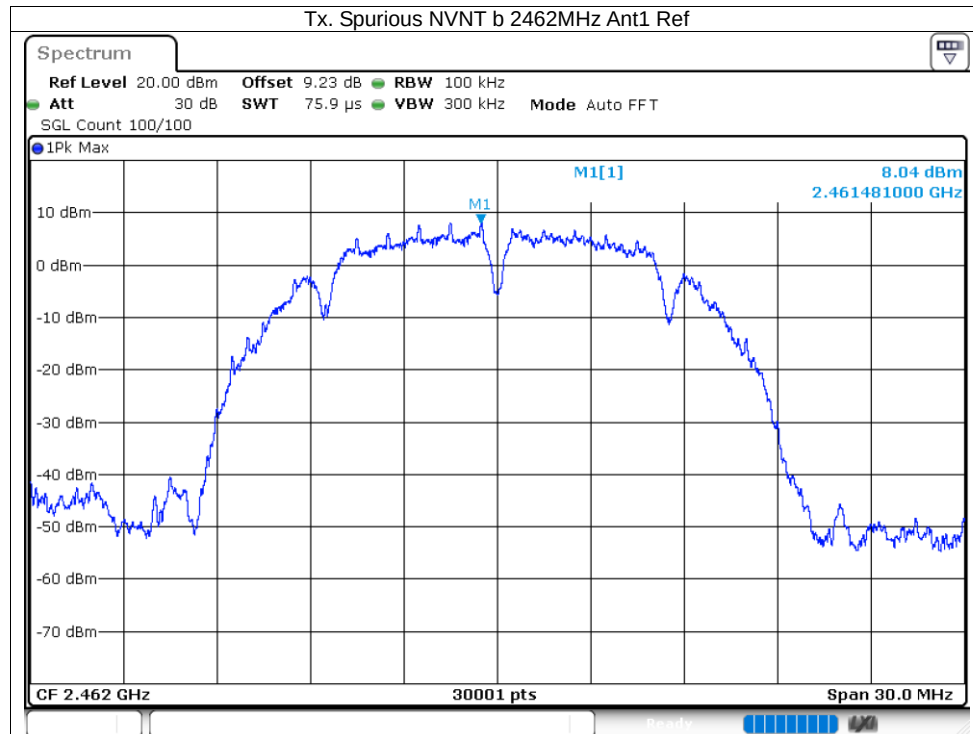


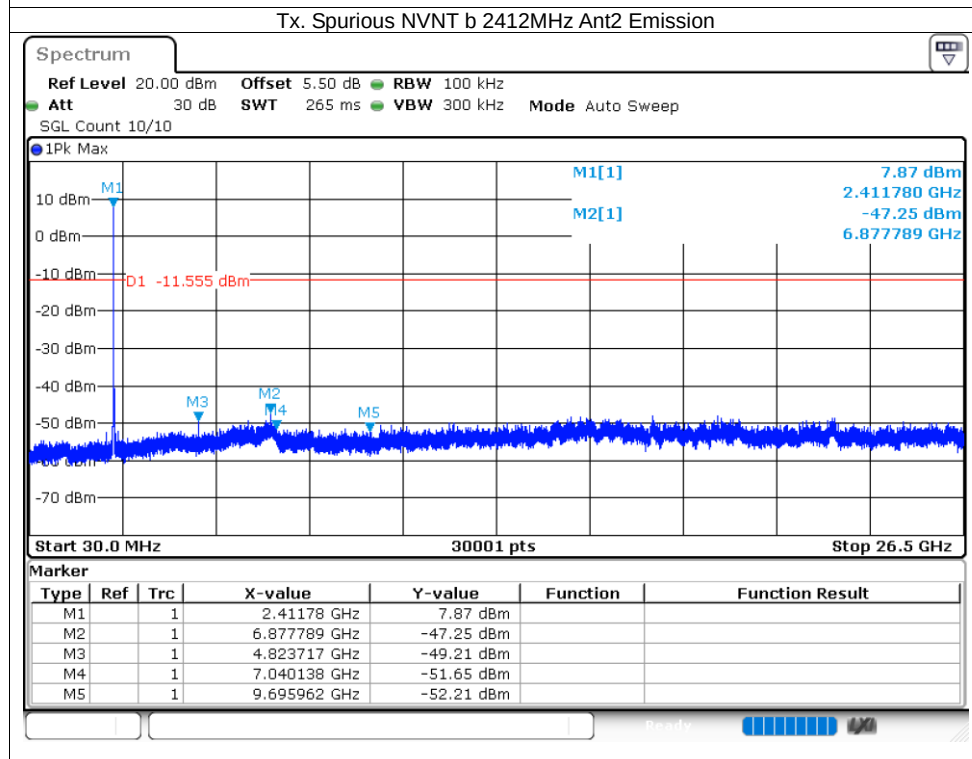
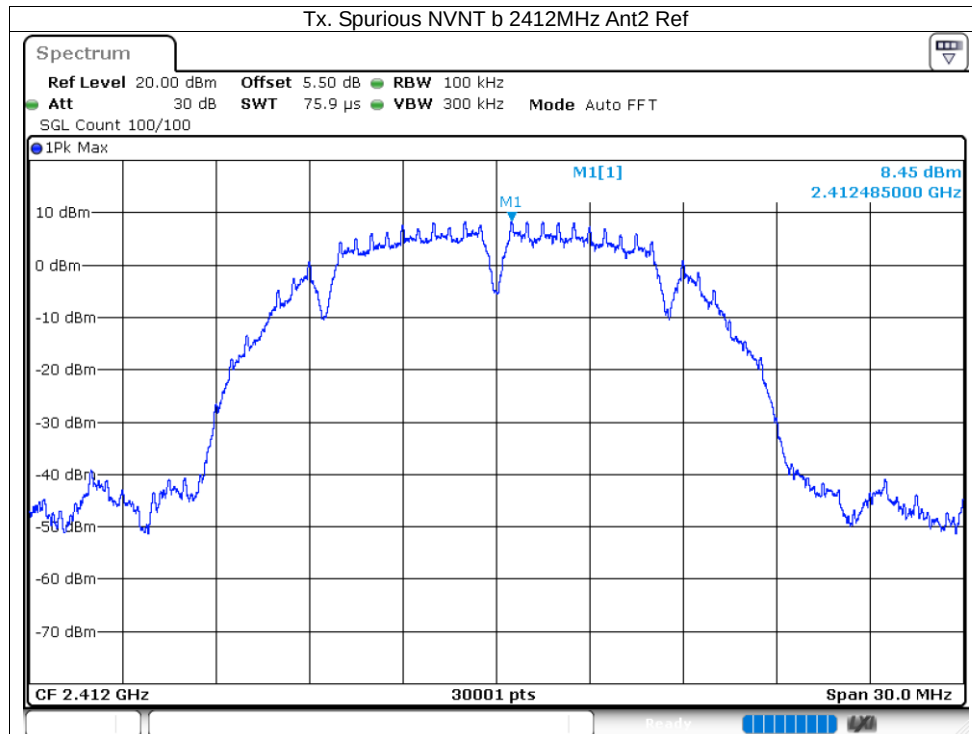


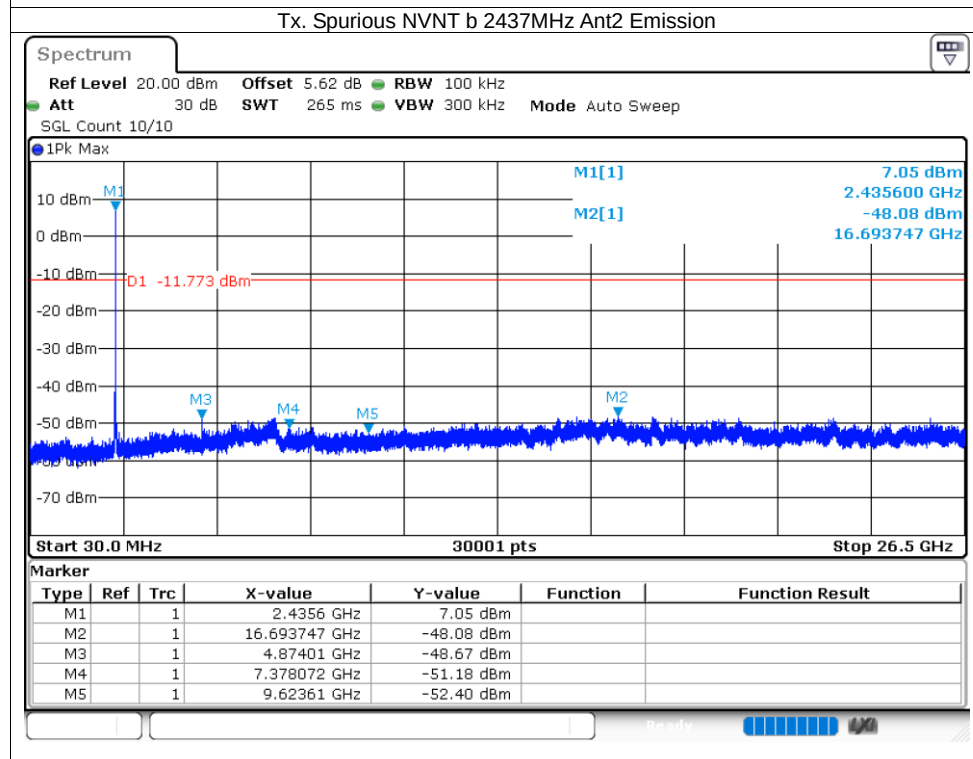
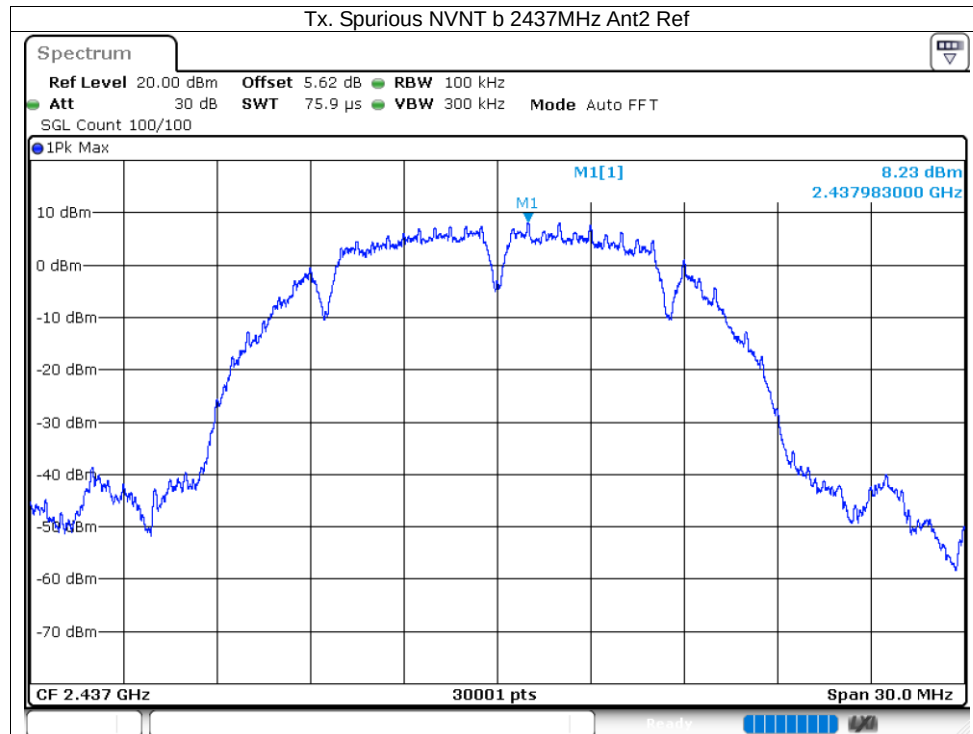


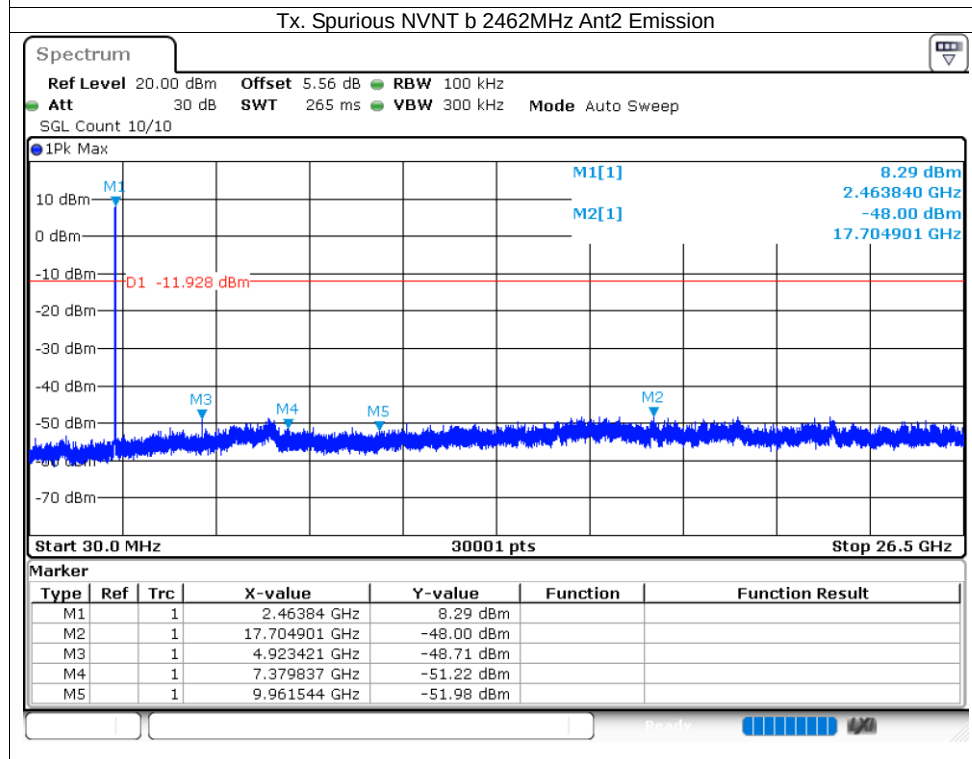
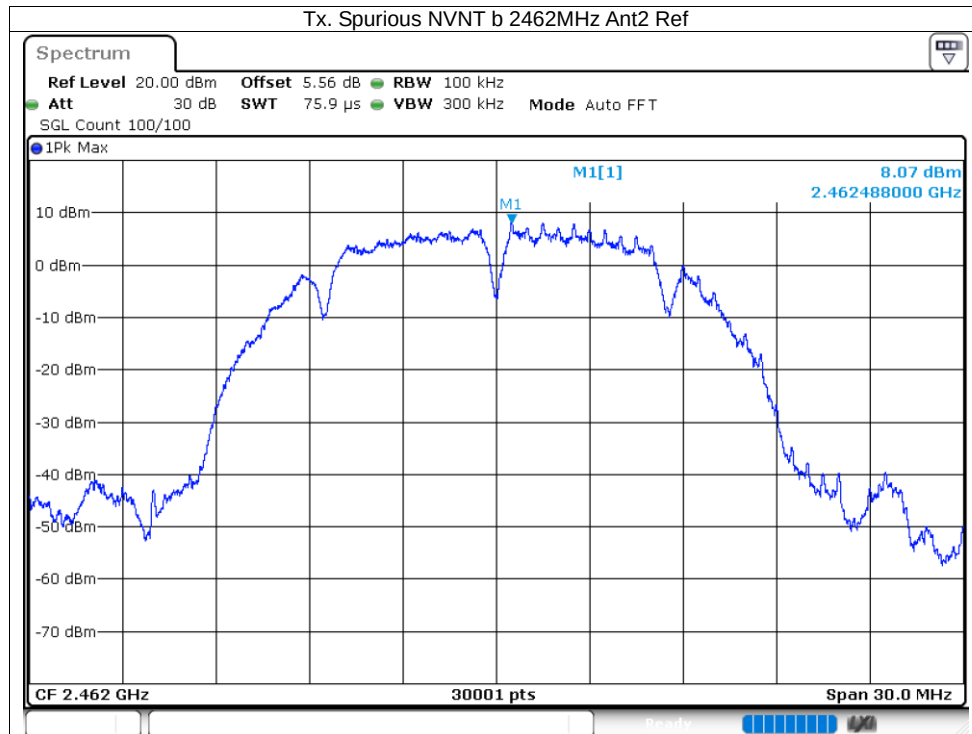


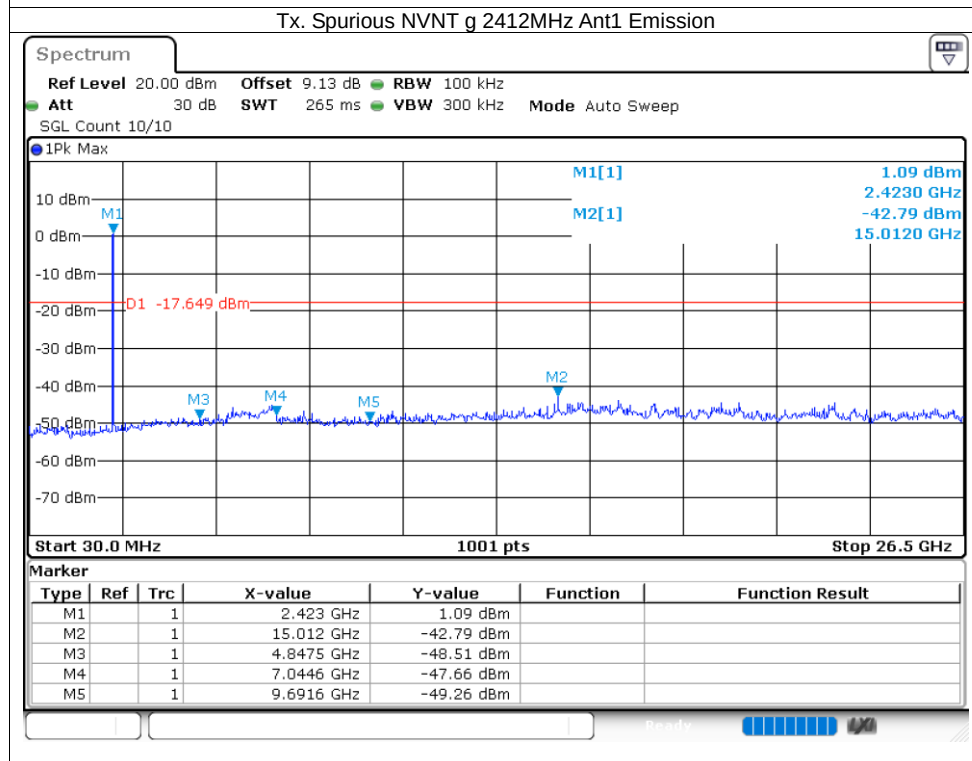
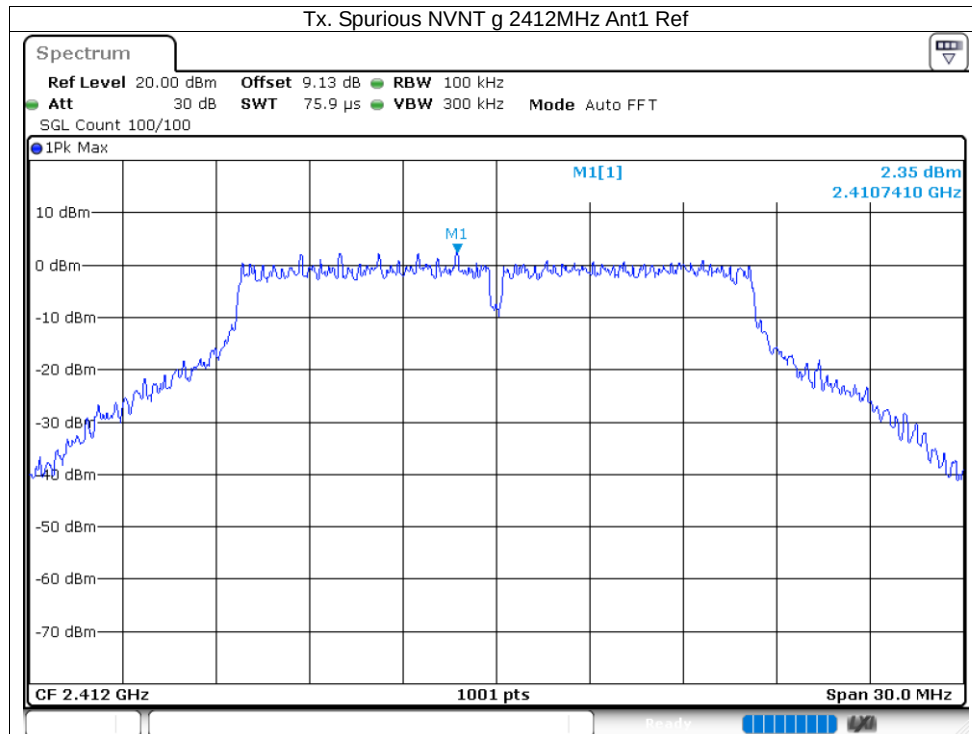


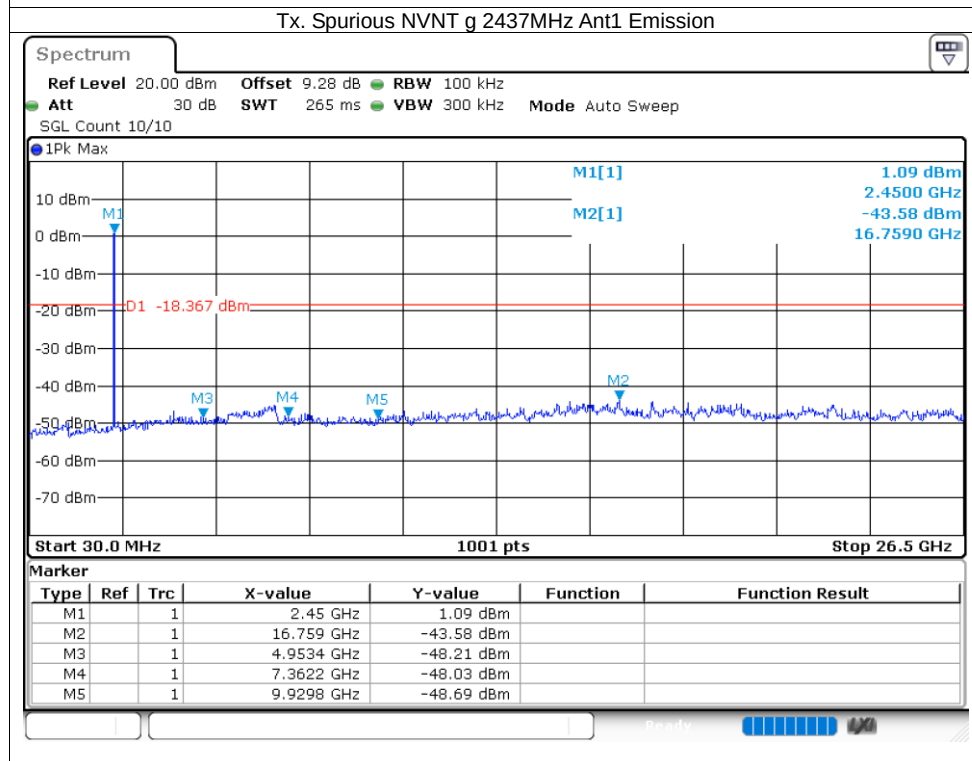
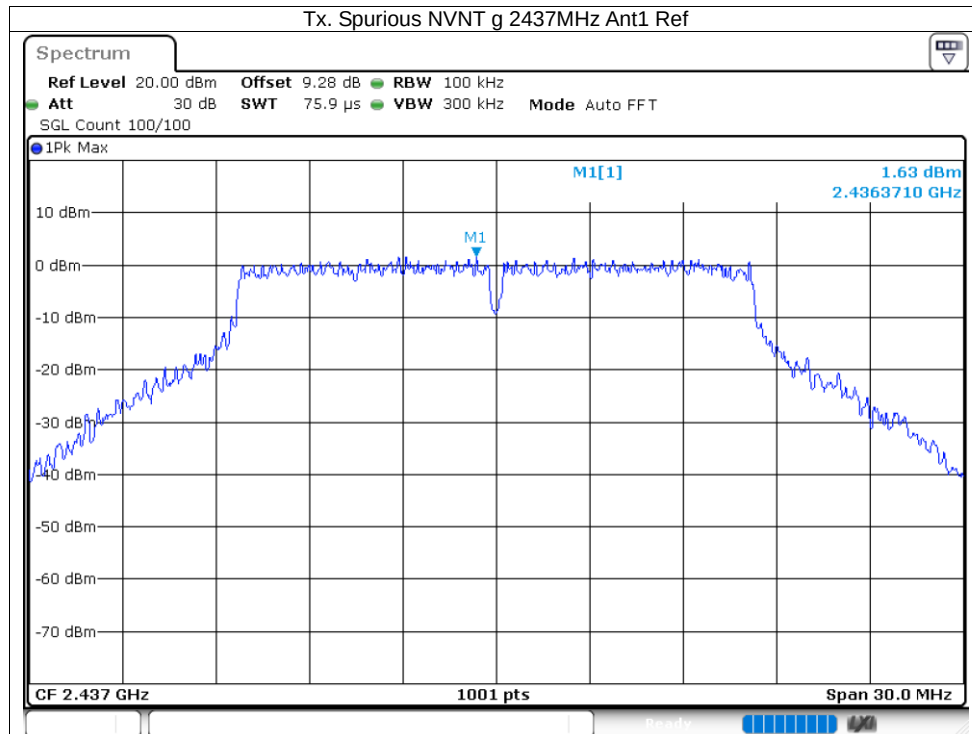


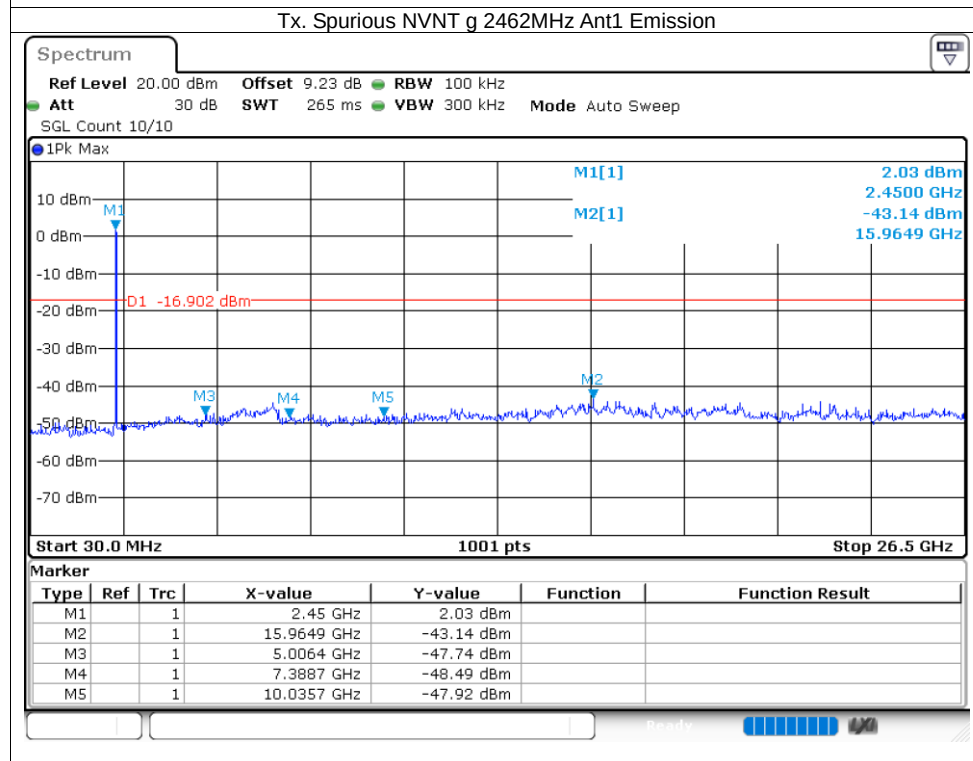
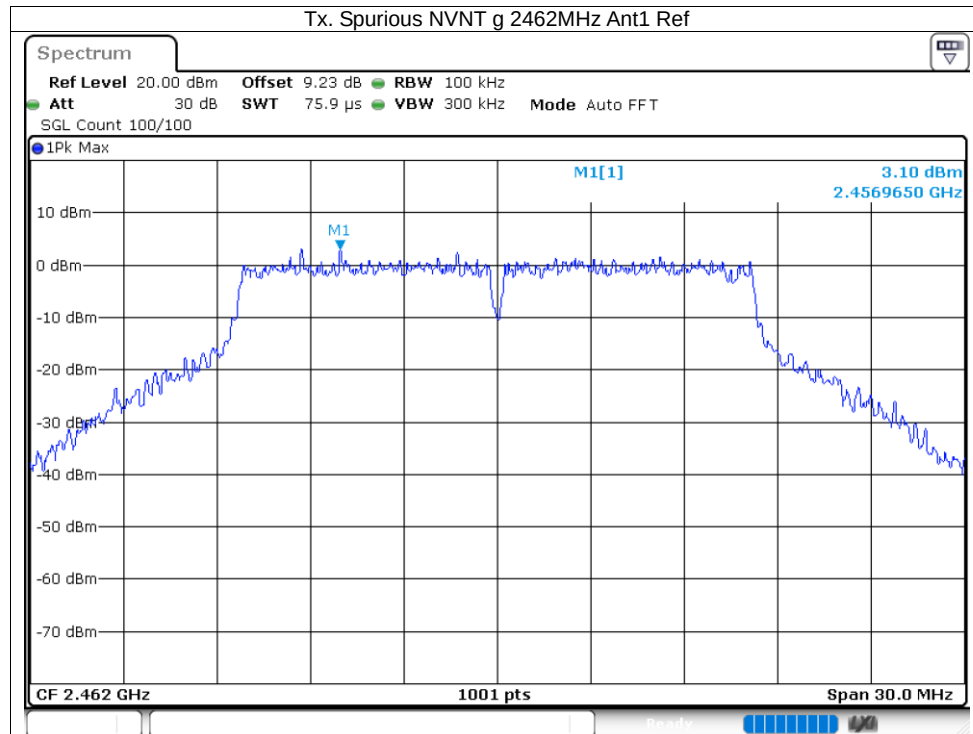


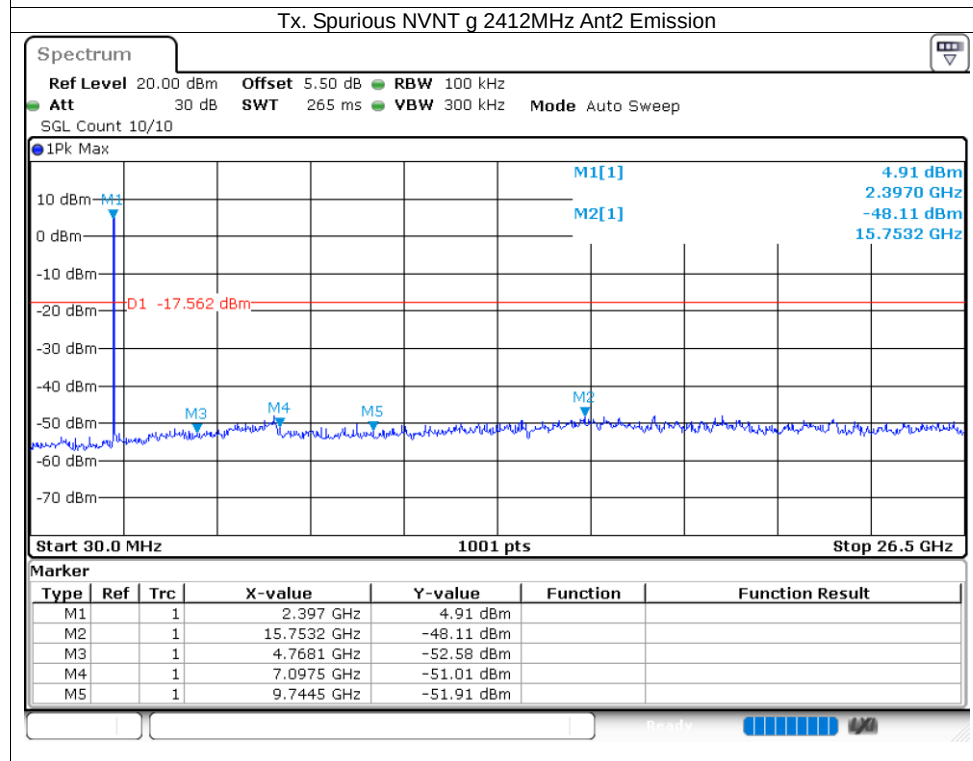
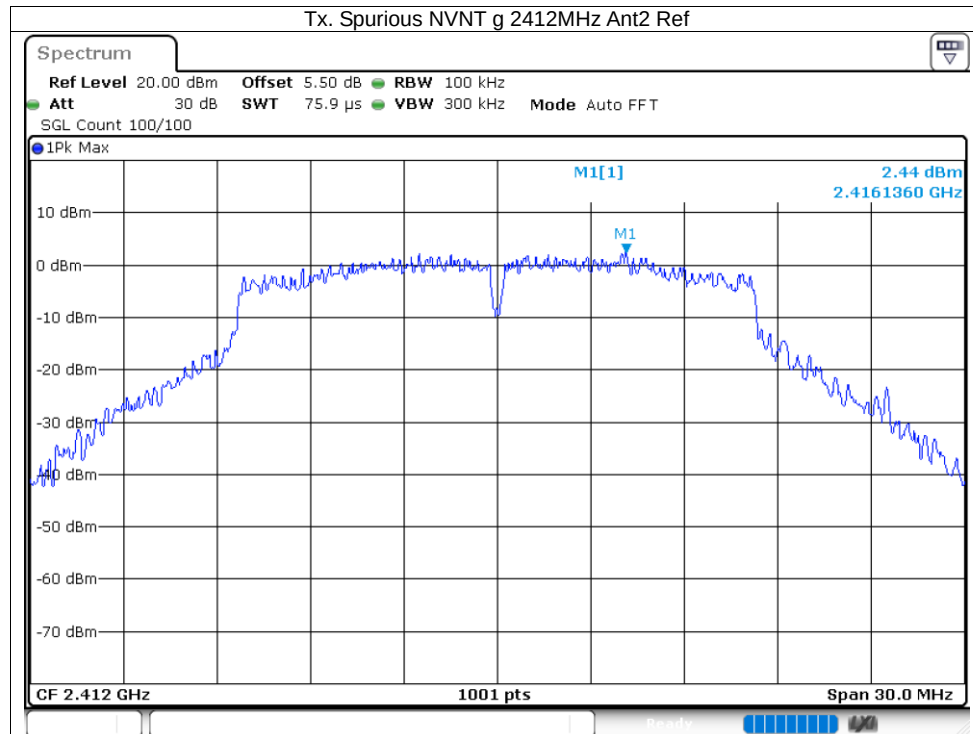


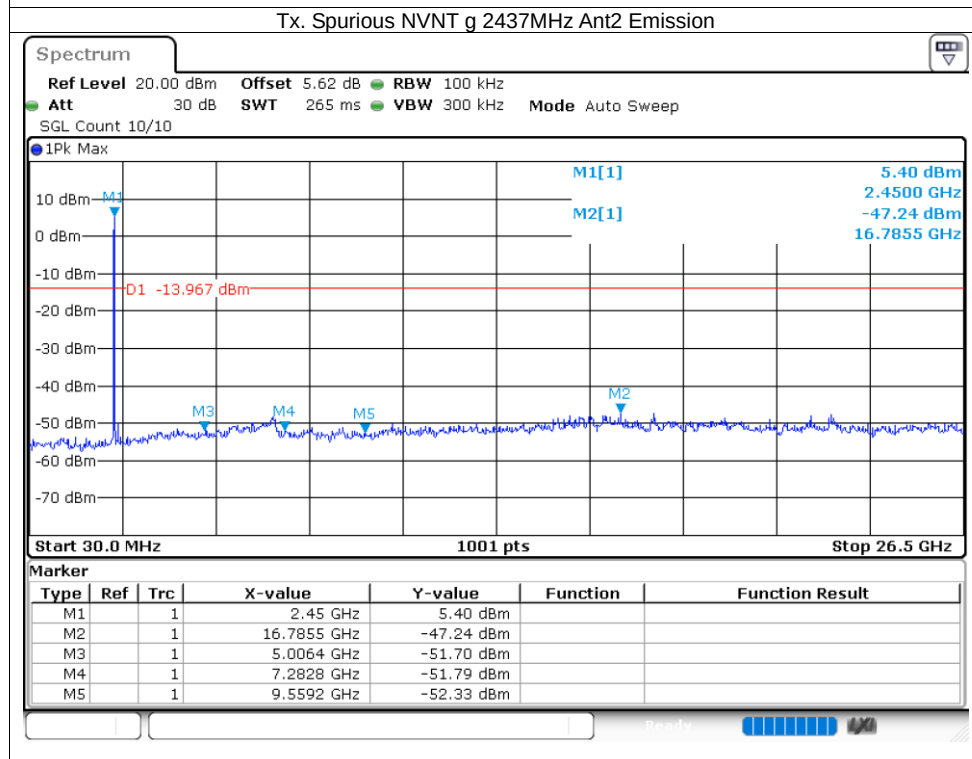
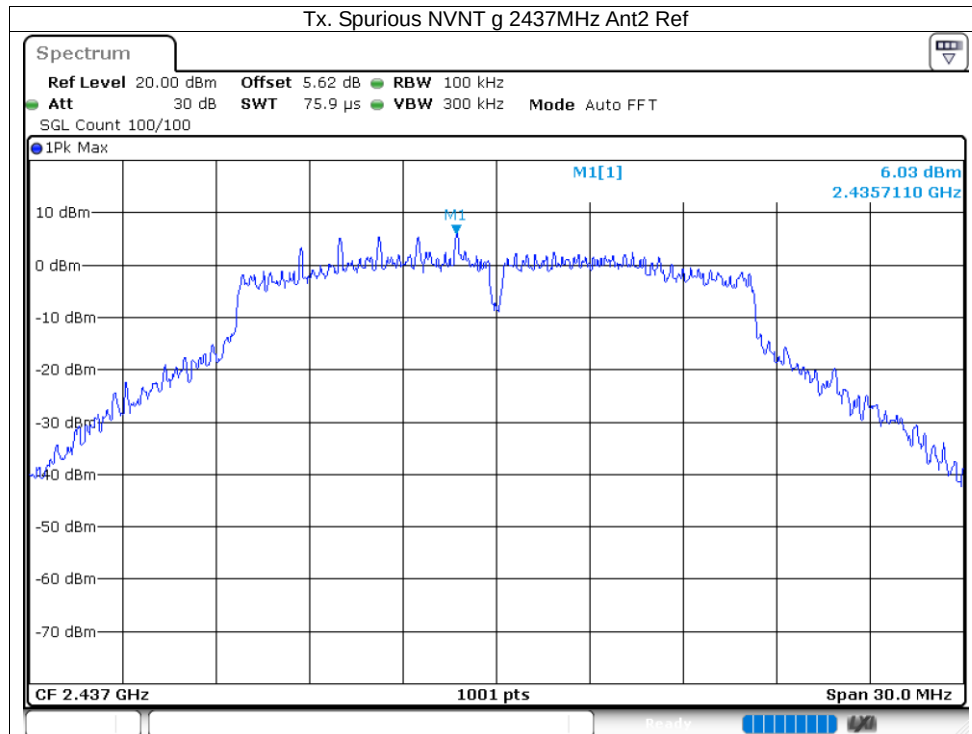


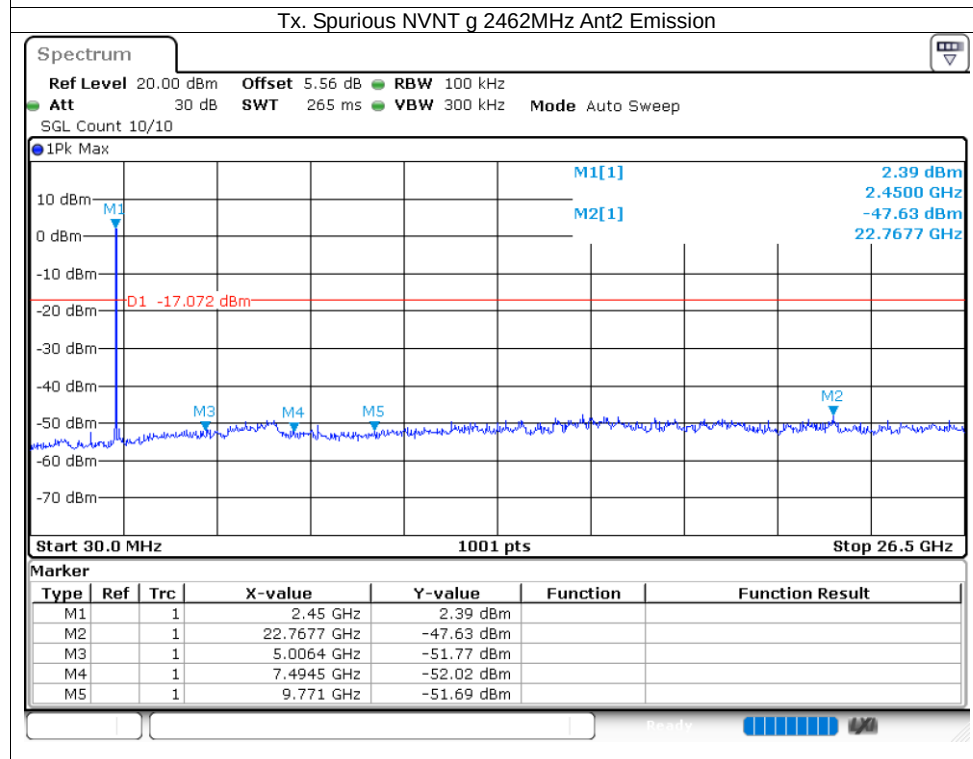
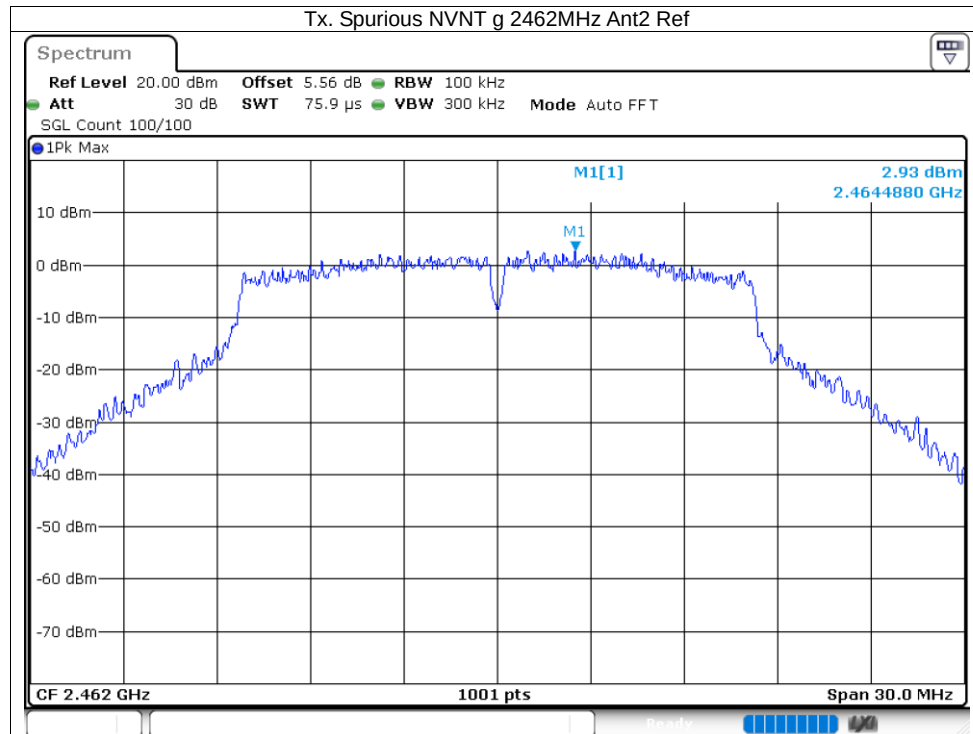


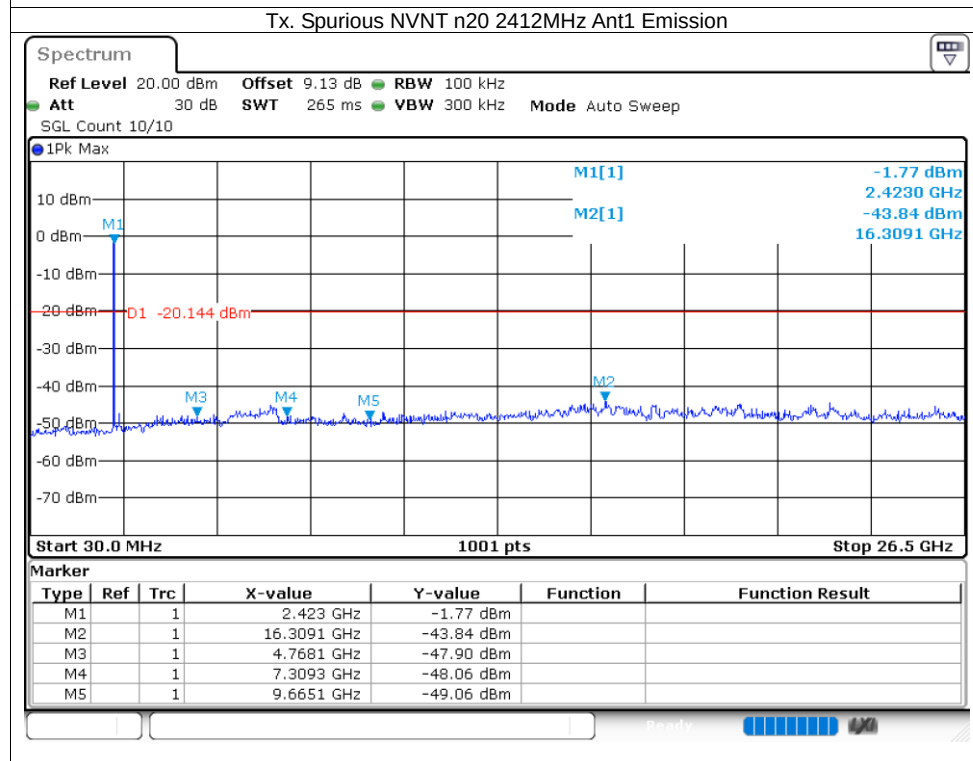
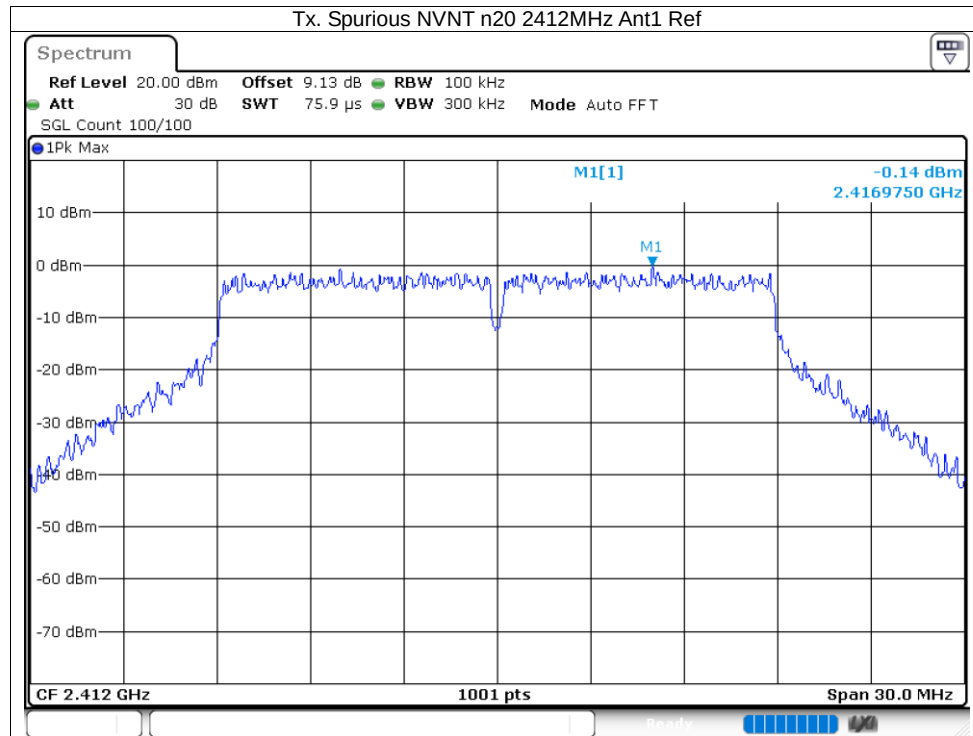


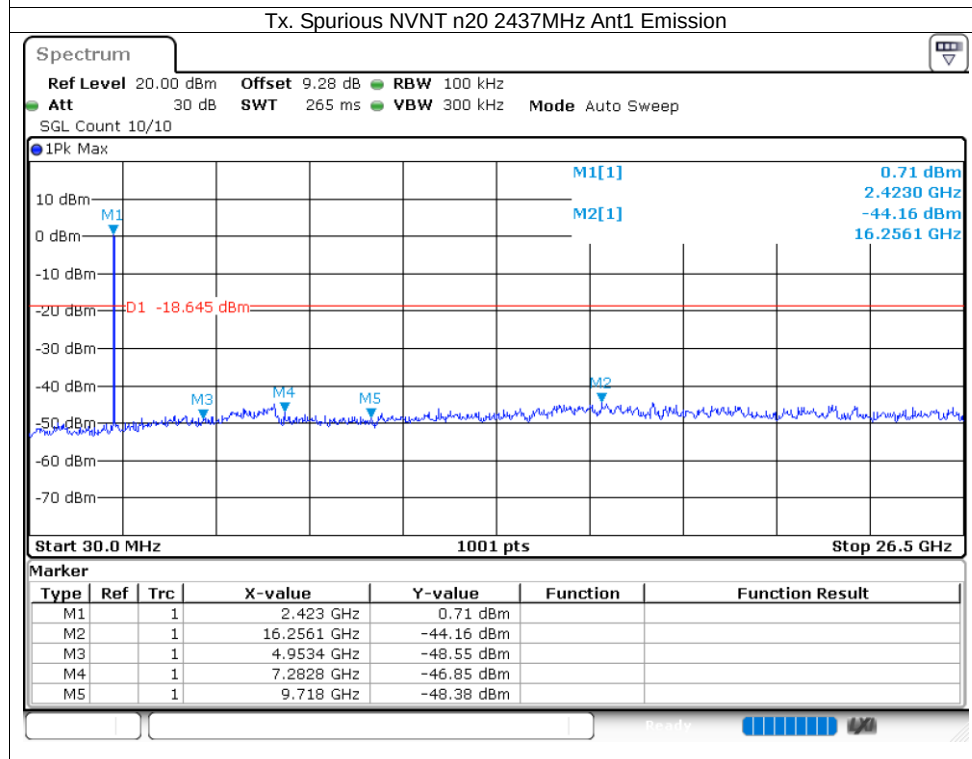
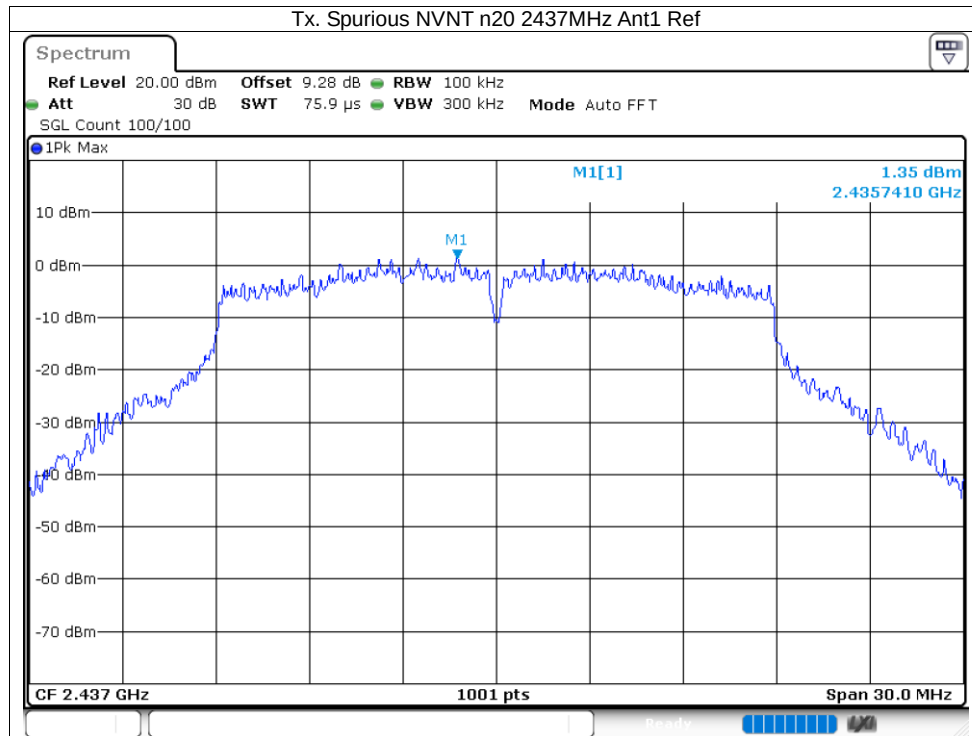


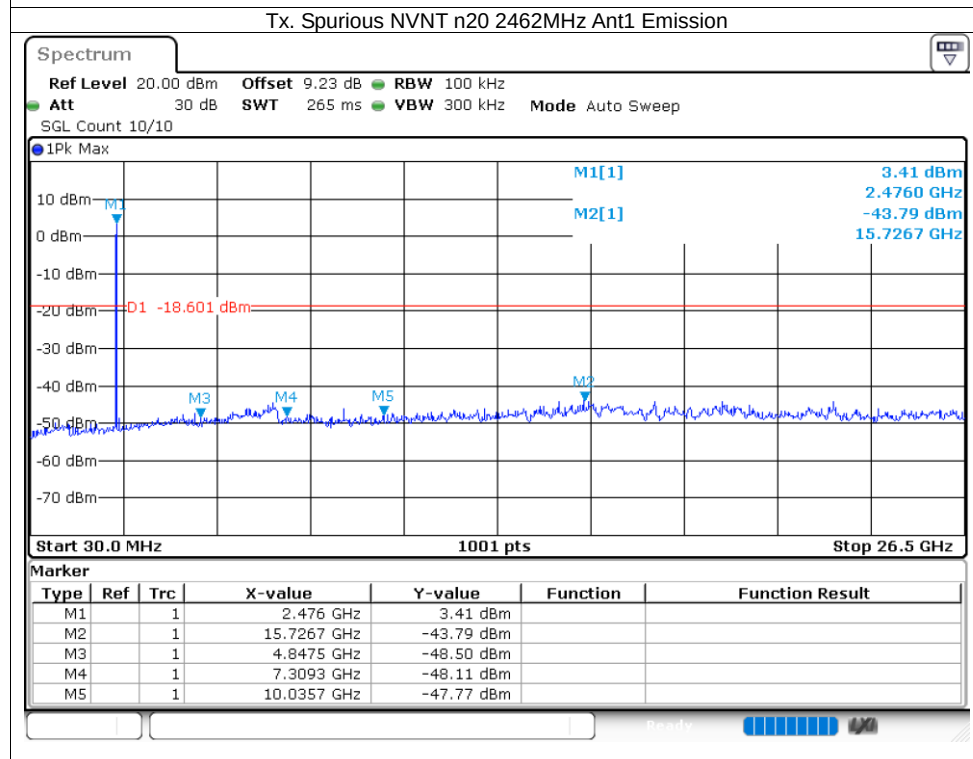
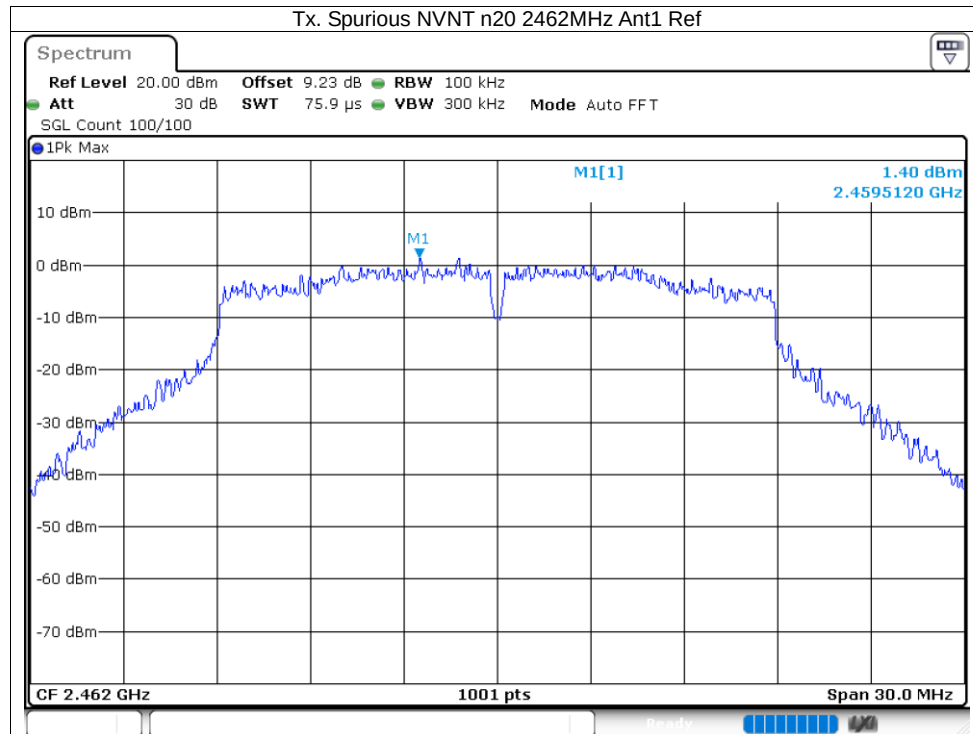


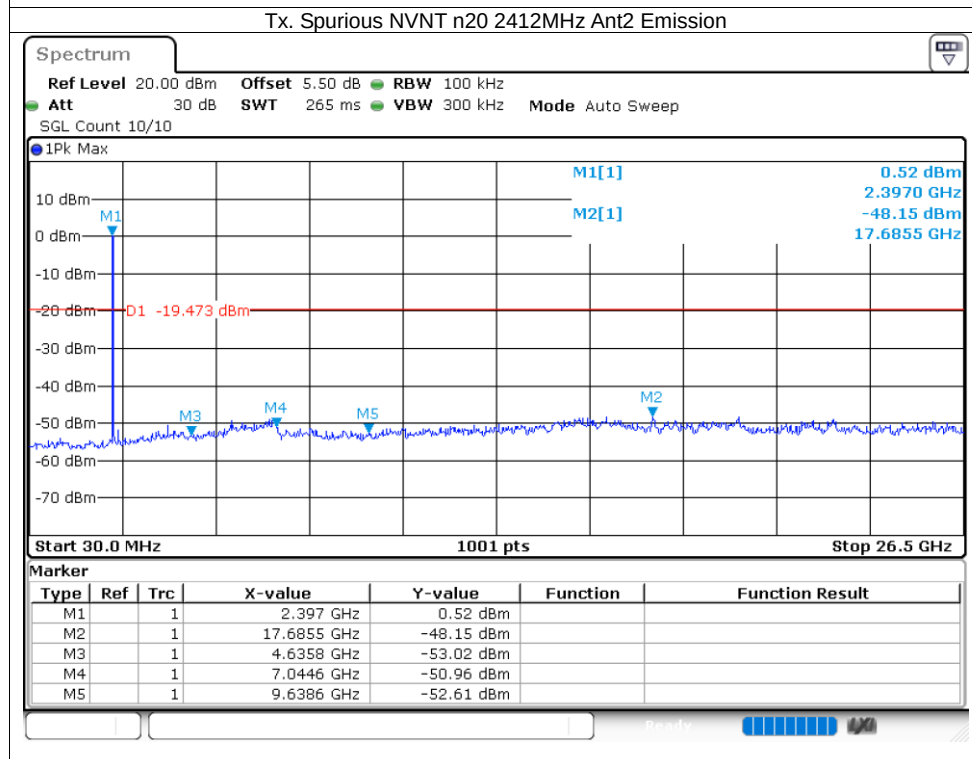
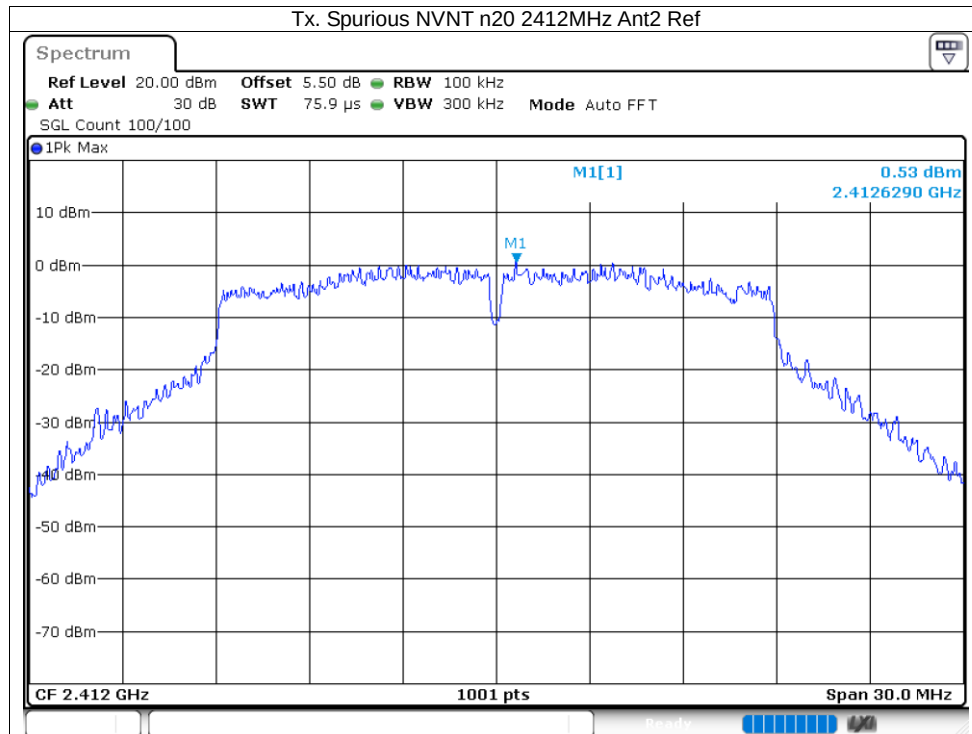


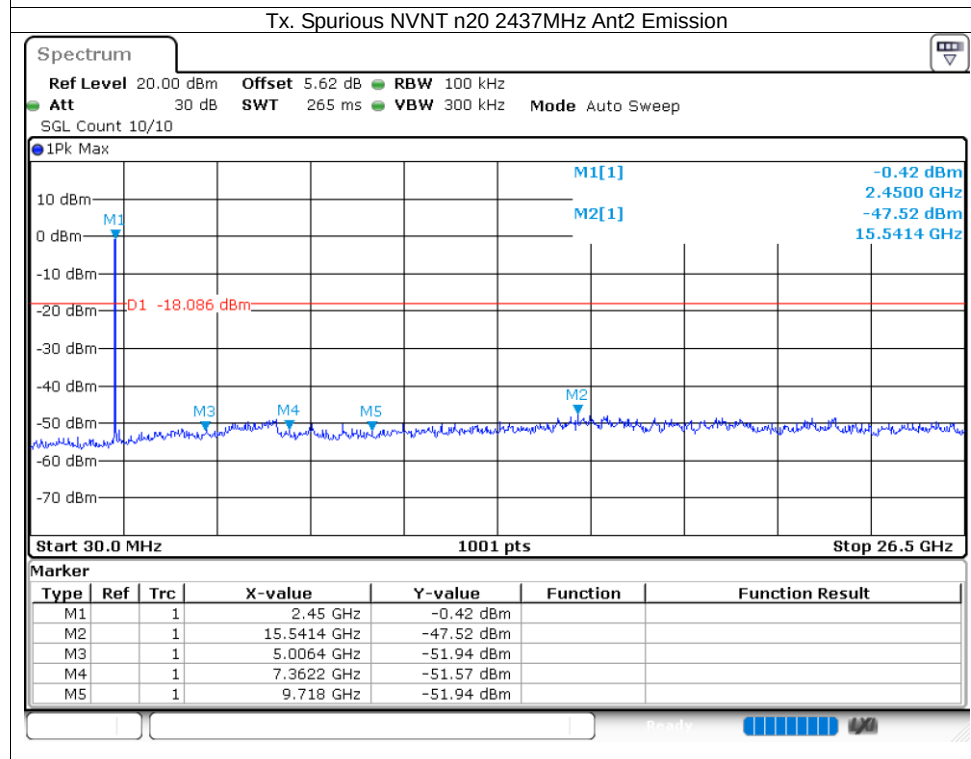
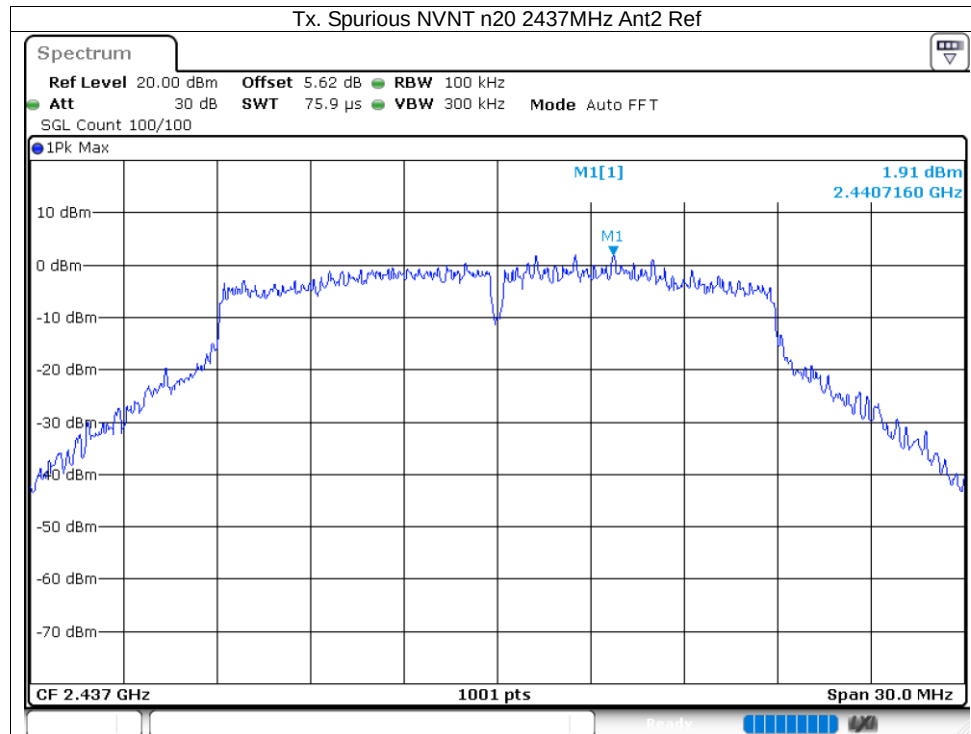


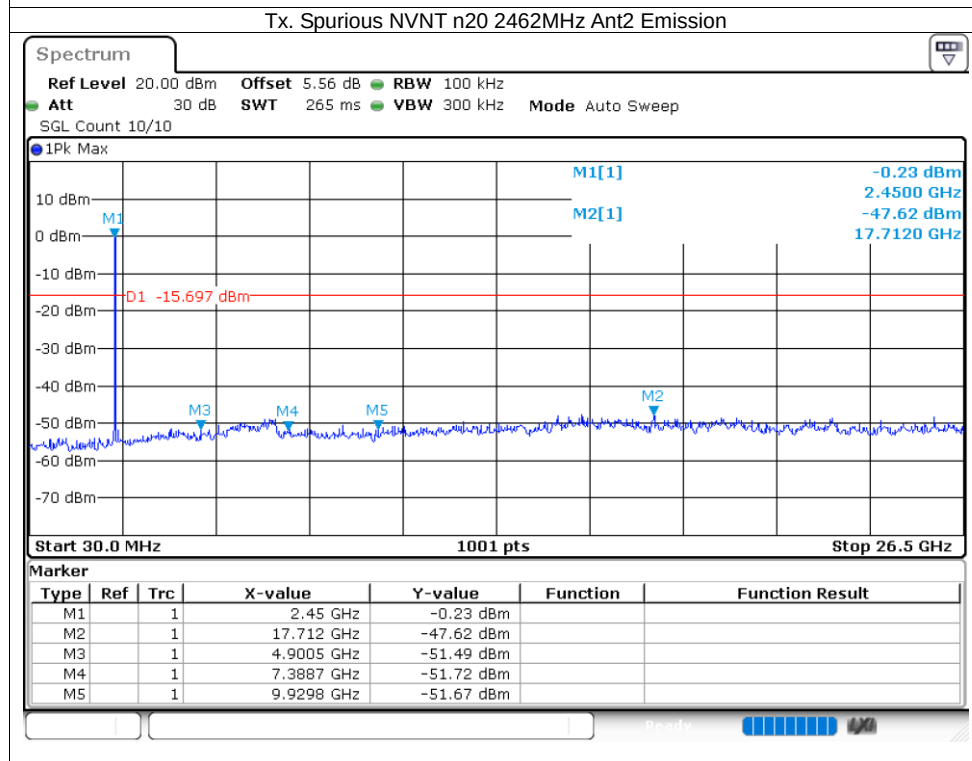
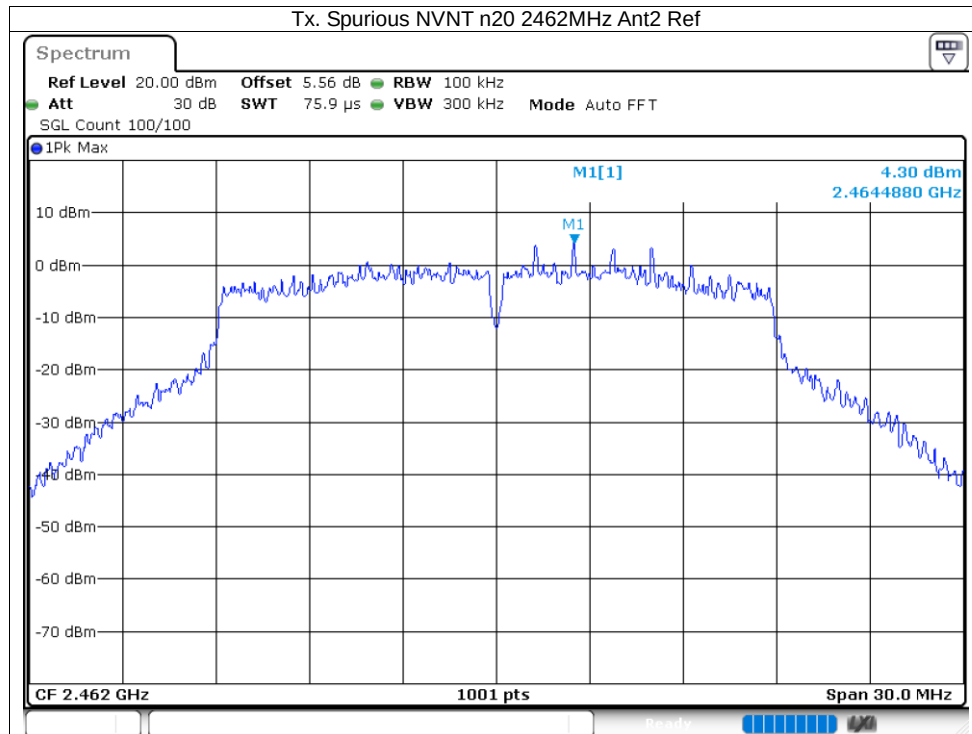


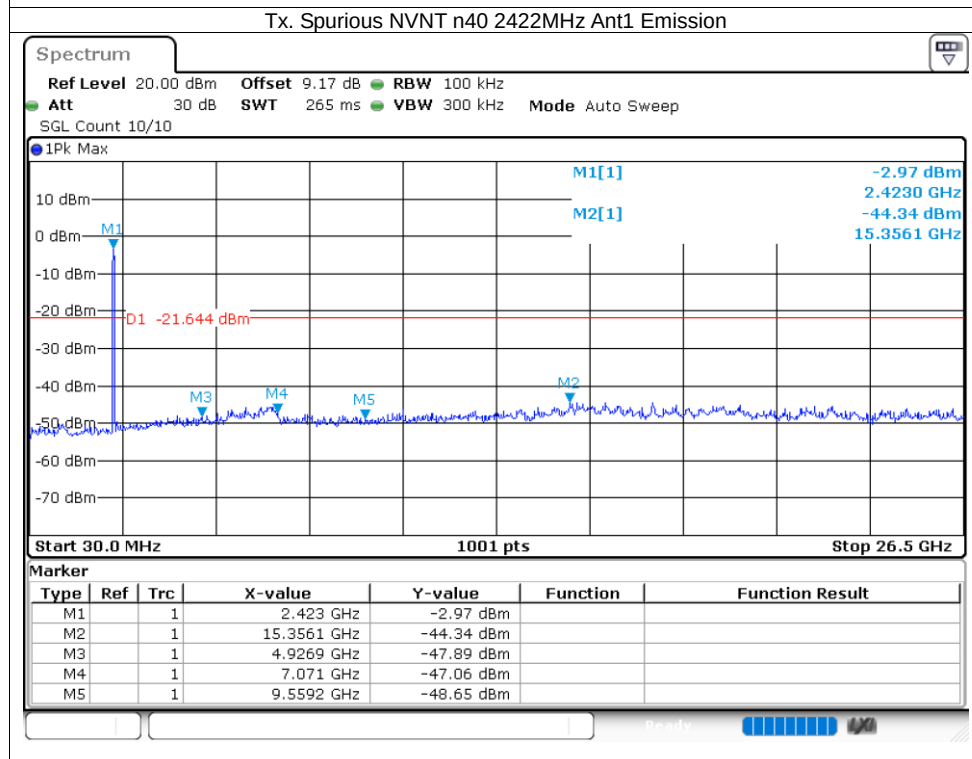
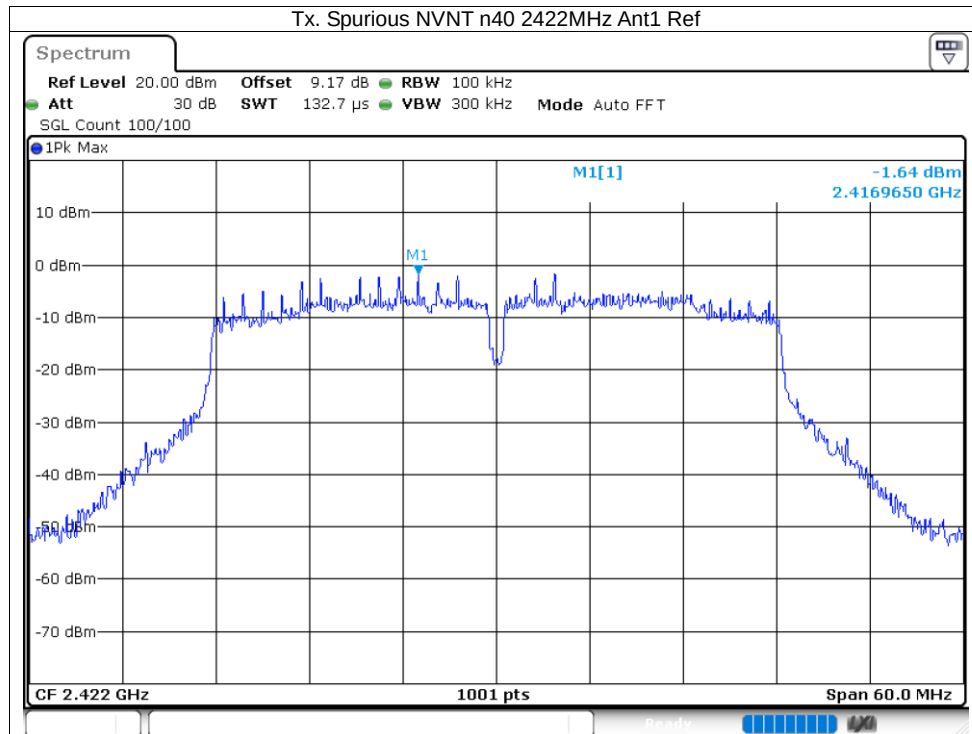


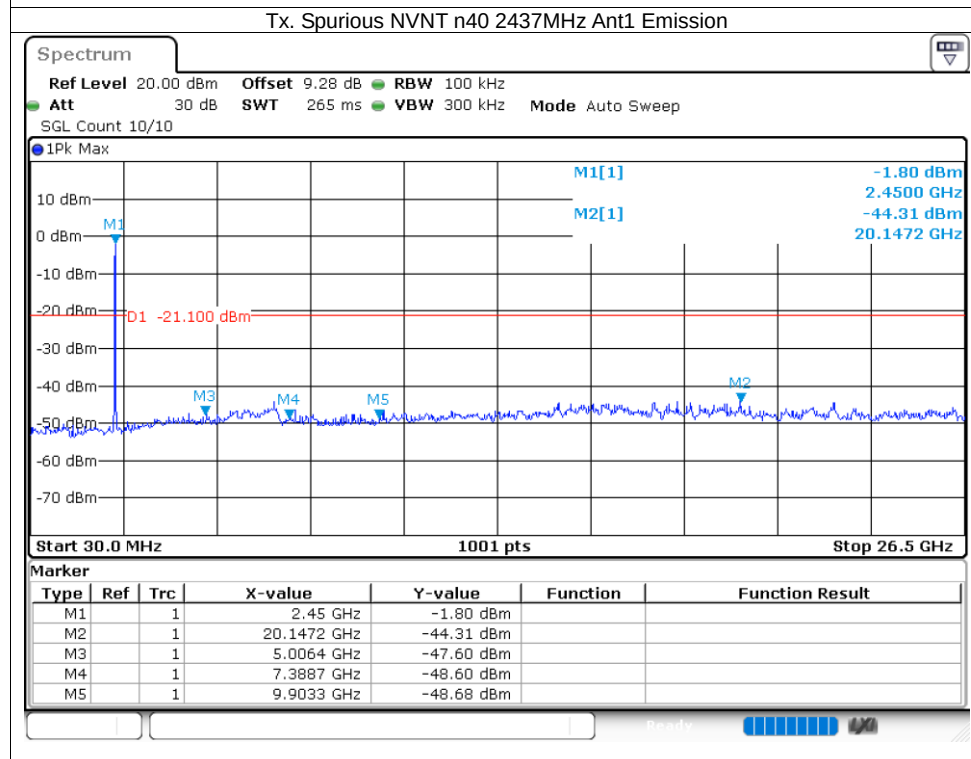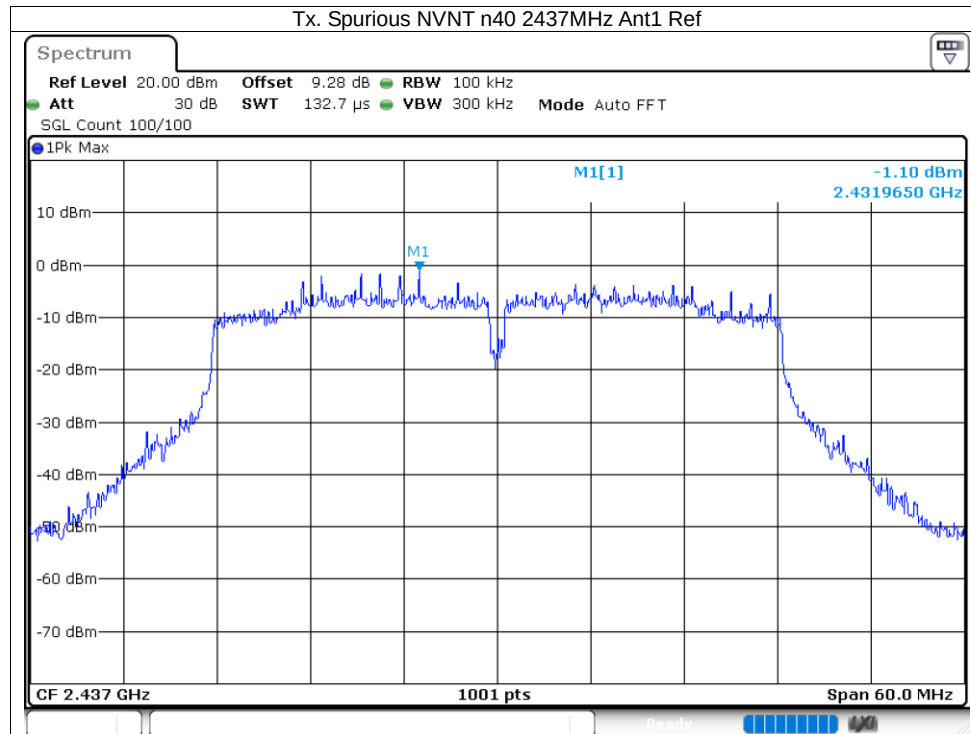

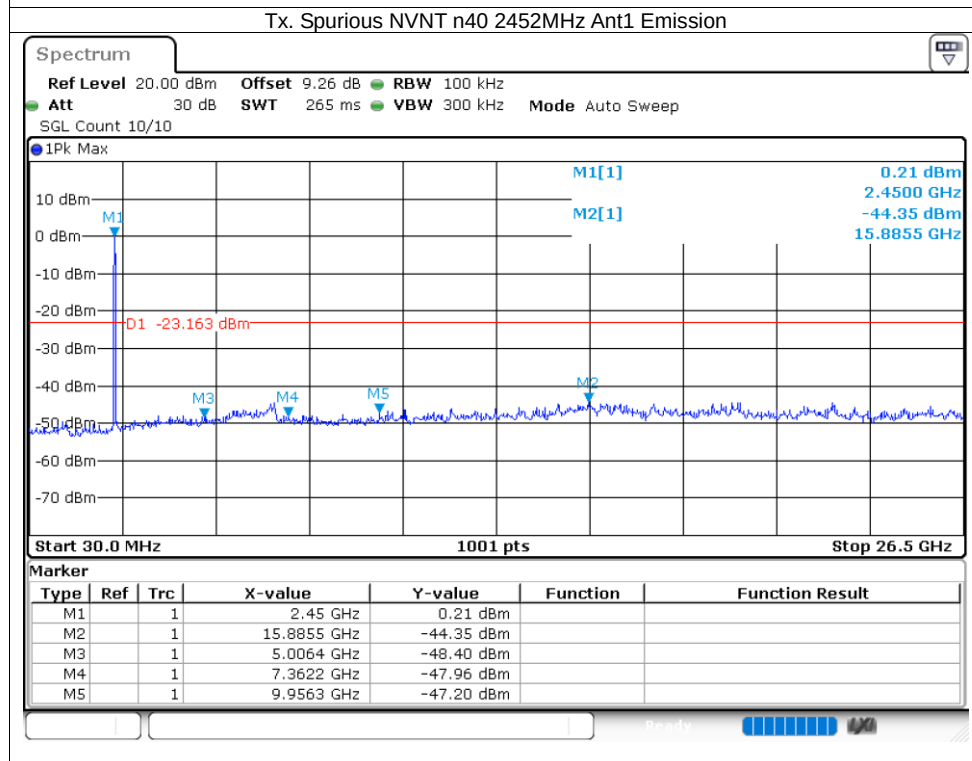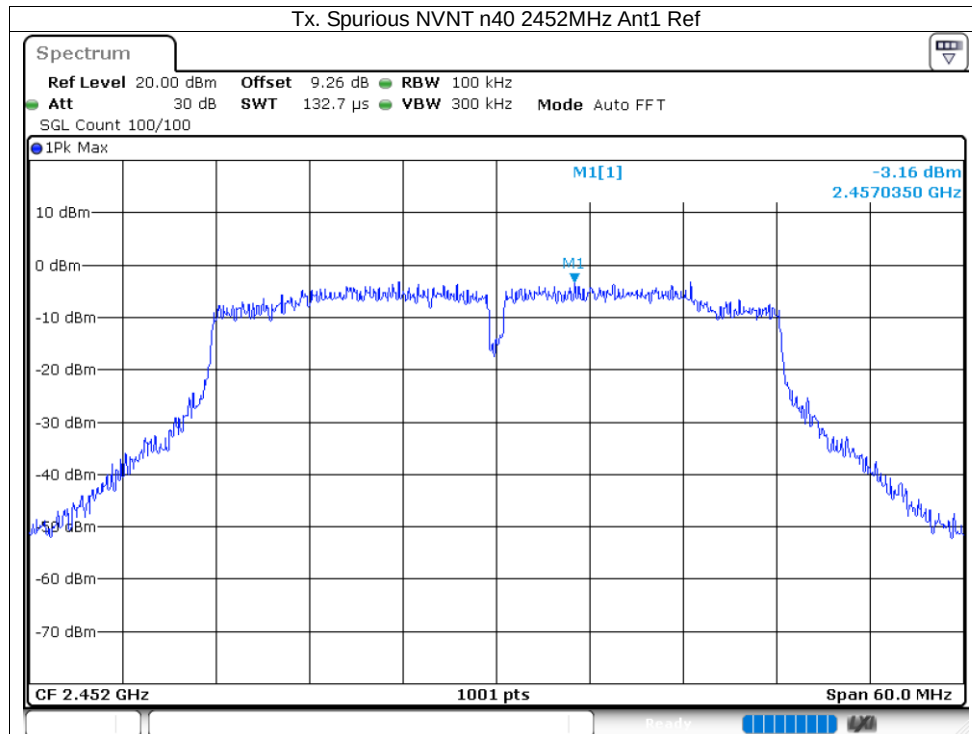

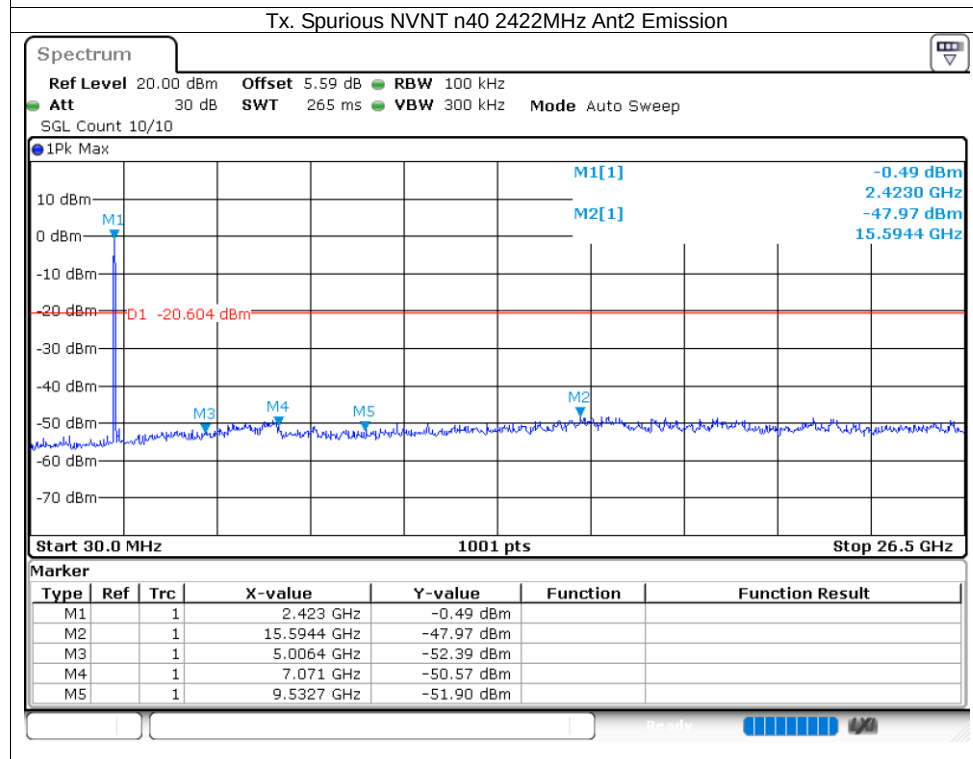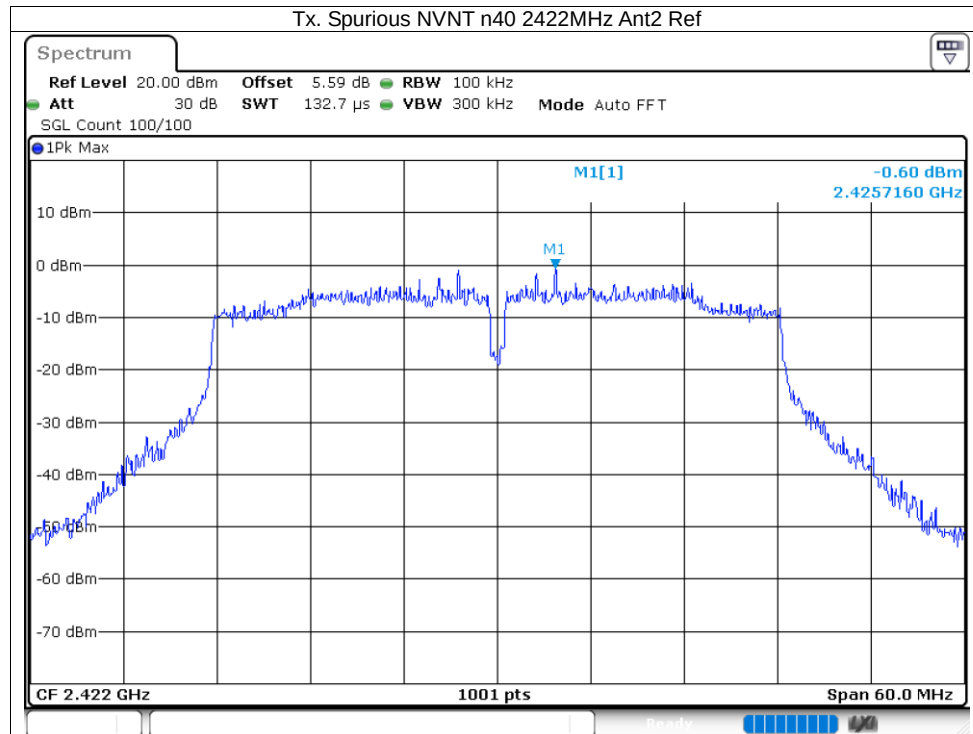

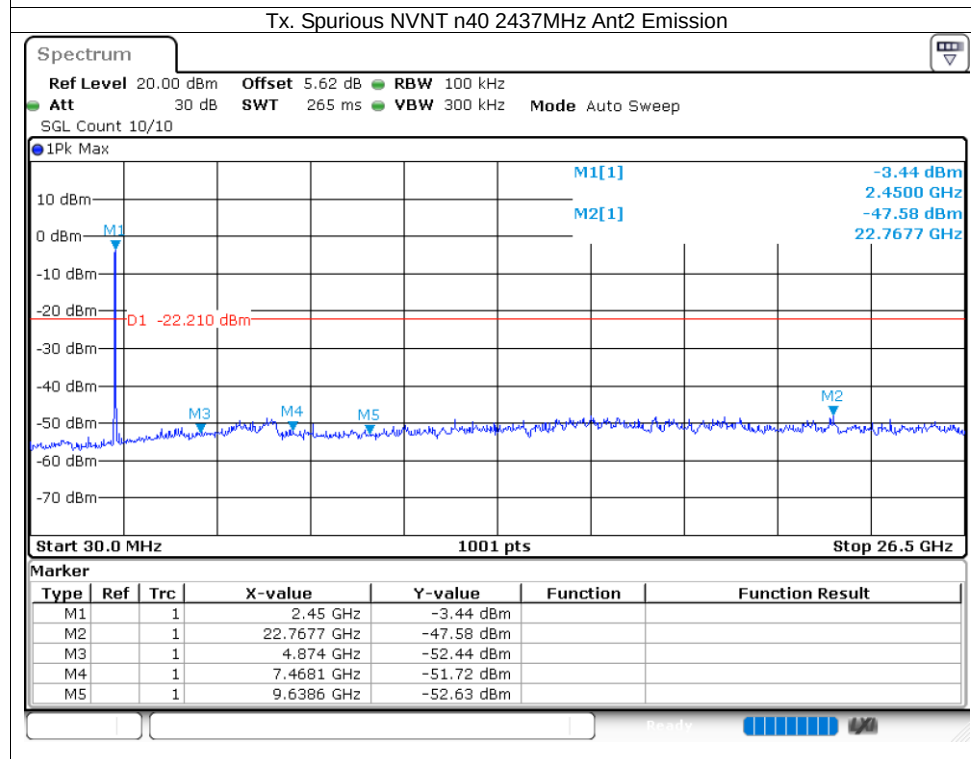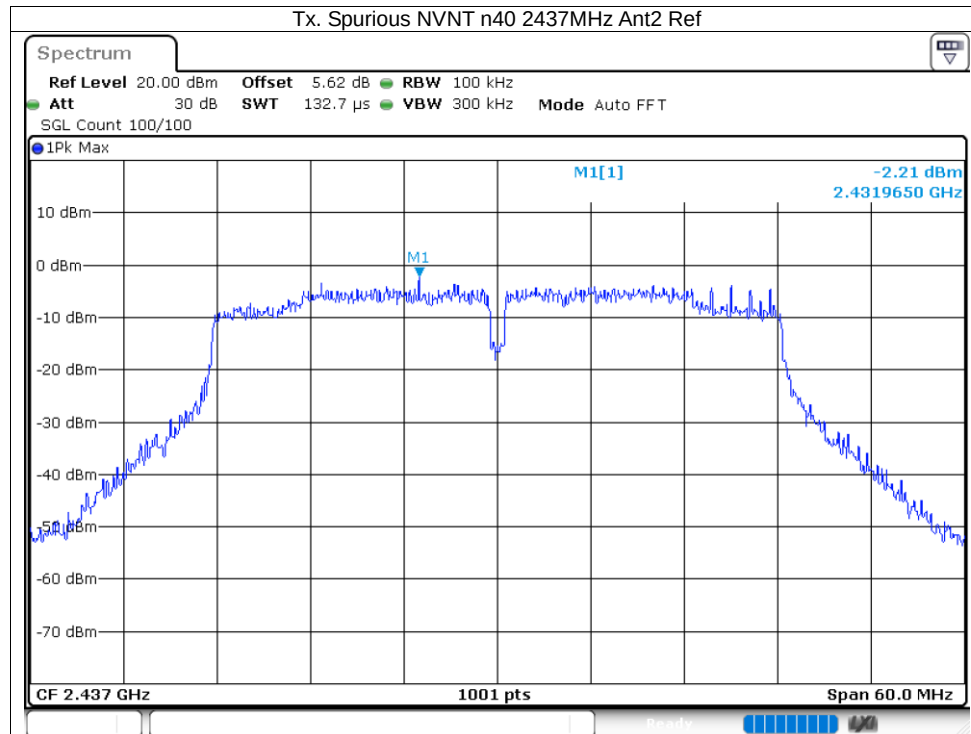

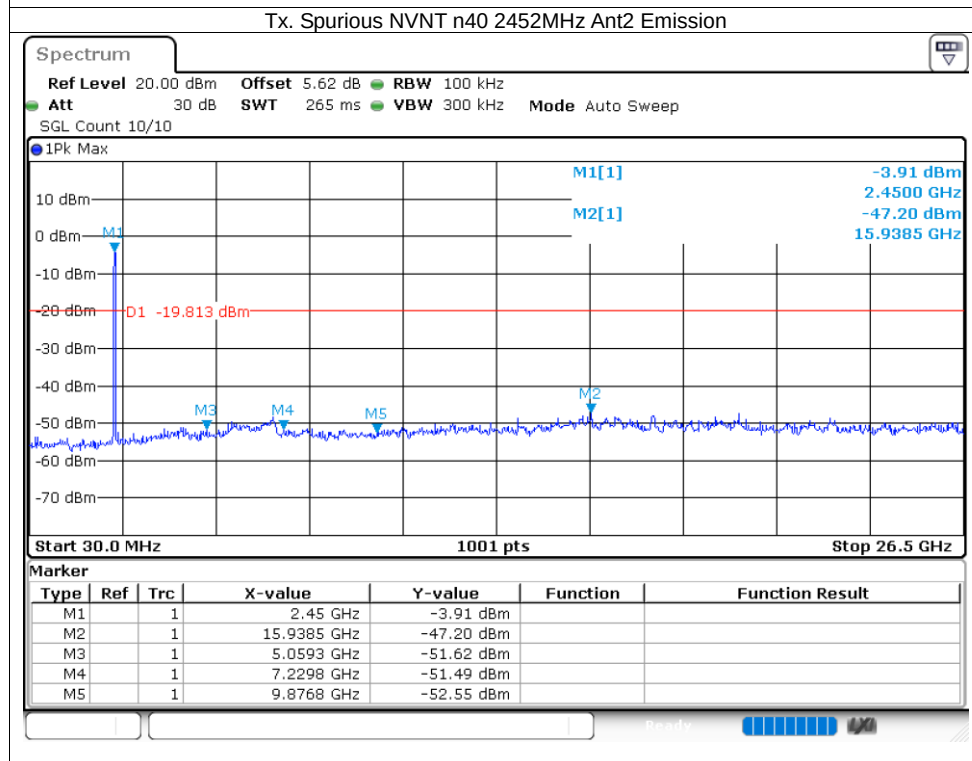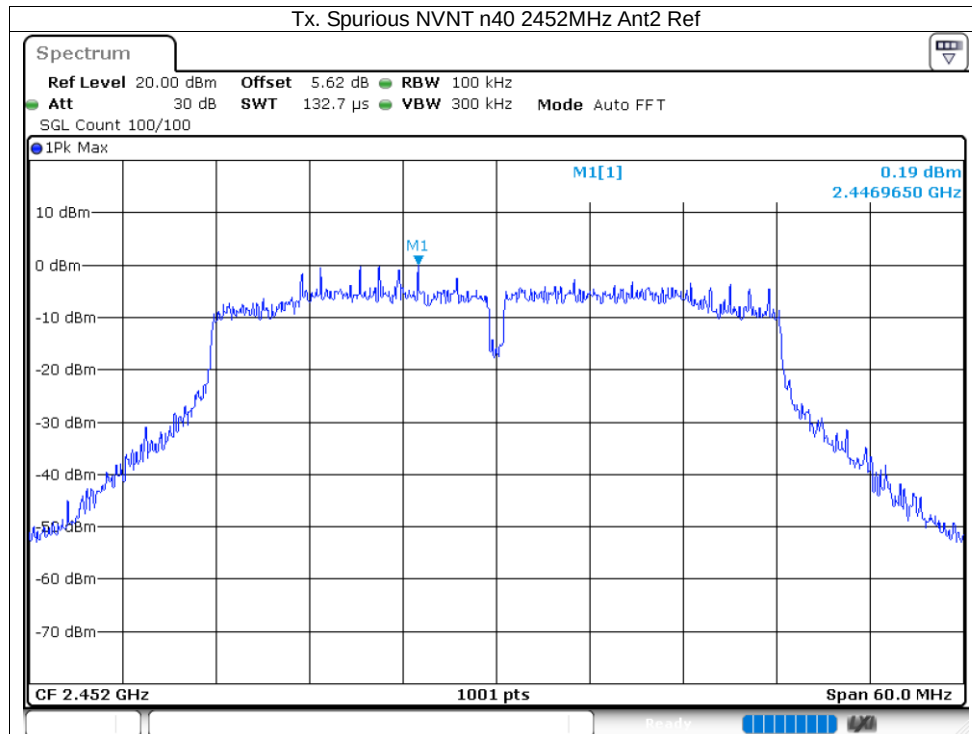

END OF REPORT