



Address:No.99,Sec.1,Balian Rd.,Xizhi Dist.,New Taipei City  
Tel:+886-2-2646-1508  
Fax:+886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File :3

Data :#5


Date: 2024/4/1

Temperature:23.6 °C

90.0 dBuV/m

Time: 上午 10:52:19

Humidity:64.3 %

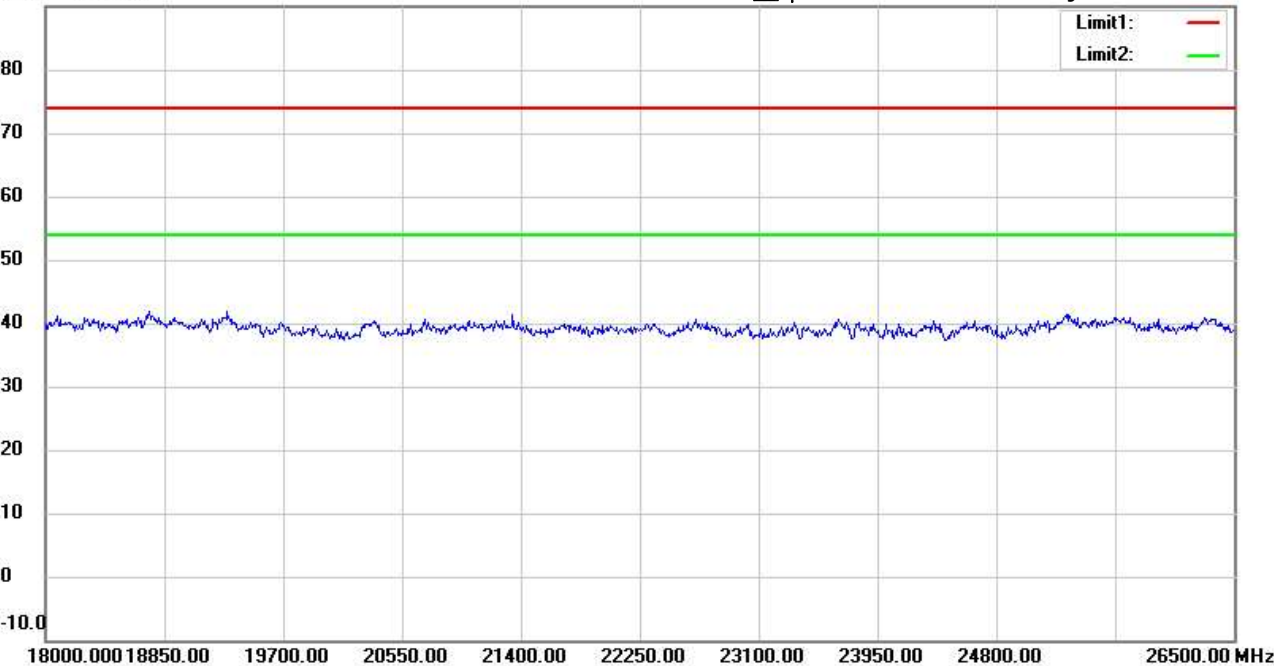

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: *Horizontal*

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|

\*:Maximum data    x:Over limit    !:over margin



Address:No.99,Sec.1,Balian Rd.,Xizhi Dist.,New Taipei City  
Tel:+886-2-2646-1508  
Fax:+886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File :3

Data :#11


Date: 2024/4/1

Temperature:23.6 °C

90.0 dBuV/m

Time: 上午 10:55:44

Humidity:64.3 %

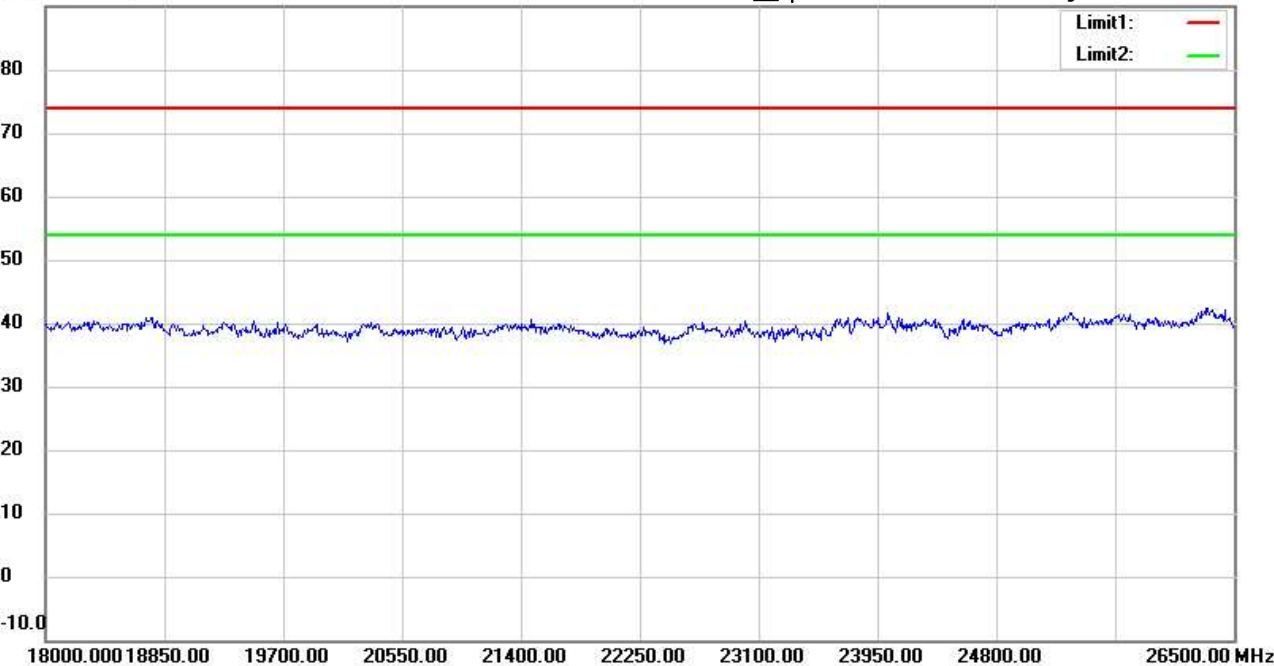

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: Vertical

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|

\*:Maximum data x:Over limit !:over margin



Address:No.99,Sec.1,Balian Rd.,Xizhi Dist.,New Taipei City  
Tel:+886-2-2646-1508  
Fax:+886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File :3

Data :#6


Date: 2024/4/1

Temperature:23.6 °C

90.0 dBuV/m

Time: 上午 10:52:29

Humidity:64.3 %

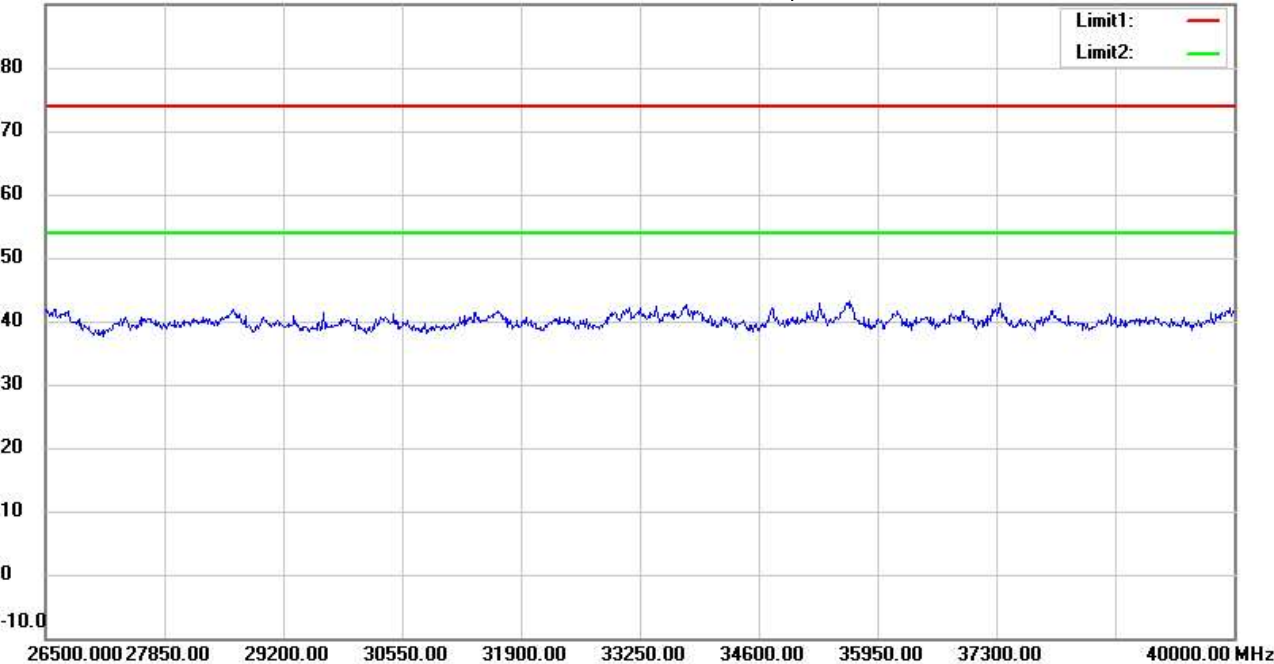

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: *Horizontal*

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|

\*:Maximum data    x:Over limit    !:over margin



Address:No.99,Sec.1,Balian Rd.,Xizhi Dist.,New Taipei City  
Tel:+886-2-2646-1508  
Fax:+886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File :3

Data :#12


Date: 2024/4/1

Temperature:23.6 °C

90.0 dBuV/m

Time: 上午 10:55:55

Humidity:64.3 %

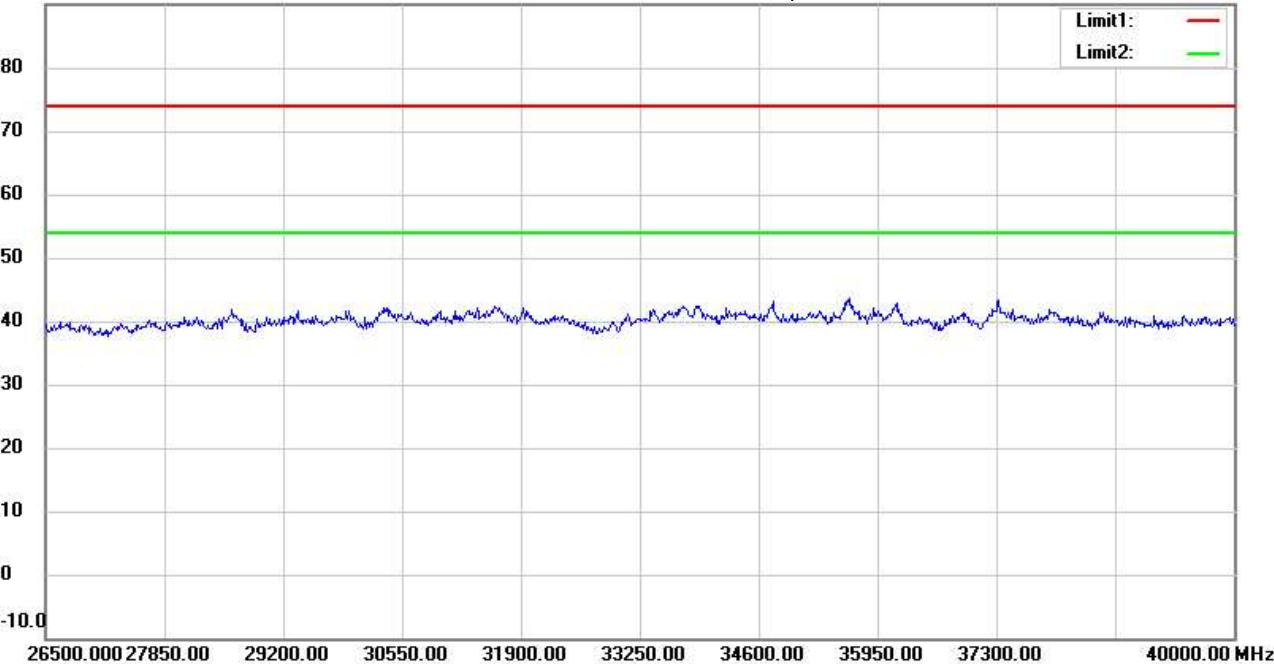

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH165

Note :

Polarization: Vertical

Power : 3.3 Vd.c.


Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|

\*:Maximum data    x:Over limit    !:over margin



Address:No.99,Sec.1,Balian Rd.,Xizhi Dist.,New Taipei City  
Tel:+886-2-2646-1508  
Fax:+886-2-2646-1533

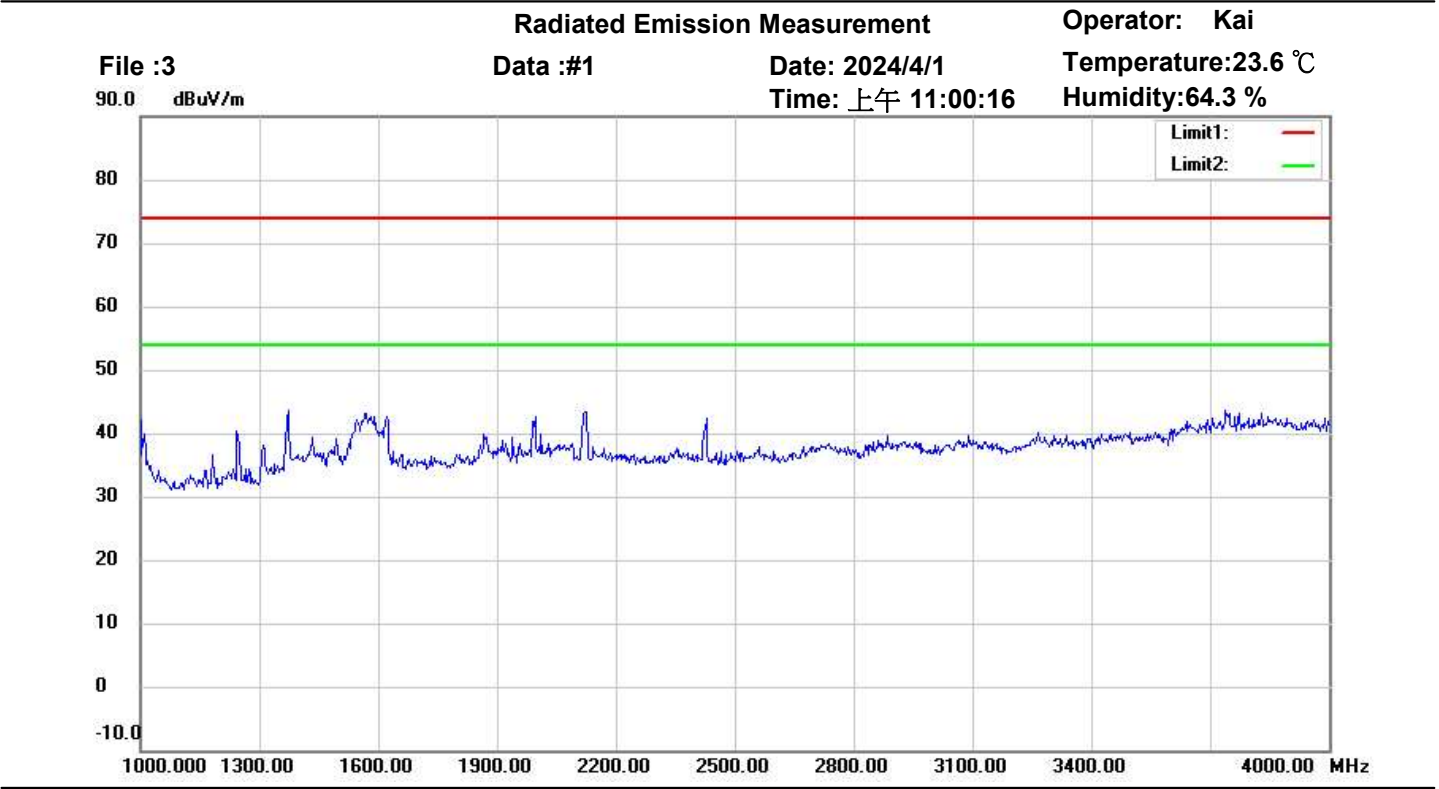

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: Horizontal

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|

\*:Maximum data    x:Over limit    !:over margin



Address: No. 99, Sec. 1, Balian Rd., Xizhi Dist., New Taipei City  
Tel: +886-2-2646-1508  
Fax: +886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #7


Date: 2024/4/1

Temperature: 23.6 °C

90.0 dBuV/m

Time: 上午 11:03:41

Humidity: 64.3 %

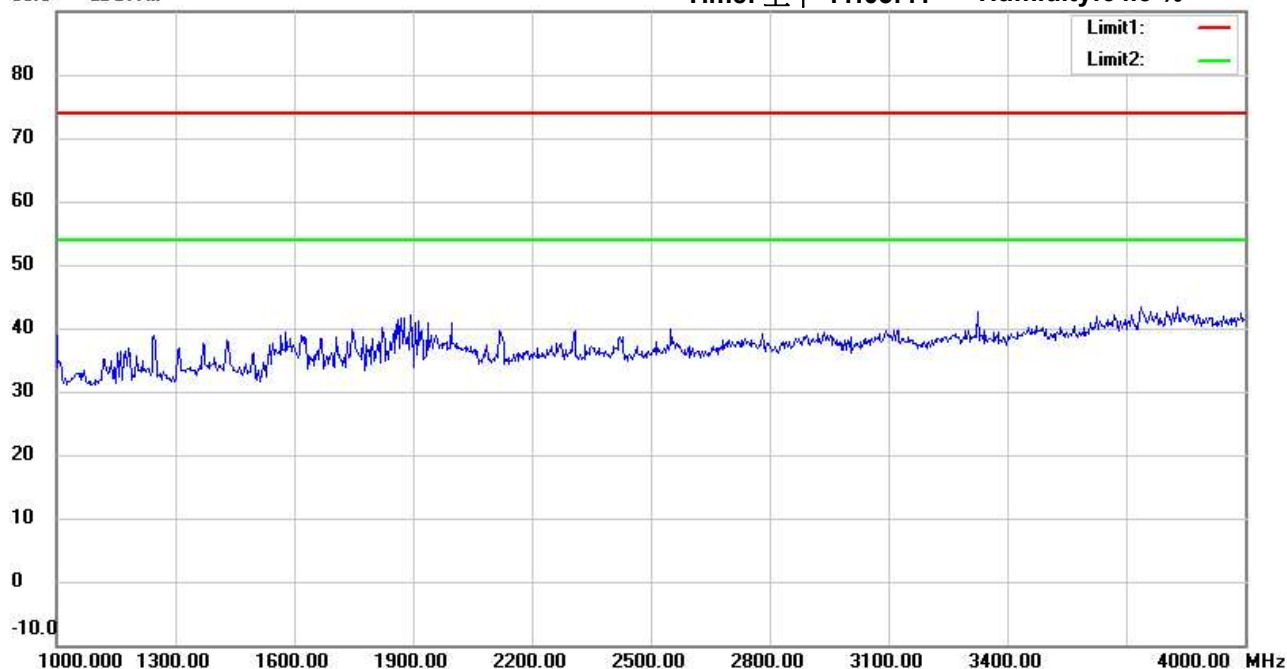

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: Vertical

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|

\*:Maximum data    x:Over limit    !:over margin



Address:No.99,Sec.1,Balian Rd.,Xizhi Dist.,New Taipei City  
Tel:+886-2-2646-1508  
Fax:+886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File :3

Data :#2


Date: 2024/4/1

Temperature:23.6 °C

90.0 dBuV/m

Time: 上午 11:00:58

Humidity:64.3 %

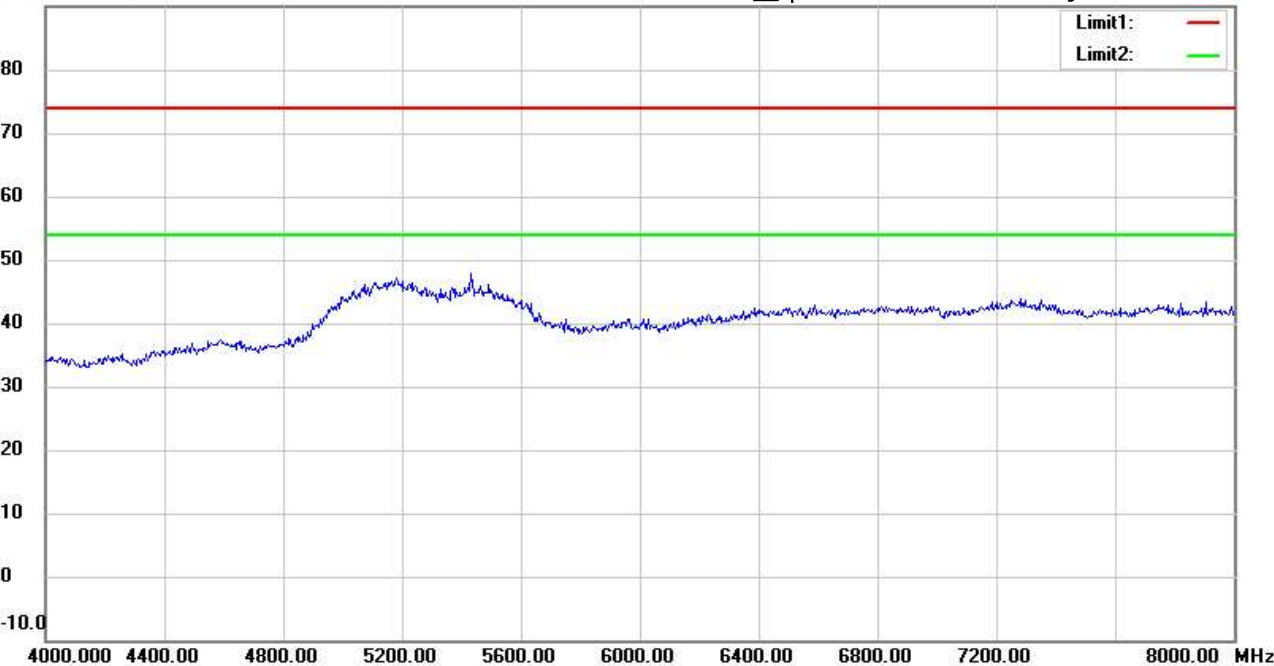

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: **Horizontal**

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|

\*:Maximum data    x:Over limit    !:over margin



Address:No.99,Sec.1,Balian Rd.,Xizhi Dist.,New Taipei City  
Tel:+886-2-2646-1508  
Fax:+886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File :3

Data :#8


Date: 2024/4/1

Temperature:23.6 °C

90.0 dBuV/m

Time: 上午 11:04:23

Humidity:64.3 %

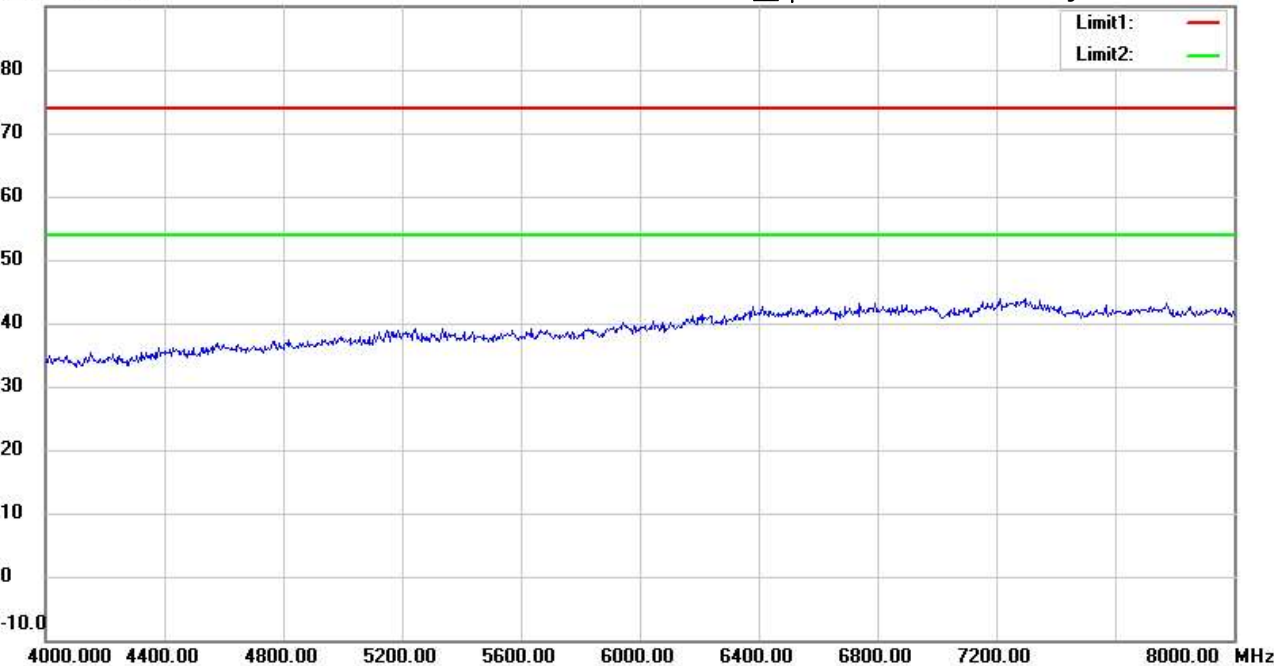

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: Vertical

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|

\*:Maximum data    x:Over limit    !:over margin



Address:No.99,Sec.1,Balian Rd.,Xizhi Dist.,New Taipei City  
Tel:+886-2-2646-1508  
Fax:+886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File :3

Data :#3


Date: 2024/4/1

Temperature:23.6 °C

90.0 dBuV/m

Time: 上午 11:01:41

Humidity:64.3 %

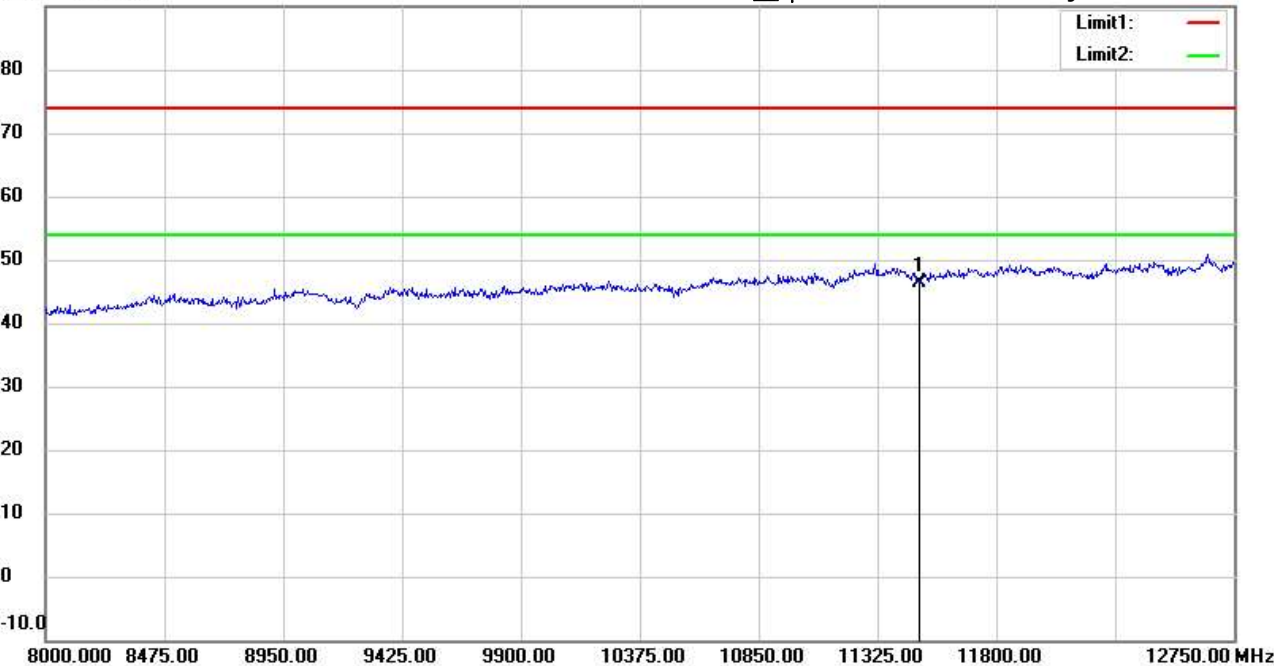

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: **Horizontal**

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
| *   | 11490.000       | 30.40          | peak     | 15.91               | 46.31           | 74.00          | 150          | 84             | -27.69      |         |

\*:Maximum data x:Over limit !:over margin



Address:No.99,Sec.1,Balian Rd.,Xizhi Dist.,New Taipei City  
Tel:+886-2-2646-1508  
Fax:+886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File :3

Data :#9


Date: 2024/4/1

Temperature:23.6 °C

90.0 dBuV/m

Time: 上午 11:05:06

Humidity:64.3 %

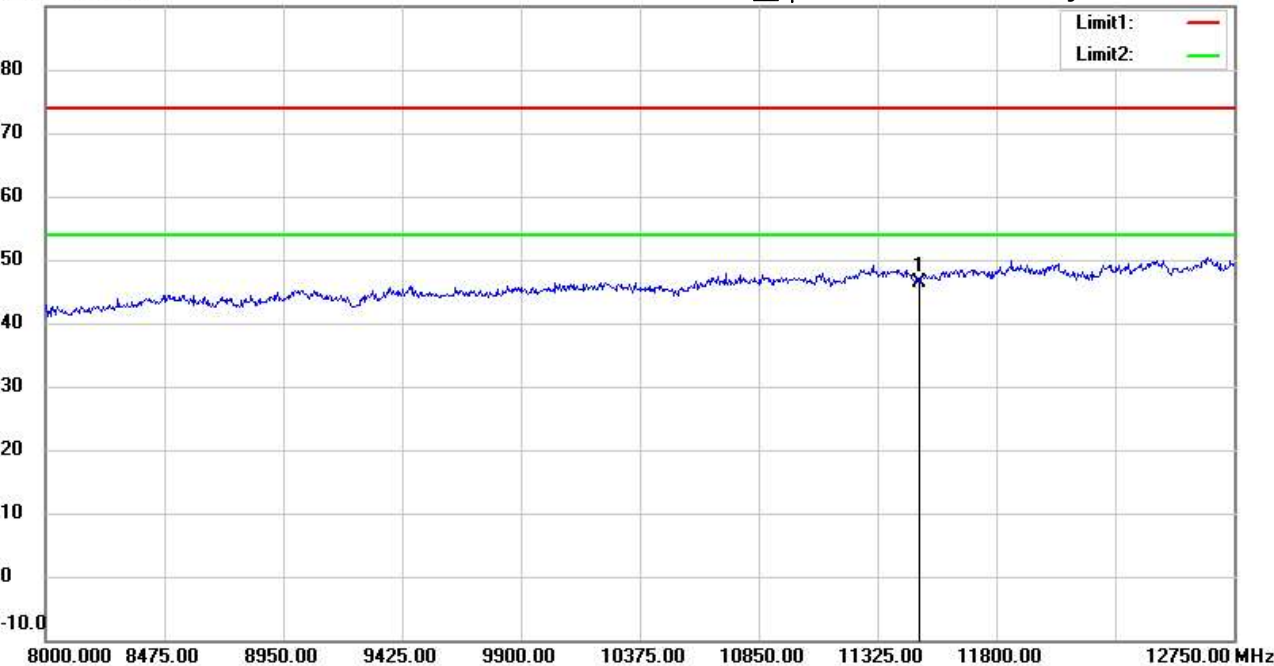

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: Vertical

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
| *   | 11490.000       | 30.40          | peak     | 15.91               | 46.31           | 74.00          | 150          | 151            | -27.69      |         |

\*:Maximum data x:Over limit !:over margin



Address:No.99,Sec.1,Balian Rd.,Xizhi Dist.,New Taipei City  
Tel:+886-2-2646-1508  
Fax:+886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File :3

Data :#4

Date: 2024/4/1

Temperature:23.6 °C

90.0 dBuV/m

Time: 上午 11:02:27

Humidity:64.3 %



Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: **Horizontal**

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
| *   | 17235.000       | 19.01          | peak     | 23.34               | 42.35           | 74.00          | 150          | 197            | -31.65      |         |

\*:Maximum data    x:Over limit    !:over margin



Address: No. 99, Sec. 1, Balian Rd., Xizhi Dist., New Taipei City  
Tel: +886-2-2646-1508  
Fax: +886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #10


Date: 2024/4/1

Temperature: 23.6 °C

90.0 dBuV/m

Time: 上午 11:05:53

Humidity: 64.3 %

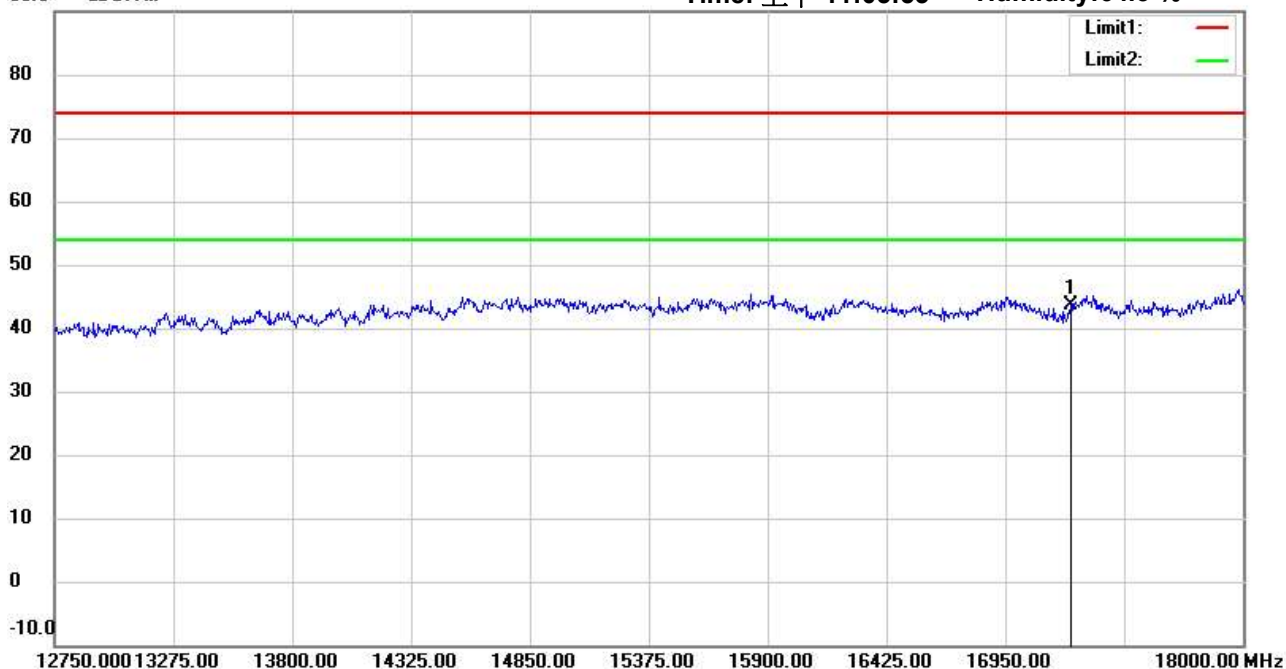

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: Vertical

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
| *   | 17235.000       | 20.24          | peak     | 23.34               | 43.58           | 74.00          | 150          | 159            | -30.42      |         |

\*:Maximum data    x:Over limit    !:over margin



Address:No.99,Sec.1,Balian Rd.,Xizhi Dist.,New Taipei City  
Tel:+886-2-2646-1508  
Fax:+886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File :3

Data :#5


Date: 2024/4/1

Temperature:23.6 °C

90.0 dBuV/m

Time: 上午 11:02:38

Humidity:64.3 %

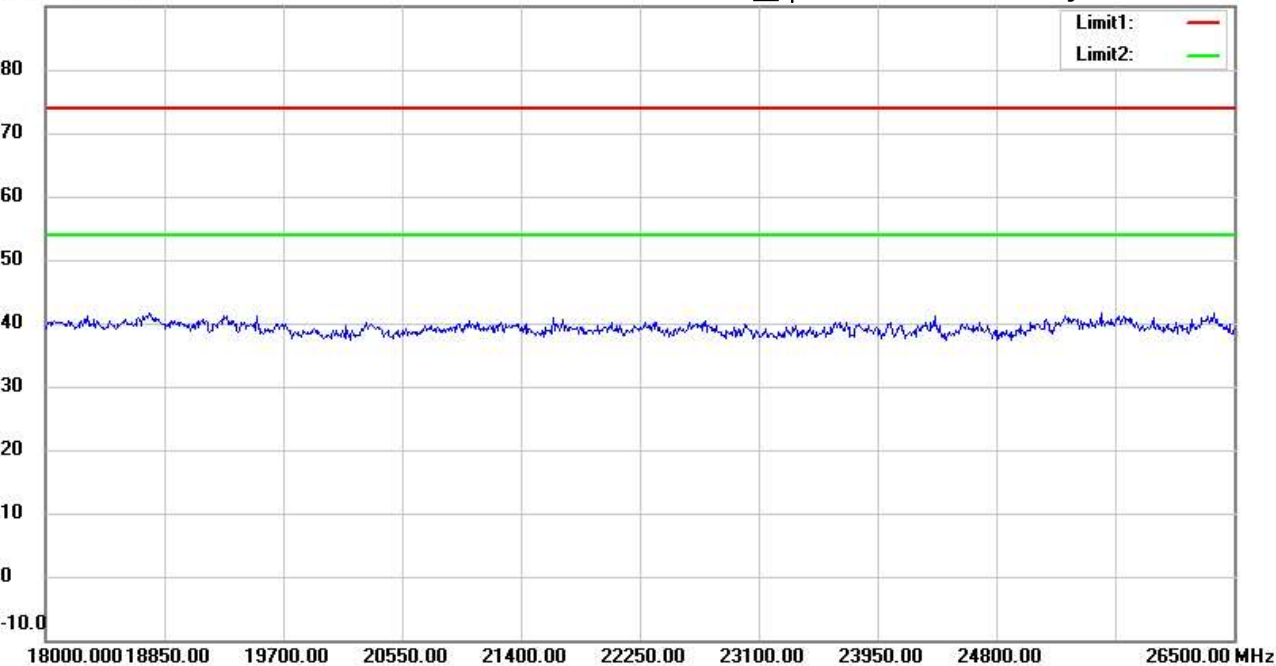

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: Horizontal

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|

\*:Maximum data    x:Over limit    !:over margin



Address:No.99,Sec.1,Balian Rd.,Xizhi Dist.,New Taipei City  
Tel:+886-2-2646-1508  
Fax:+886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File :3

Data :#11


Date: 2024/4/1

Temperature:23.6 °C

90.0 dBuV/m

Time: 上午 11:06:03

Humidity:64.3 %

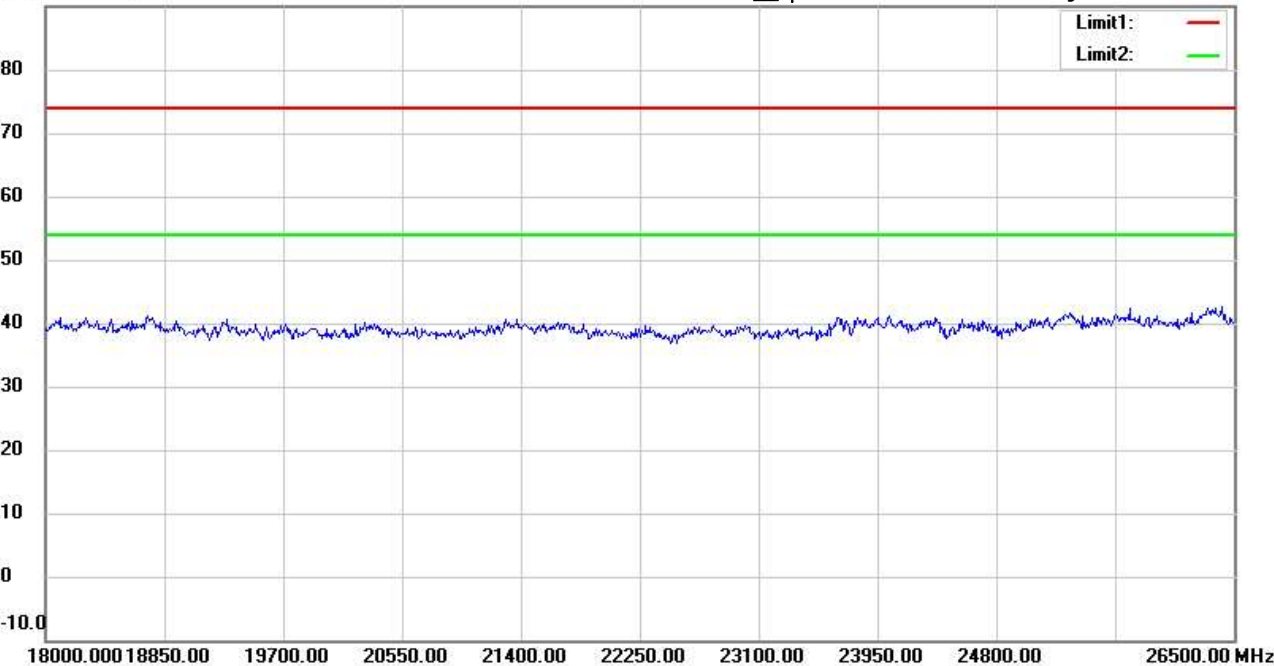

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: Vertical

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|

\*:Maximum data    x:Over limit    !:over margin



Address:No.99,Sec.1,Balian Rd.,Xizhi Dist.,New Taipei City  
Tel:+886-2-2646-1508  
Fax:+886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File :3

Data :#6


Date: 2024/4/1

Temperature:23.6 °C

90.0 dBuV/m

Time: 上午 11:02:48

Humidity:64.3 %

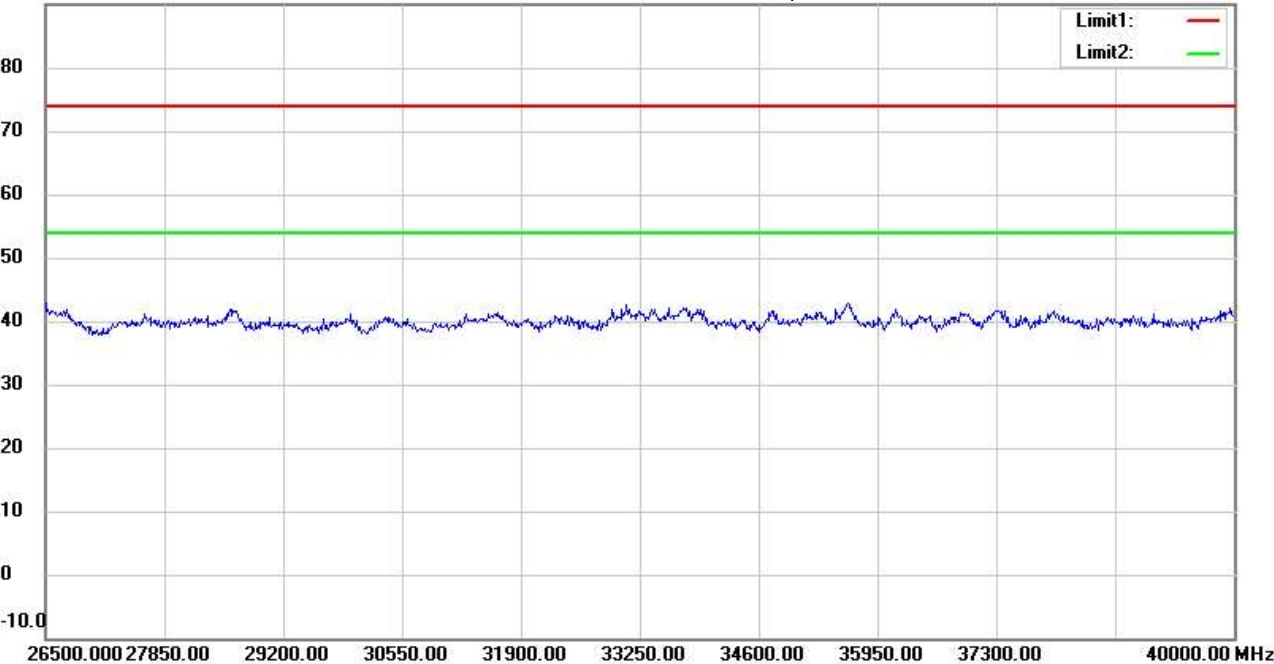

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: *Horizontal*

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|

\*:Maximum data    x:Over limit    !:over margin



Address: No. 99, Sec. 1, Balian Rd., Xizhi Dist., New Taipei City  
Tel: +886-2-2646-1508  
Fax: +886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #12


Date: 2024/4/1

Temperature: 23.6 °C

90.0 dBuV/m

Time: 上午 11:06:14

Humidity: 64.3 %

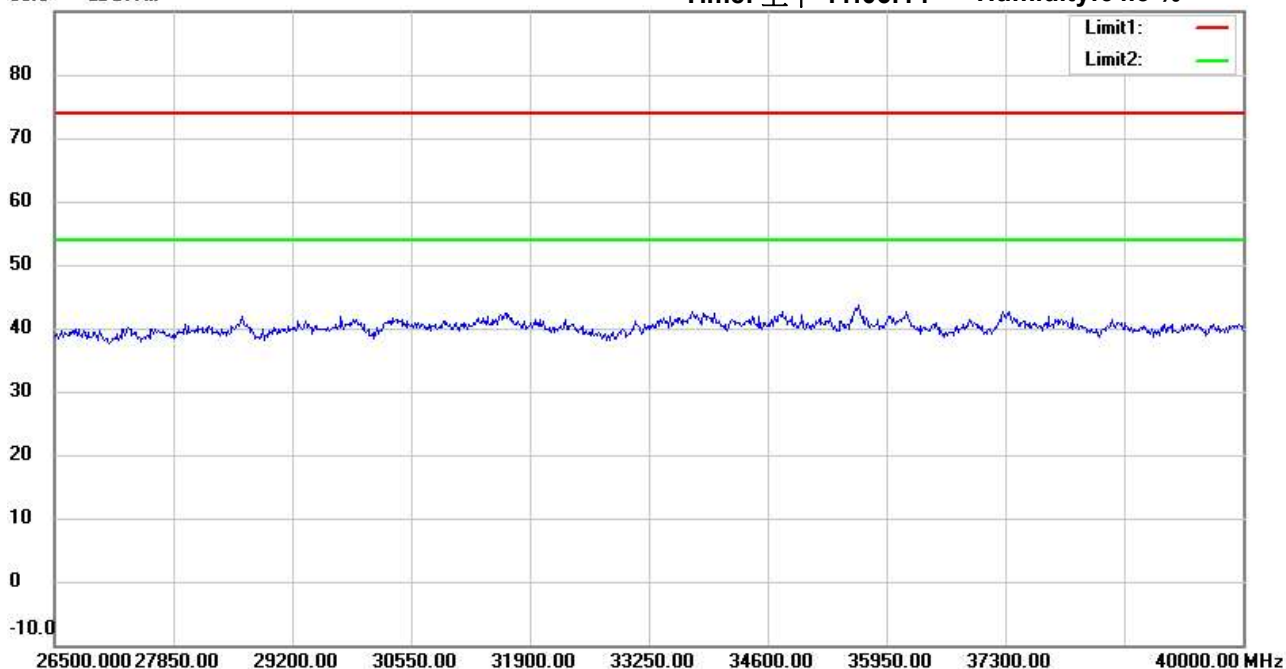

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH149

Note :

Polarization: Vertical

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|

\*:Maximum data    x:Over limit    !:over margin



Address:No.99,Sec.1,Balian Rd.,Xizhi Dist.,New Taipei City  
Tel:+886-2-2646-1508  
Fax:+886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File :3

Data :#1


Date: 2024/4/1

Temperature:23.6 °C

90.0 dBuV/m

Time: 上午 11:09:07

Humidity:64.3 %

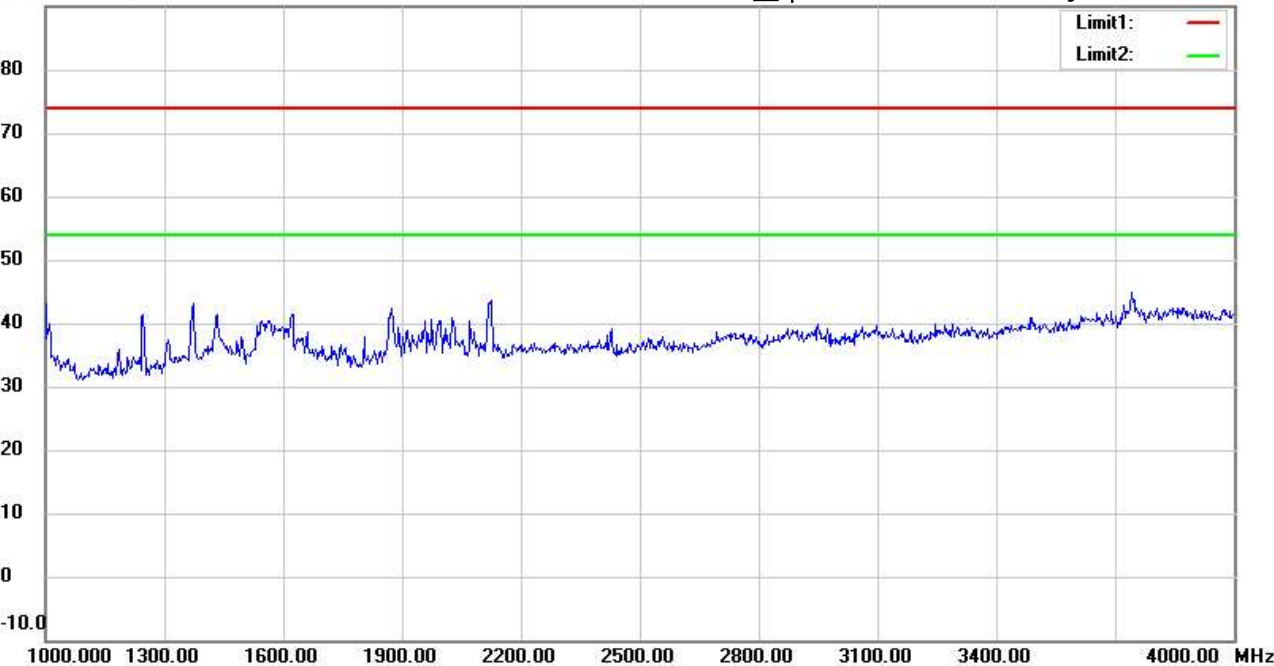

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: **Horizontal**

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|

\*:Maximum data    x:Over limit    !:over margin



Address: No. 99, Sec. 1, Balian Rd., Xizhi Dist., New Taipei City  
Tel: +886-2-2646-1508  
Fax: +886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #7


Date: 2024/4/1

Temperature: 23.6 °C

90.0 dBuV/m

Time: 上午 11:12:33

Humidity: 64.3 %

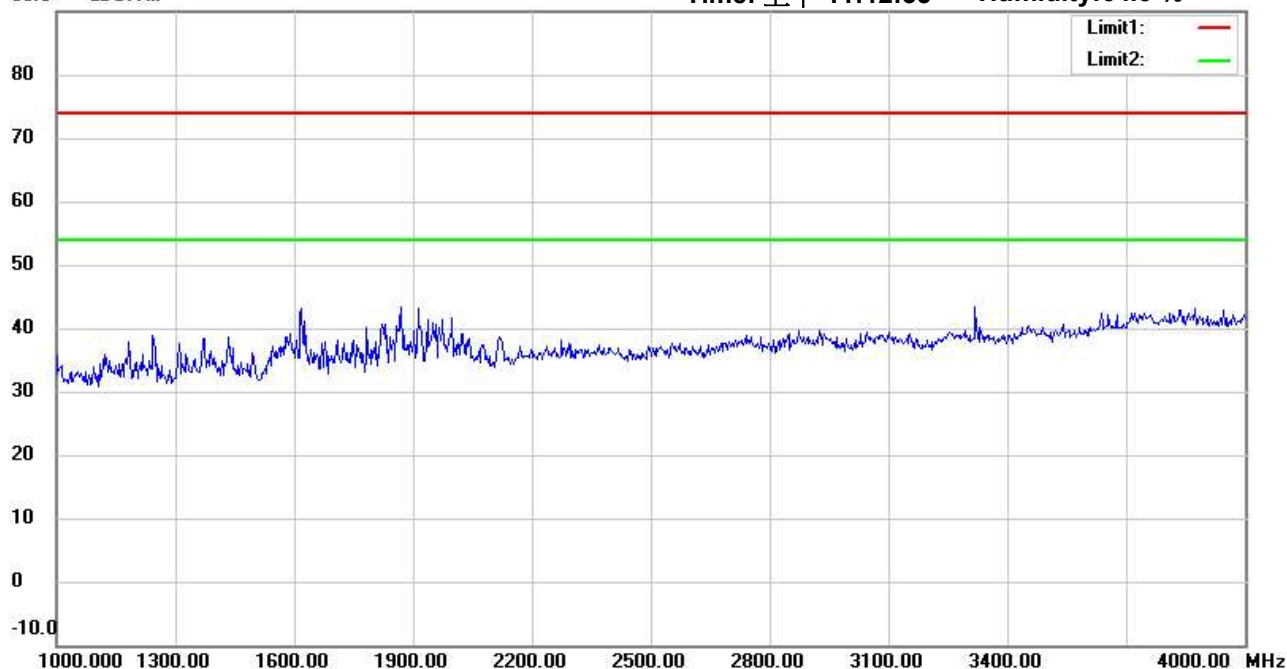

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: Vertical

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|

\*:Maximum data    x:Over limit    !:over margin



Address: No. 99, Sec. 1, Balian Rd., Xizhi Dist., New Taipei City  
Tel: +886-2-2646-1508  
Fax: +886-2-2646-1533

# Radiated Emission Measurement

Operator: Kai

File : 3

Data : #2


Date: 2024/4/1

Temperature: 23.6 °C

90.0 dBuV/m

Time: 上午 11:09:50

Humidity: 64.3 %

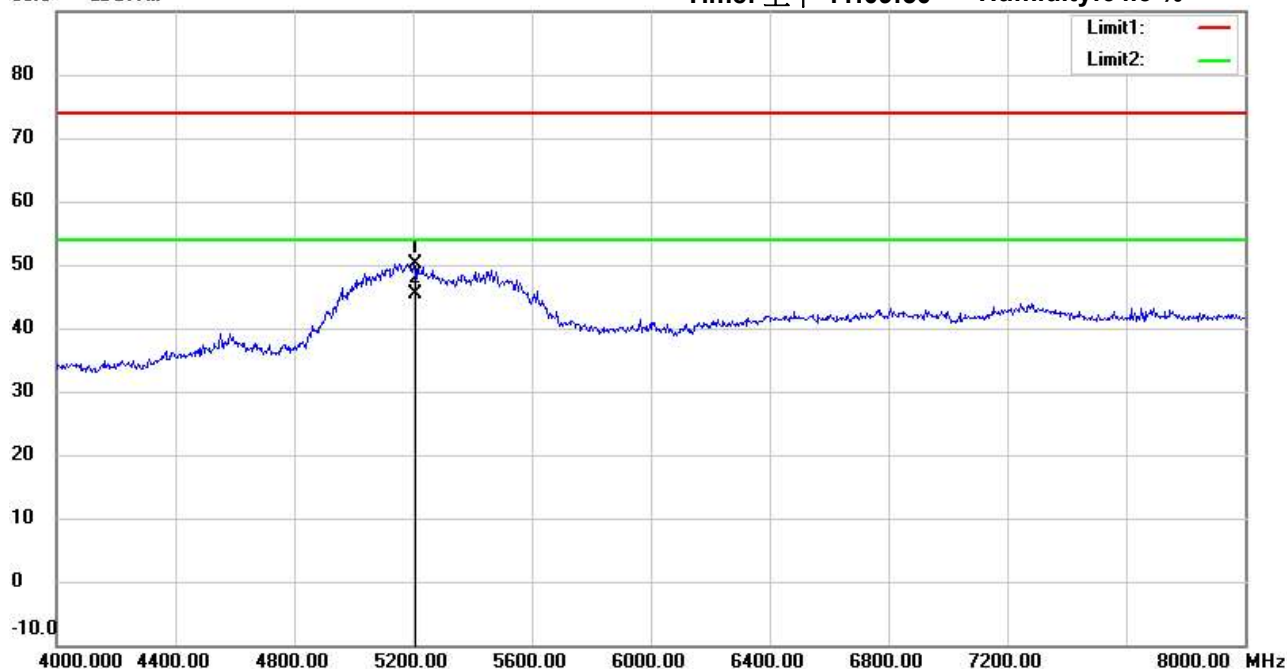

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: **Horizontal**

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
|     | 5206.000        | 45.50          | peak     | 4.73                | 50.23           | 74.00          | 150          | 33             | -23.77      |         |
| *   | 5206.000        | 40.55          | AVG      | 4.73                | 45.28           | 54.00          | 150          | 33             | -8.72       |         |

\*:Maximum data    x:Over limit    !:over margin



Address:No.99,Sec.1,Balian Rd.,Xizhi Dist.,New Taipei City  
Tel:+886-2-2646-1508  
Fax:+886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File :3

Data :#8


Date: 2024/4/1

Temperature:23.6 °C

90.0 dBuV/m

Time: 上午 11:13:15

Humidity:64.3 %

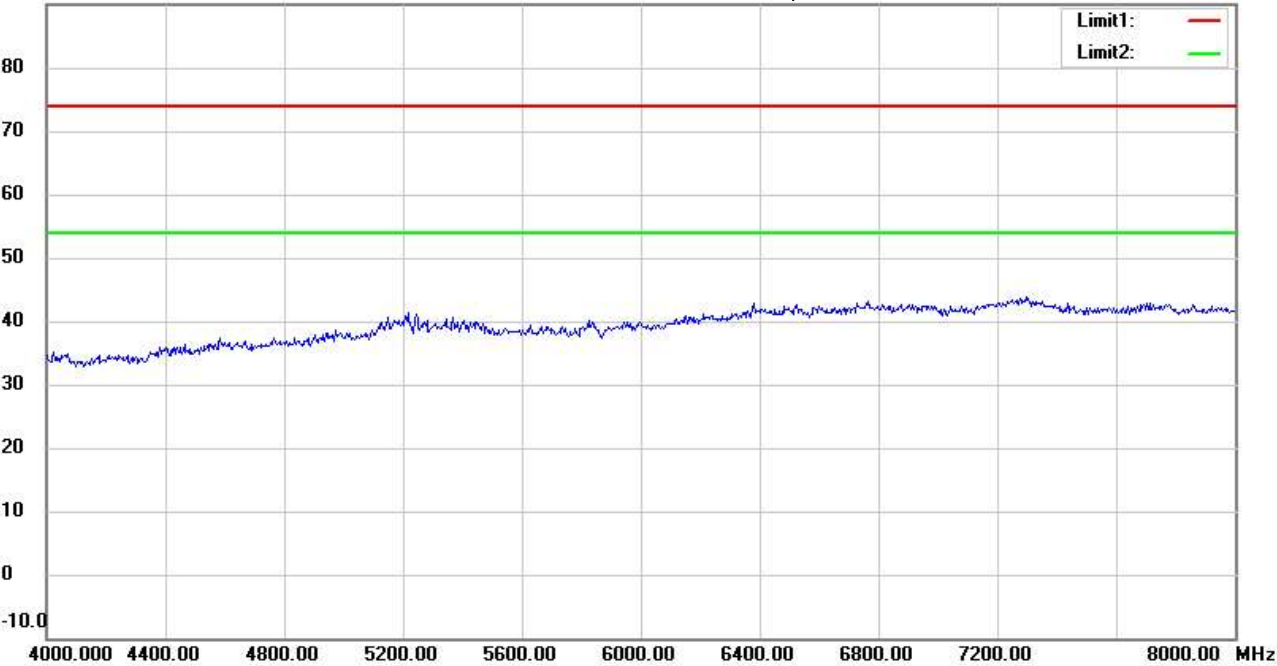

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: Vertical

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|

\*:Maximum data    x:Over limit    !:over margin



Address:No.99,Sec.1,Balian Rd.,Xizhi Dist.,New Taipei City  
Tel:+886-2-2646-1508  
Fax:+886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File :3

Data :#3


Date: 2024/4/1

Temperature:23.6 °C

90.0 dBuV/m

Time: 上午 11:10:33

Humidity:64.3 %

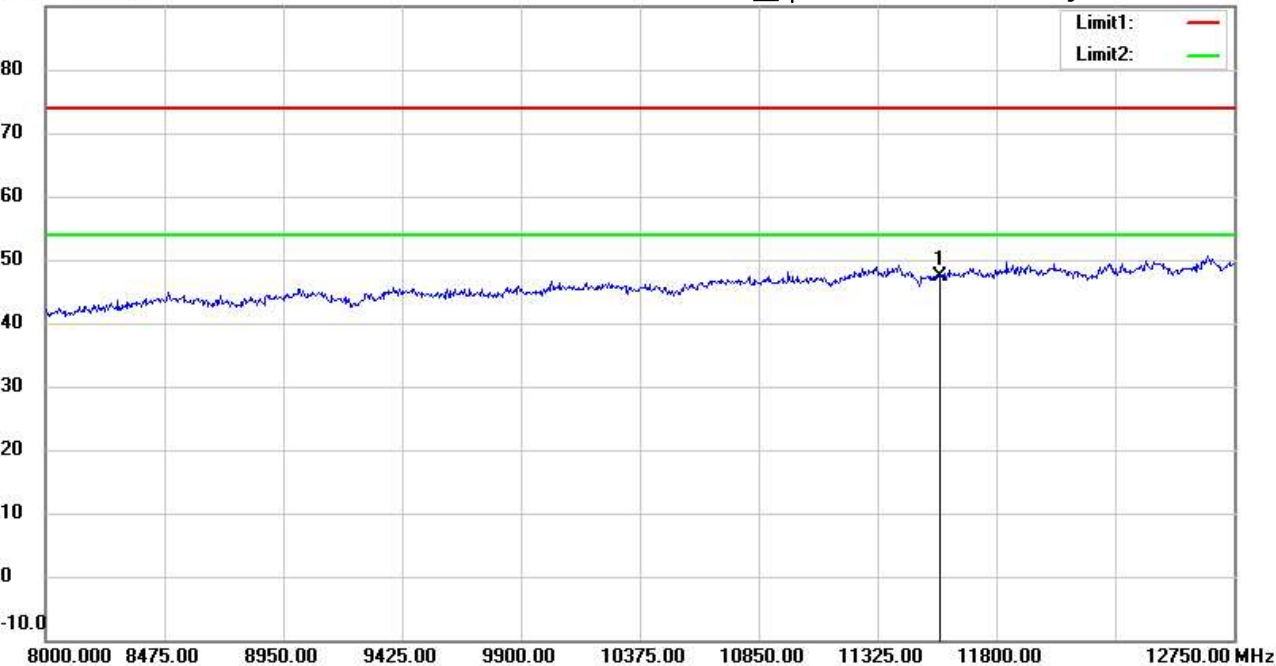

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: **Horizontal**

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
| *   | 11570.000       | 31.24          | peak     | 16.10               | 47.34           | 74.00          | 150          | 345            | -26.66      |         |

\*:Maximum data    x:Over limit    !:over margin



Address:No.99,Sec.1,Balian Rd.,Xizhi Dist.,New Taipei City  
Tel:+886-2-2646-1508  
Fax:+886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File :3

Data :#9


Date: 2024/4/1

Temperature:23.6 °C

90.0 dBuV/m

Time: 上午 11:13:58

Humidity:64.3 %

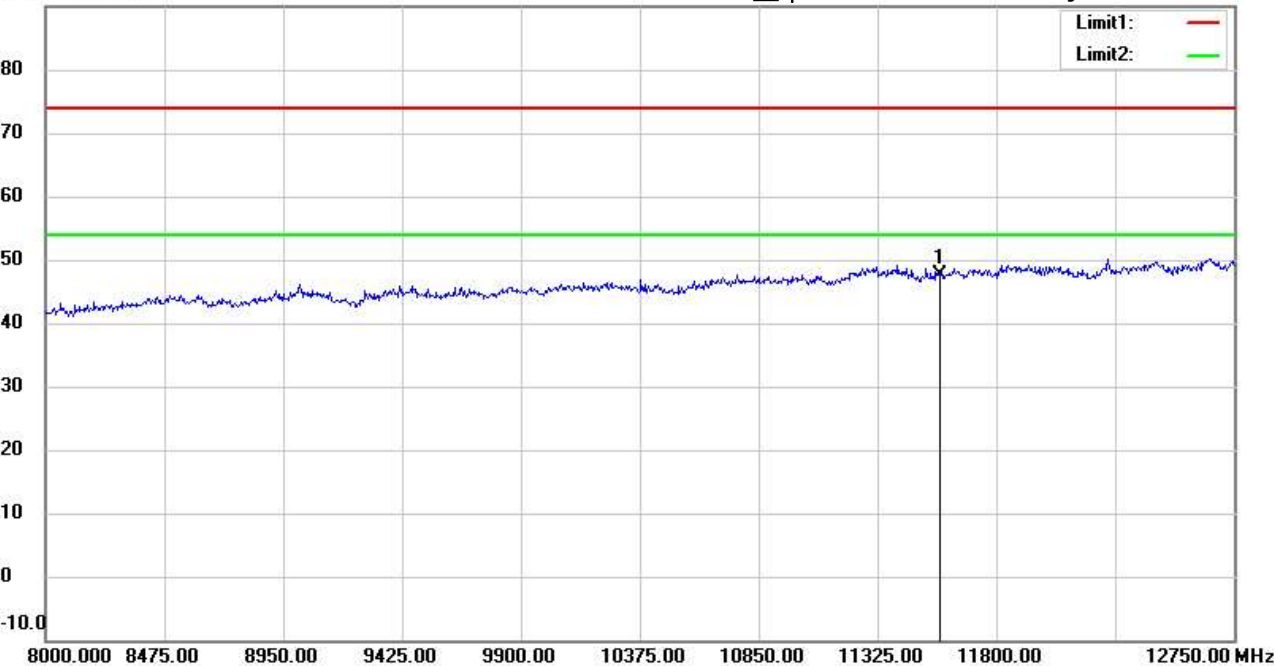

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: Vertical

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
| *   | 11570.000       | 31.41          | peak     | 16.10               | 47.51           | 74.00          | 150          | 260            | -26.49      |         |

\*:Maximum data x:Over limit !:over margin



Address:No.99,Sec.1,Balian Rd.,Xizhi Dist.,New Taipei City  
Tel:+886-2-2646-1508  
Fax:+886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File :3

Data :#4


Date: 2024/4/1

Temperature:23.6 °C

90.0 dBuV/m

Time: 上午 11:11:19

Humidity:64.3 %

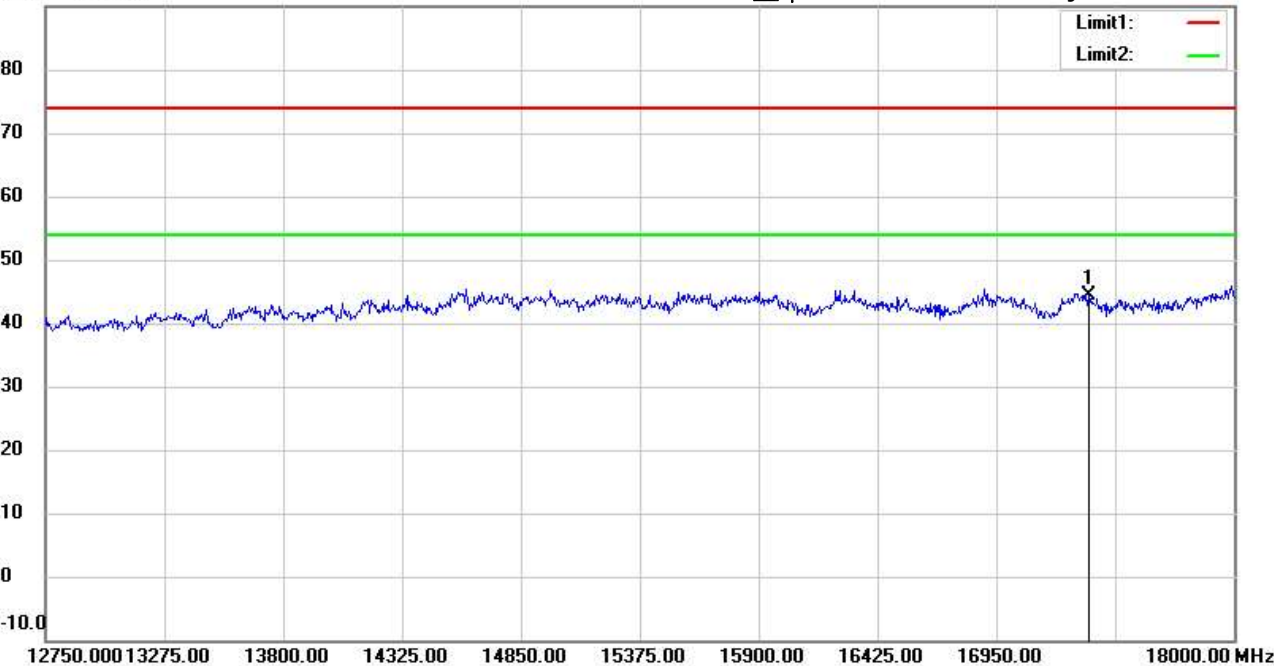

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: **Horizontal**

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
| *   | 17355.000       | 20.91          | peak     | 23.57               | 44.48           | 74.00          | 150          | 200            | -29.52      |         |

\*:Maximum data    x:Over limit    !:over margin



Address: No. 99, Sec. 1, Balian Rd., Xizhi Dist., New Taipei City  
Tel: +886-2-2646-1508  
Fax: +886-2-2646-1533

### Radiated Emission Measurement

Operator: Kai

File : 3

Data : #10


Date: 2024/4/1

Temperature: 23.6 °C

90.0 dBuV/m

Time: 上午 11:14:45

Humidity: 64.3 %

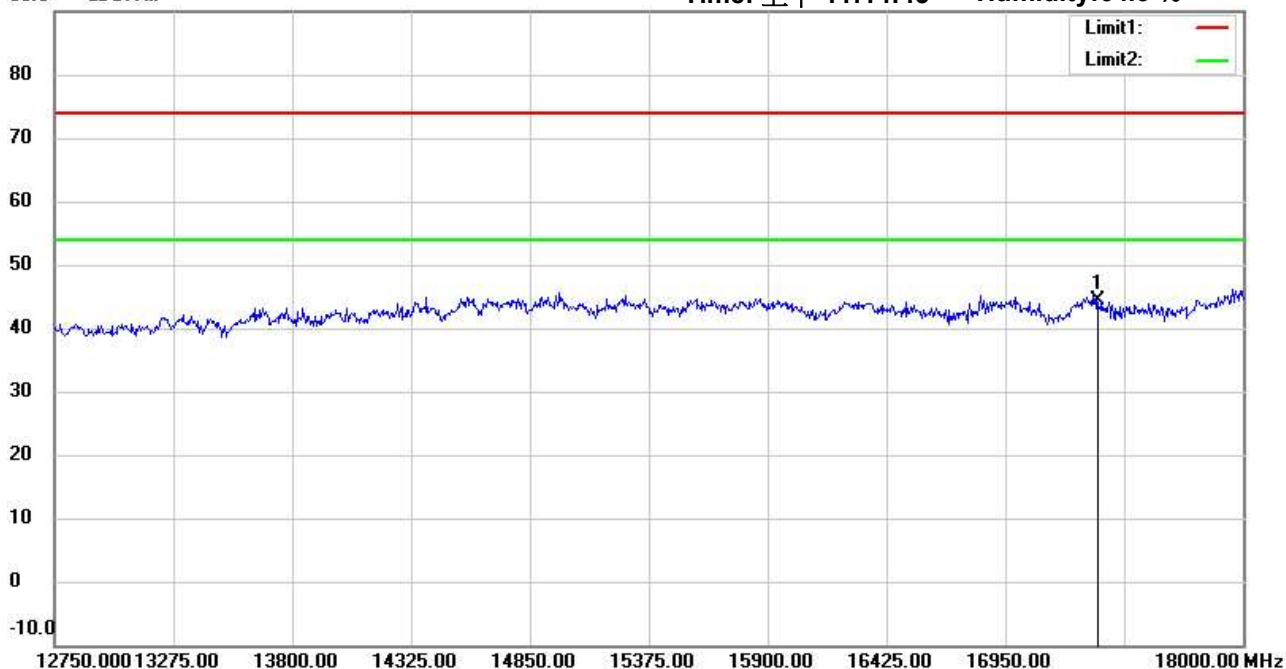

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: Vertical

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
| *   | 17355.000       | 20.82          | peak     | 23.57               | 44.39           | 74.00          | 150          | 280            | -29.61      |         |

\*:Maximum data    x:Over limit    !:over margin



Address:No.99,Sec.1,Balian Rd.,Xizhi Dist.,New Taipei City  
Tel:+886-2-2646-1508  
Fax:+886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File :3

Data :#5


Date: 2024/4/1

Temperature:23.6 °C

90.0 dBuV/m

Time: 上午 11:11:30

Humidity:64.3 %

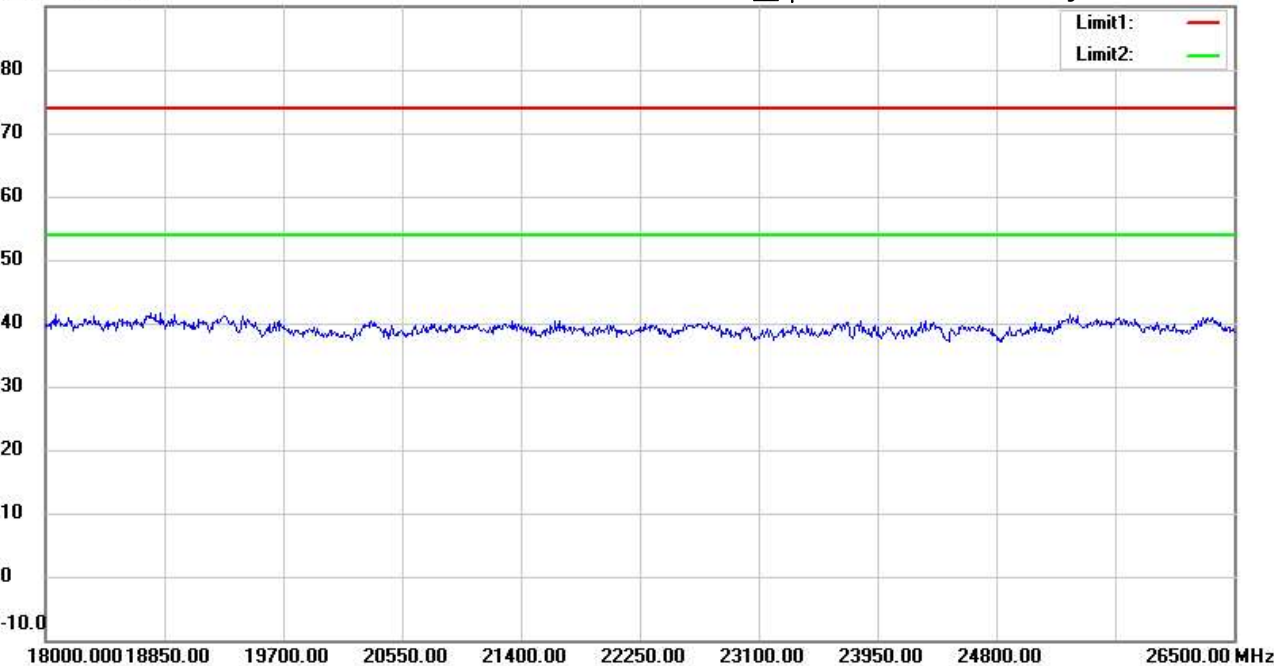

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: Horizontal

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|

\*:Maximum data    x:Over limit    !:over margin



Address:No.99,Sec.1,Balian Rd.,Xizhi Dist.,New Taipei City  
Tel:+886-2-2646-1508  
Fax:+886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File :3

Data :#11


Date: 2024/4/1

Temperature:23.6 °C

90.0 dBuV/m

Time: 上午 11:14:55

Humidity:64.3 %

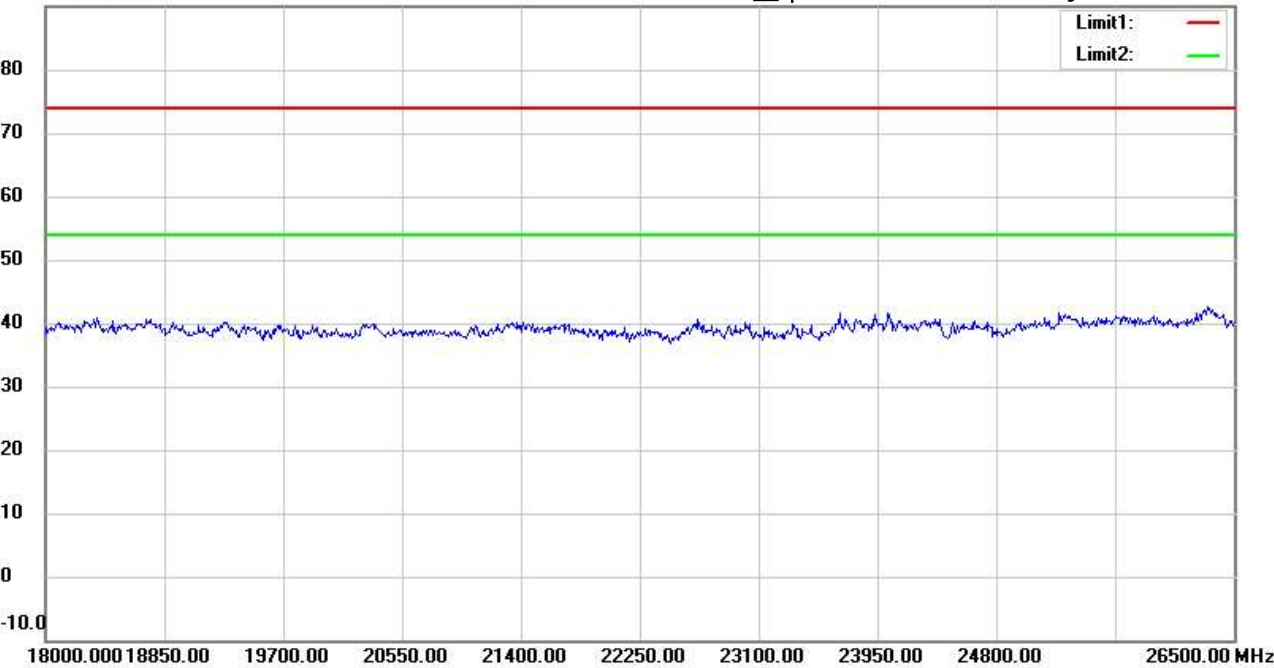

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: Vertical

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|

\*:Maximum data    x:Over limit    !:over margin



Address:No.99,Sec.1,Balian Rd.,Xizhi Dist.,New Taipei City  
Tel:+886-2-2646-1508  
Fax:+886-2-2646-1533

Radiated Emission Measurement

Operator: Kai

File :3

Data :#6


Date: 2024/4/1

Temperature:23.6 °C

90.0 dBuV/m

Time: 上午 11:11:40

Humidity:64.3 %

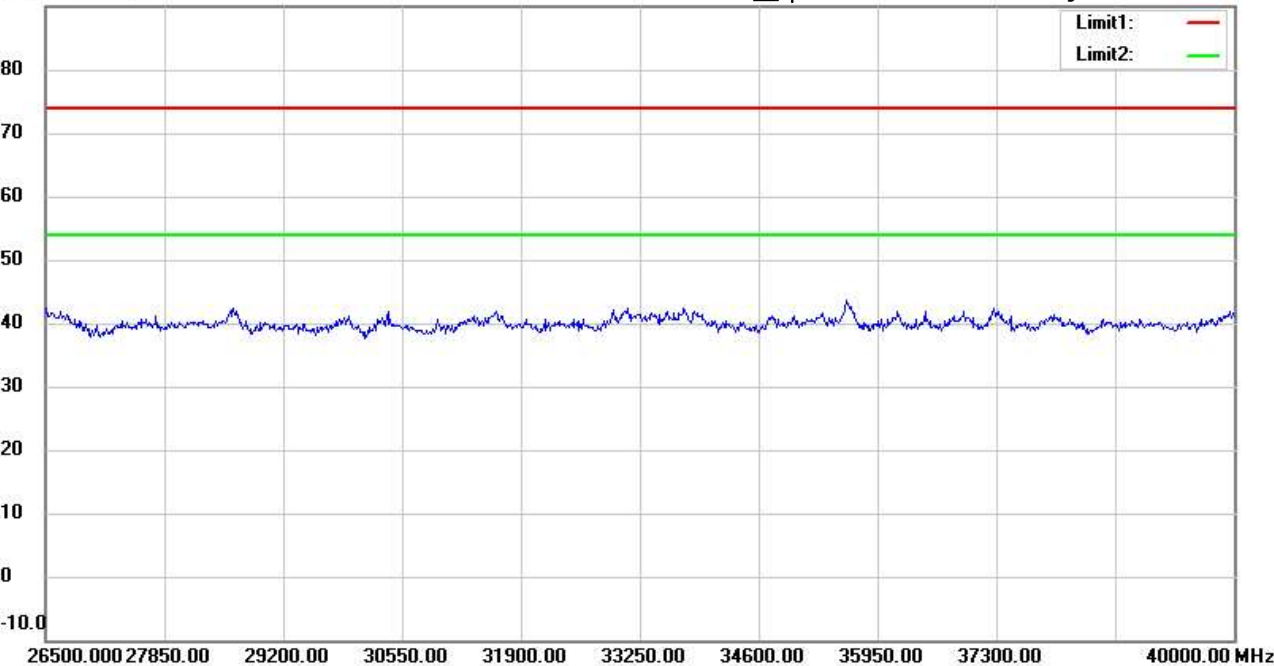

Site : 966A Chamber

Condition : FCC\_part 15E RE\_Above 1GHz\_PK

EUT : W6M22403-23316

M/N:

Test Mode : TX 802.11a CH157

Note :

Polarization: *Horizontal*

Power : 3.3 Vd.c.

Distance: 3m

| Mk. | Frequency (MHz) | Reading (dBuV) | Detector | Corr. factor (dB/m) | Result (dBuV/m) | Limit (dBuV/m) | Ant.Pos (cm) | Tab.Pos (deg.) | Margin (dB) | Comment |
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|
|-----|-----------------|----------------|----------|---------------------|-----------------|----------------|--------------|----------------|-------------|---------|

\*:Maximum data    x:Over limit    !:over margin