



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#12


Date: 2023/11/28

Temperature:23.8 °C

90.0 dBuV/m

Time: 下午 04:27:01

Humidity:61.8 %

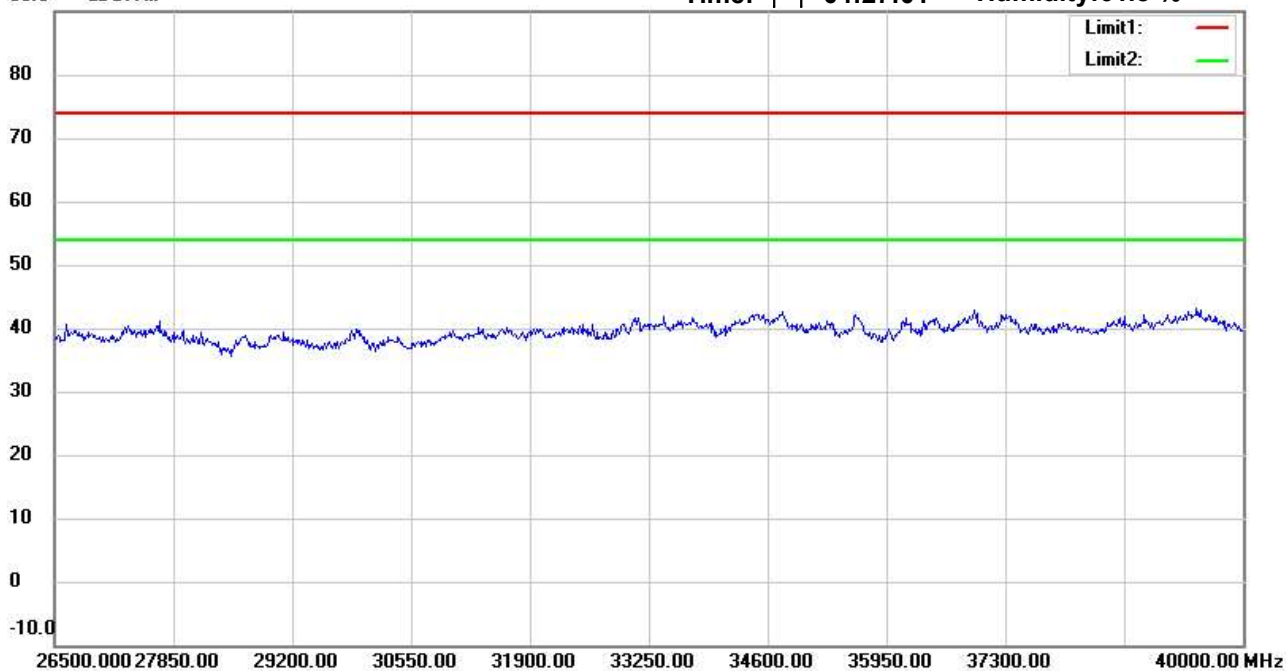

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH149

Note :

Polarization: Vertical

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#1


Date: 2023/11/28

Temperature:23.8 °C

90.0 dBuV/m

Time: 下午 04:30:22

Humidity:61.8 %

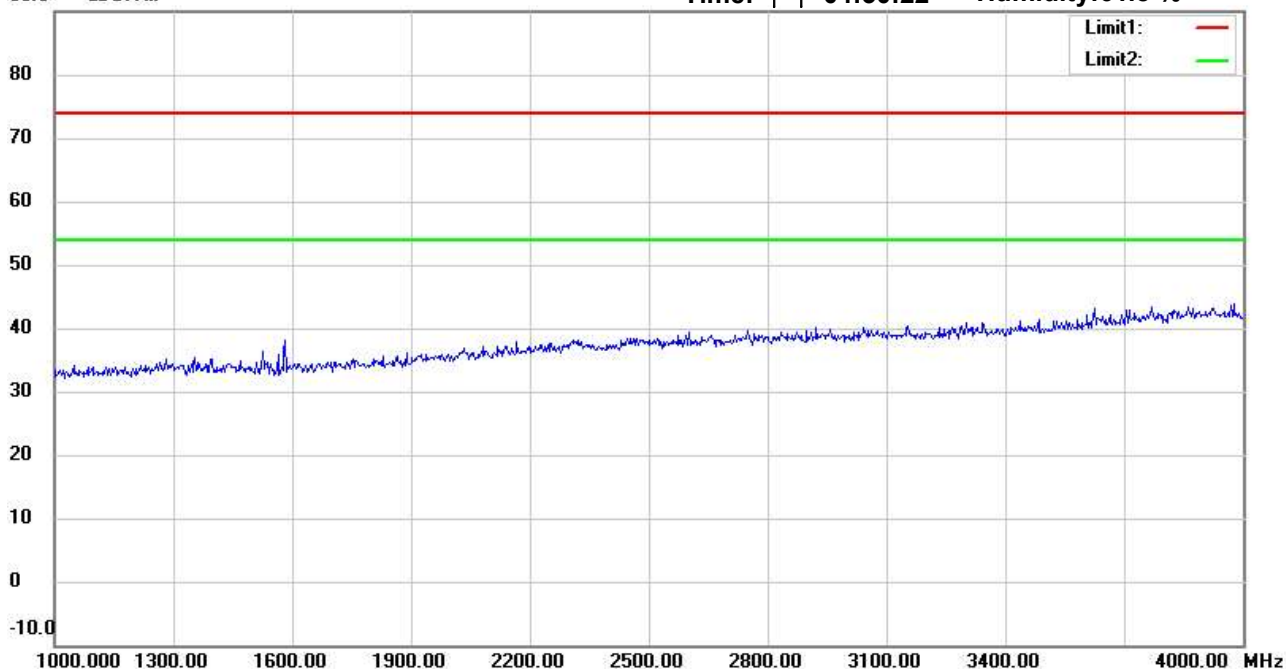

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #7


Date: 2023/11/28

Temperature: 23.8 °C

90.0 dBuV/m

Time: 下午 04:34:49

Humidity: 61.8 %

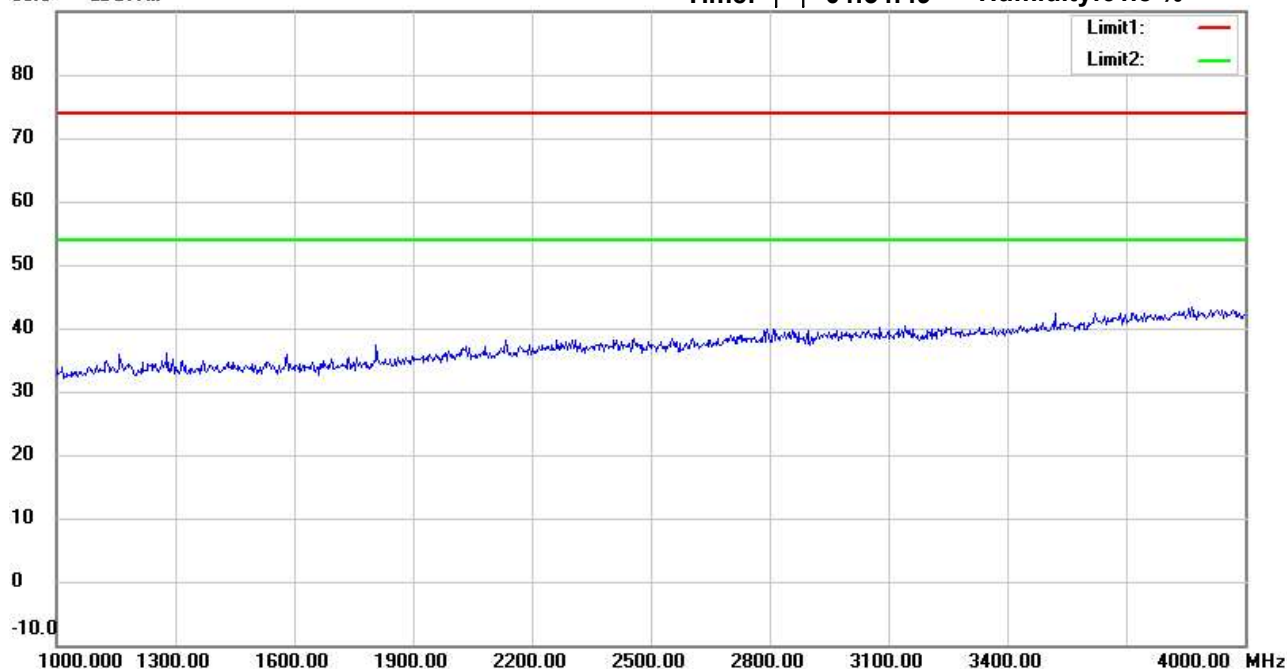

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: **Vertical**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#2


Date: 2023/11/28

Temperature:23.8 °C

90.0 dBuV/m

Time: 下午 04:31:18

Humidity:61.8 %

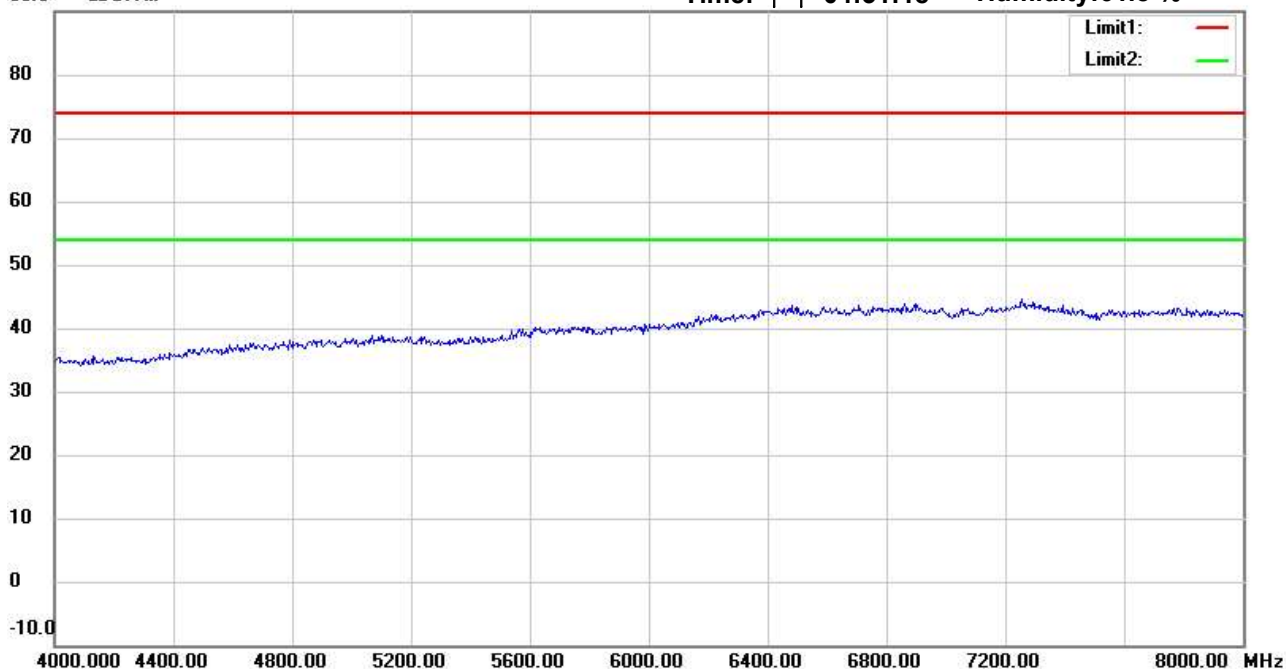

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#8


Date: 2023/11/28

Temperature:23.8 °C

90.0 dBuV/m

Time: 下午 04:35:46

Humidity:61.8 %

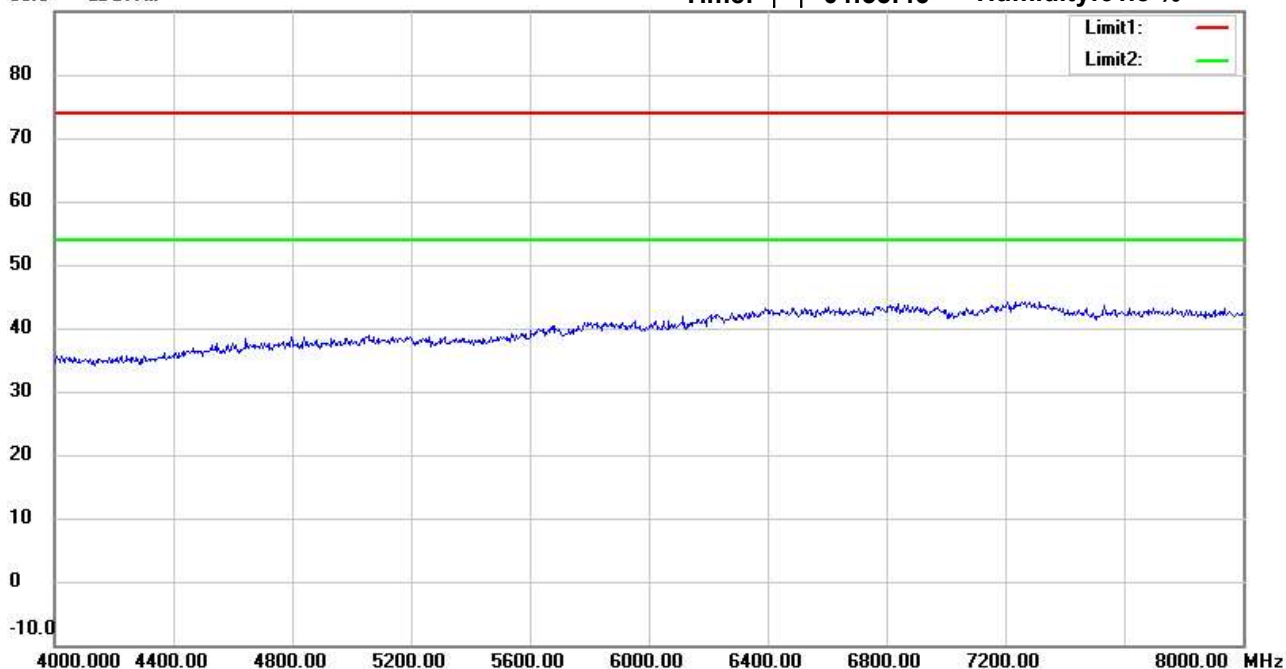

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: **Vertical**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #3


Date: 2023/11/28

Temperature: 23.8 °C

90.0 dBuV/m

Time: 下午 04:32:16

Humidity: 61.8 %

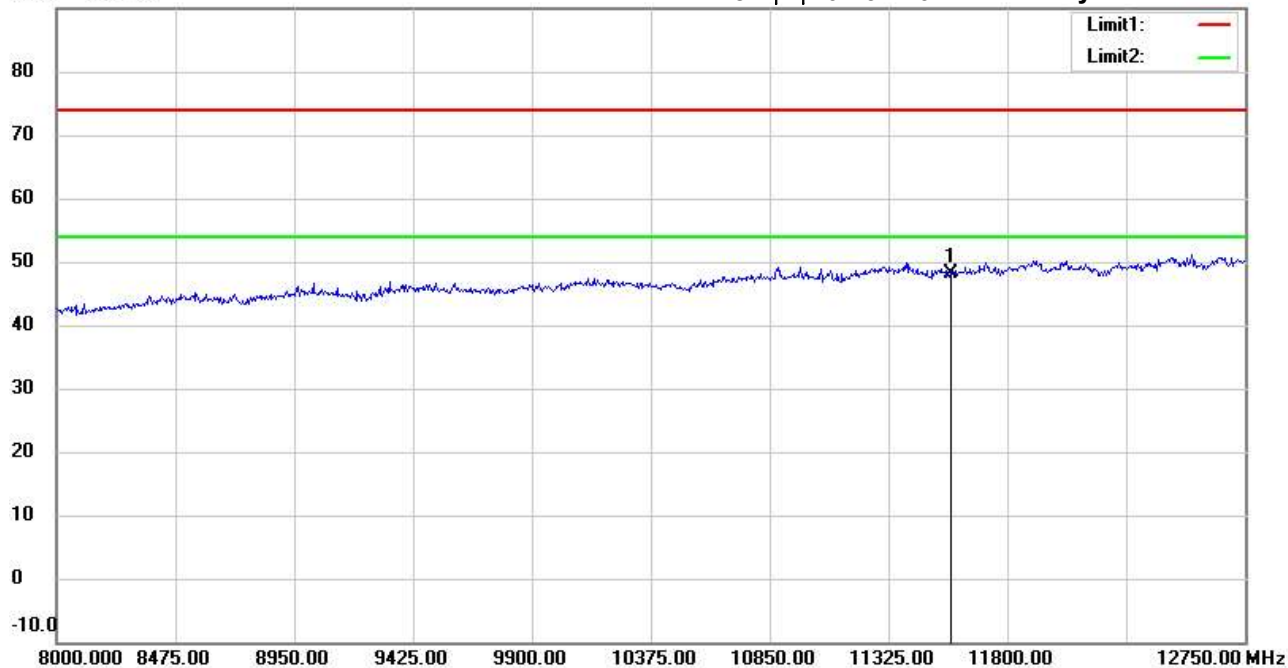

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11570.000	31.43	peak	16.60	48.03	74.00	150	337	-25.97	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#9


Date: 2023/11/28

Temperature:23.8 °C

90.0 dBuV/m

Time: 下午 04:36:44

Humidity:61.8 %

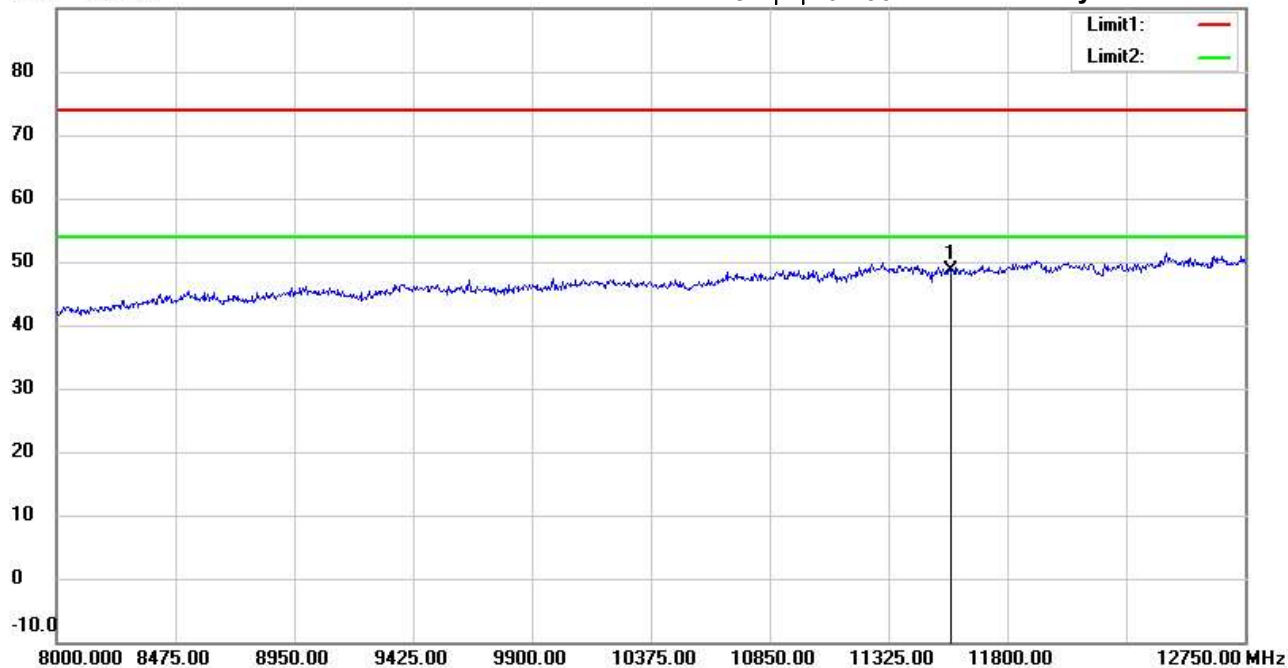

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: **Vertical**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11570.000	32.00	peak	16.60	48.60	74.00	150	10	-25.40	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #4


Date: 2023/11/28

Temperature: 23.8 °C

90.0 dBuV/m

Time: 下午 04:33:18

Humidity: 61.8 %

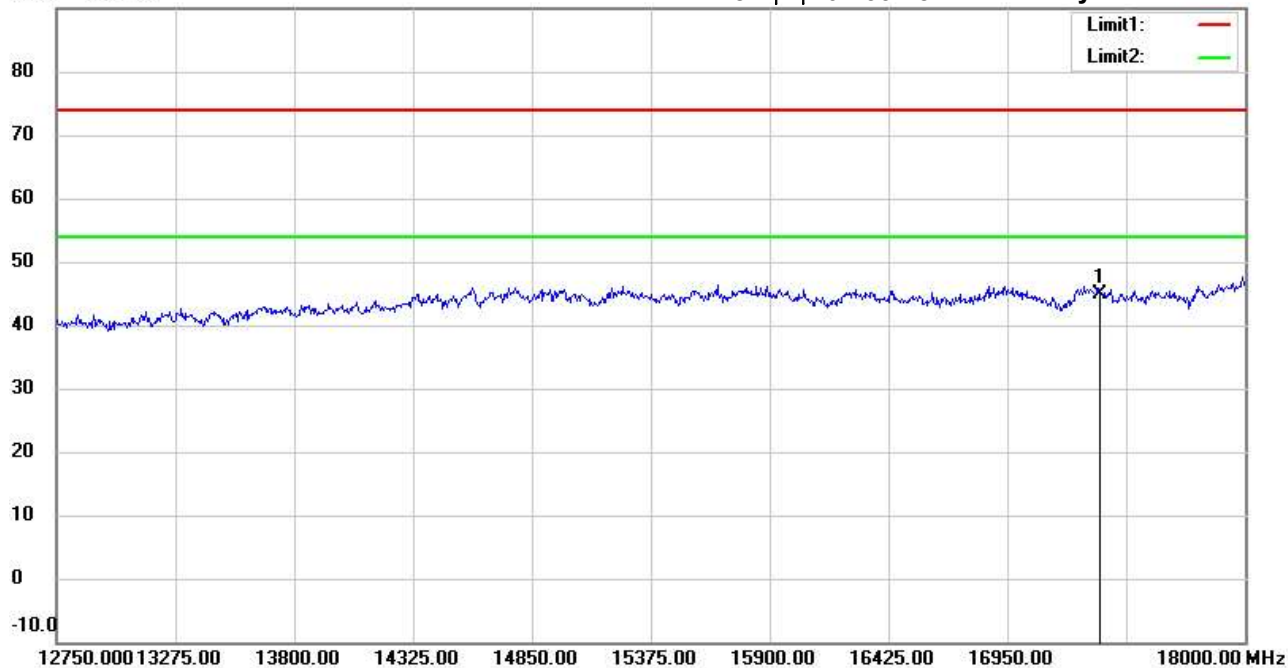

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17355.000	20.92	peak	23.97	44.89	74.00	150	12	-29.11	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #10


Date: 2023/11/28

Temperature: 23.8 °C

90.0 dBuV/m

Time: 下午 04:37:46

Humidity: 61.8 %

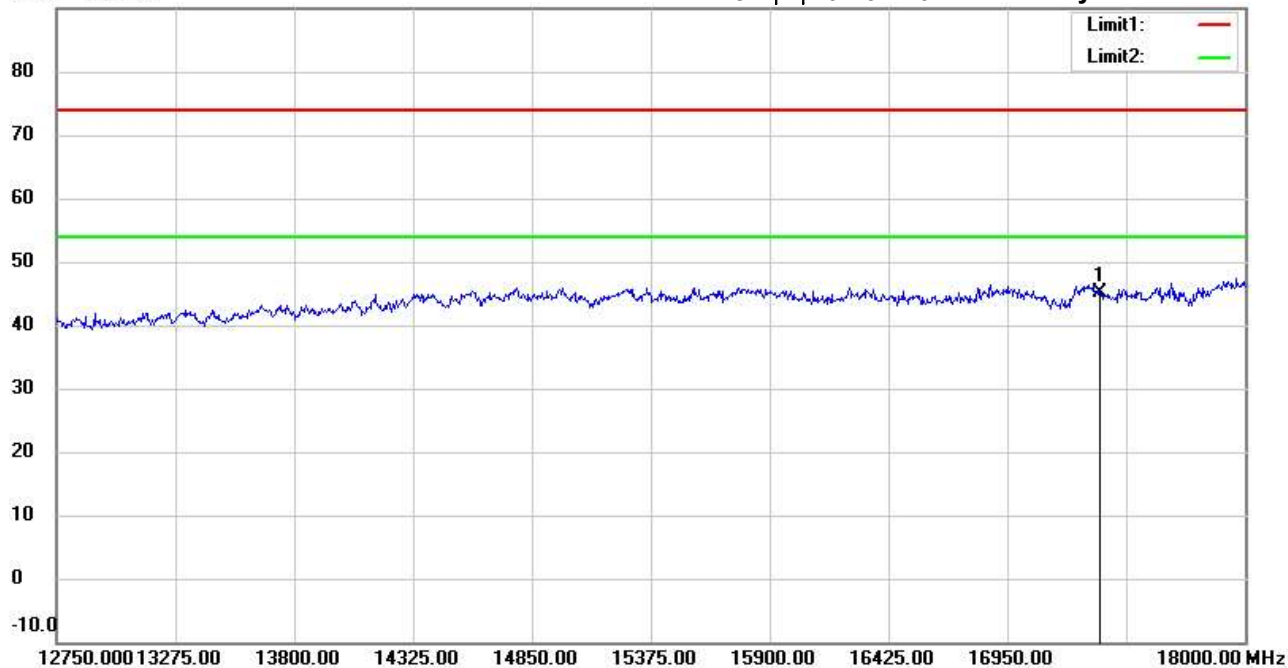

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: Vertical

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17355.000	21.07	peak	23.97	45.04	74.00	150	27	-28.96	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#5


Date: 2023/11/28

Temperature:23.8 °C

90.0 dBuV/m

Time: 下午 04:33:29

Humidity:61.8 %

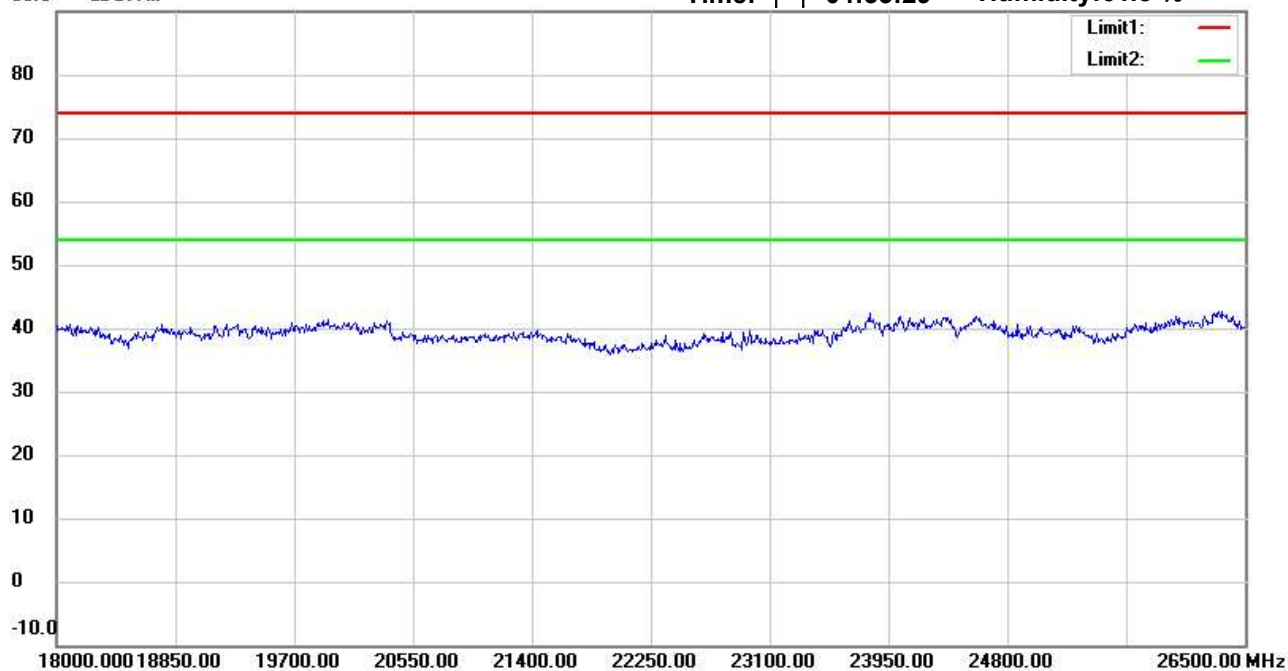

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: Horizontal

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#11


Date: 2023/11/28

Temperature:23.8 °C

90.0 dBuV/m

Time: 下午 04:37:57

Humidity:61.8 %

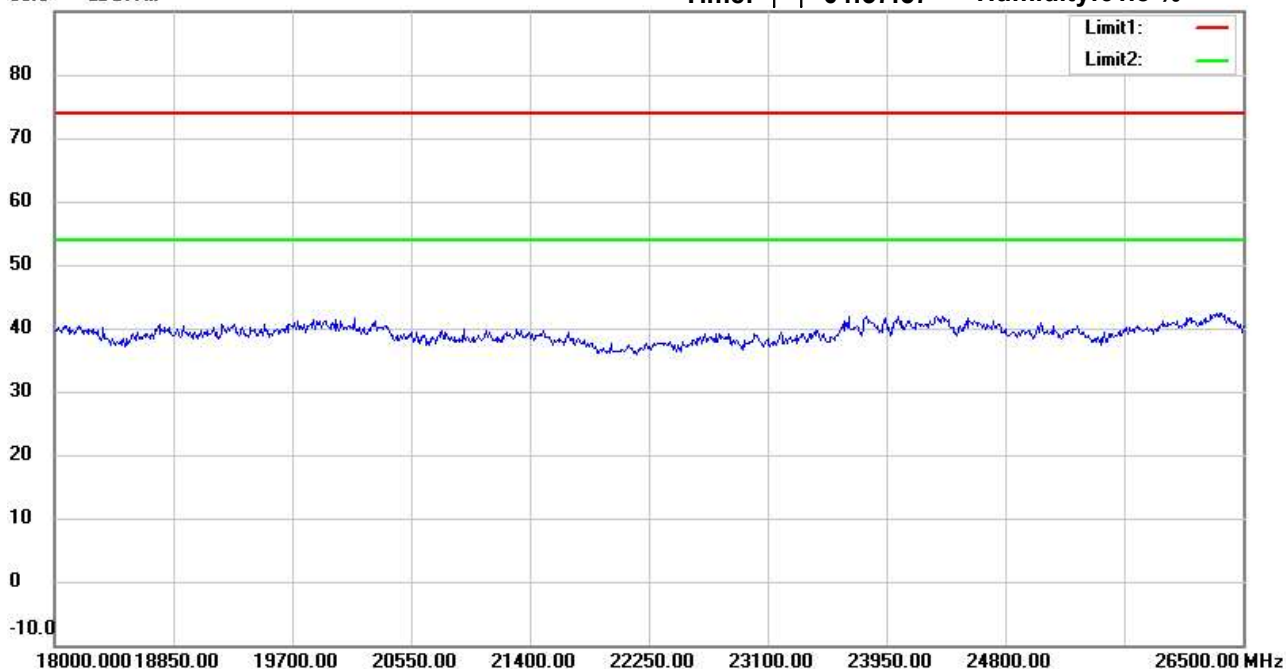

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: Vertical

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#6


Date: 2023/11/28

Temperature:23.8 °C

90.0 dBuV/m

Time: 下午 04:33:41

Humidity:61.8 %

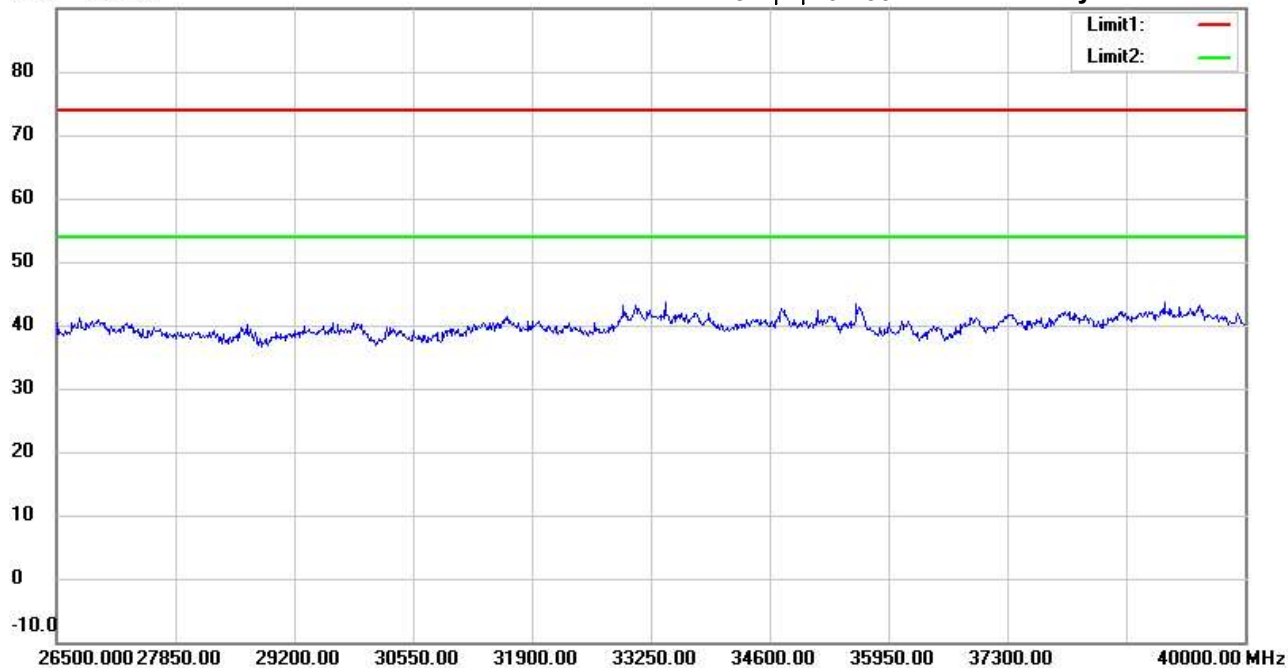

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: Horizontal

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#12


Date: 2023/11/28

Temperature:23.8 °C

90.0 dBuV/m

Time: 下午 04:38:09

Humidity:61.8 %

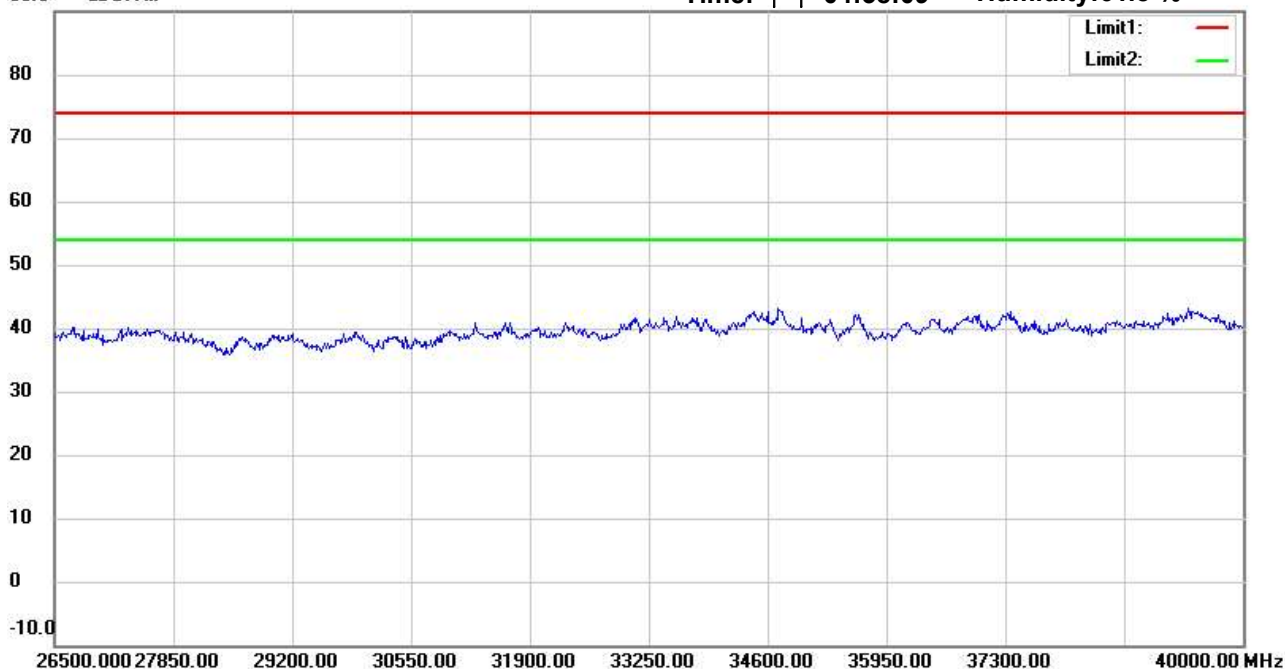

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH157

Note :

Polarization: Vertical

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#1


Date: 2023/11/28

Temperature:23.8 °C

90.0 dBuV/m

Time: 下午 04:41:59

Humidity:61.8 %

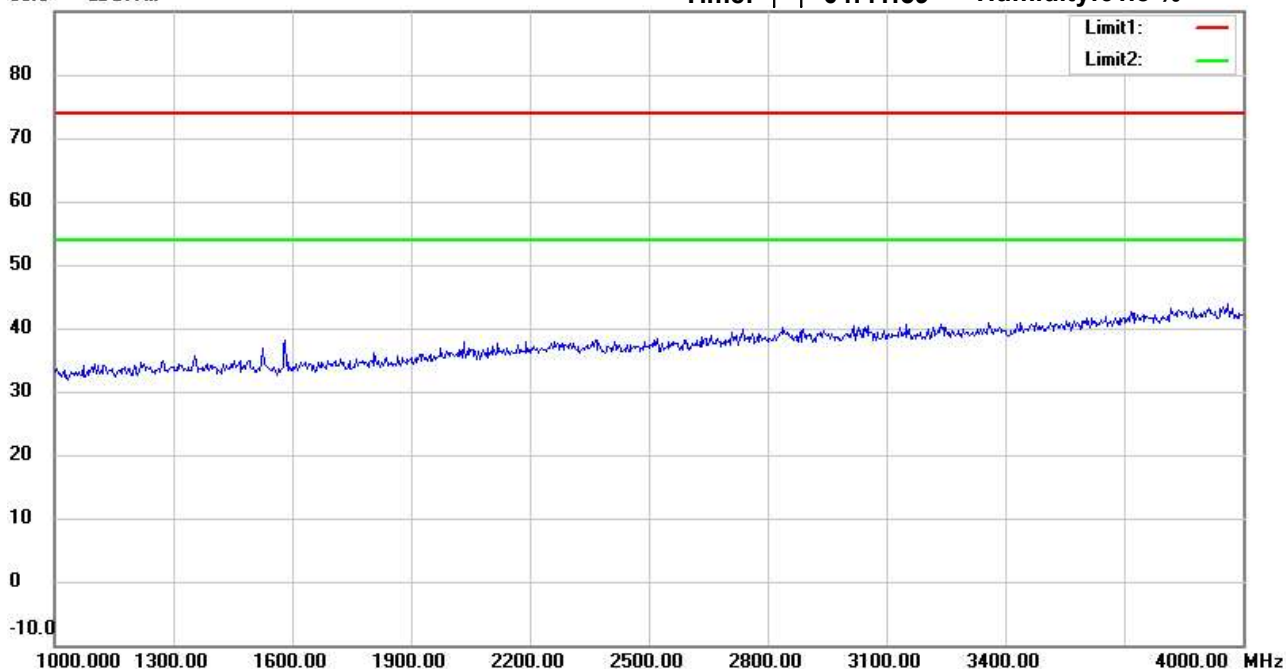

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#7


Date: 2023/11/28

Temperature:23.8 °C

90.0 dBuV/m

Time: 下午 04:46:27

Humidity:61.8 %

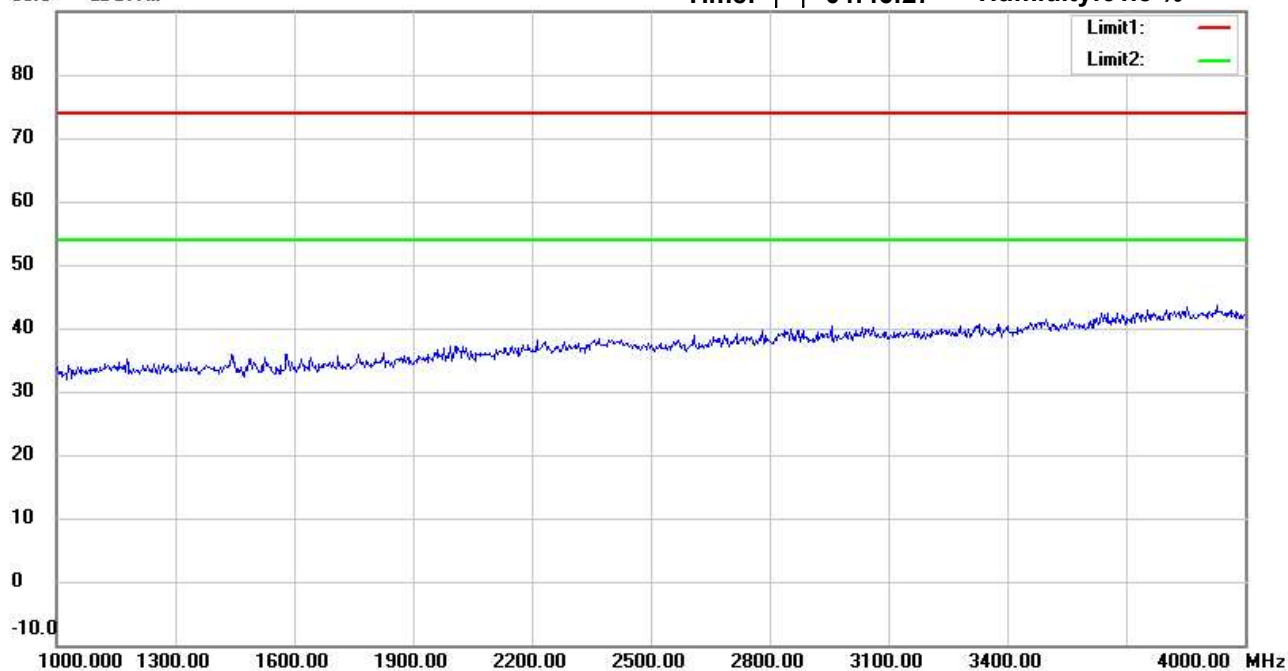

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: **Vertical**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #2


Date: 2023/11/28

Temperature: 23.8 °C

90.0 dBuV/m

Time: 下午 04:42:56

Humidity: 61.8 %

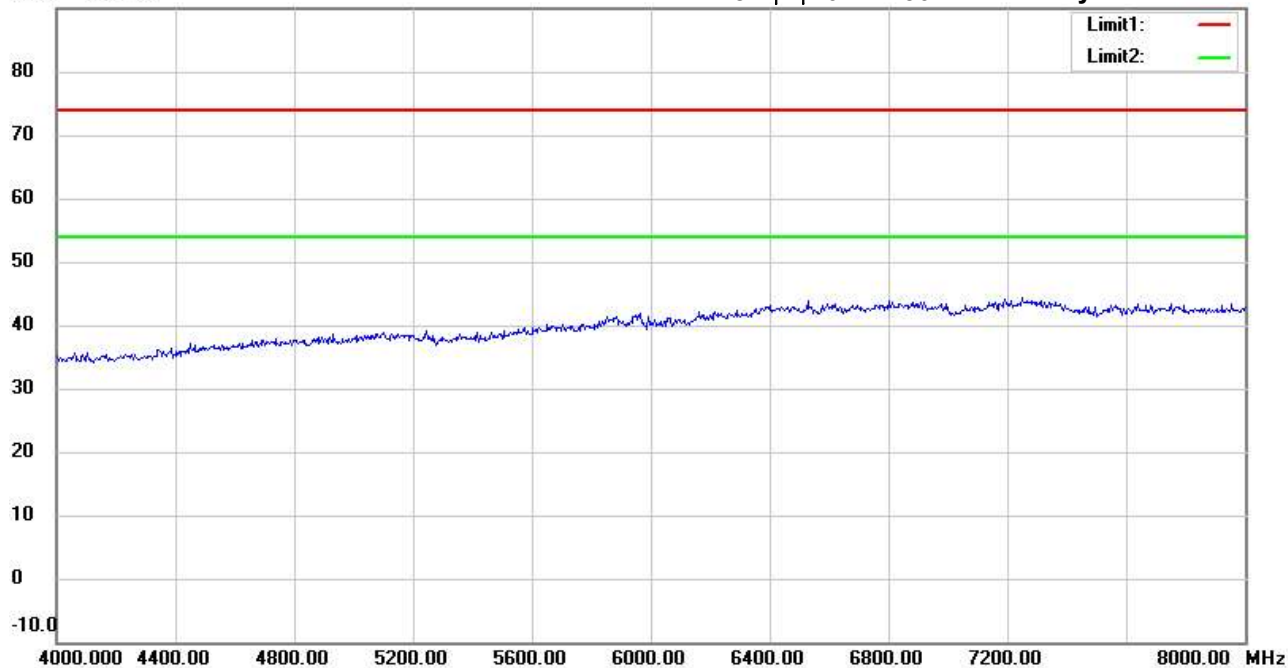

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: **Horizontal**

Power : 120 V.a.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#8


Date: 2023/11/28

Temperature:23.8 °C

90.0 dBuV/m

Time: 下午 04:47:24

Humidity:61.8 %

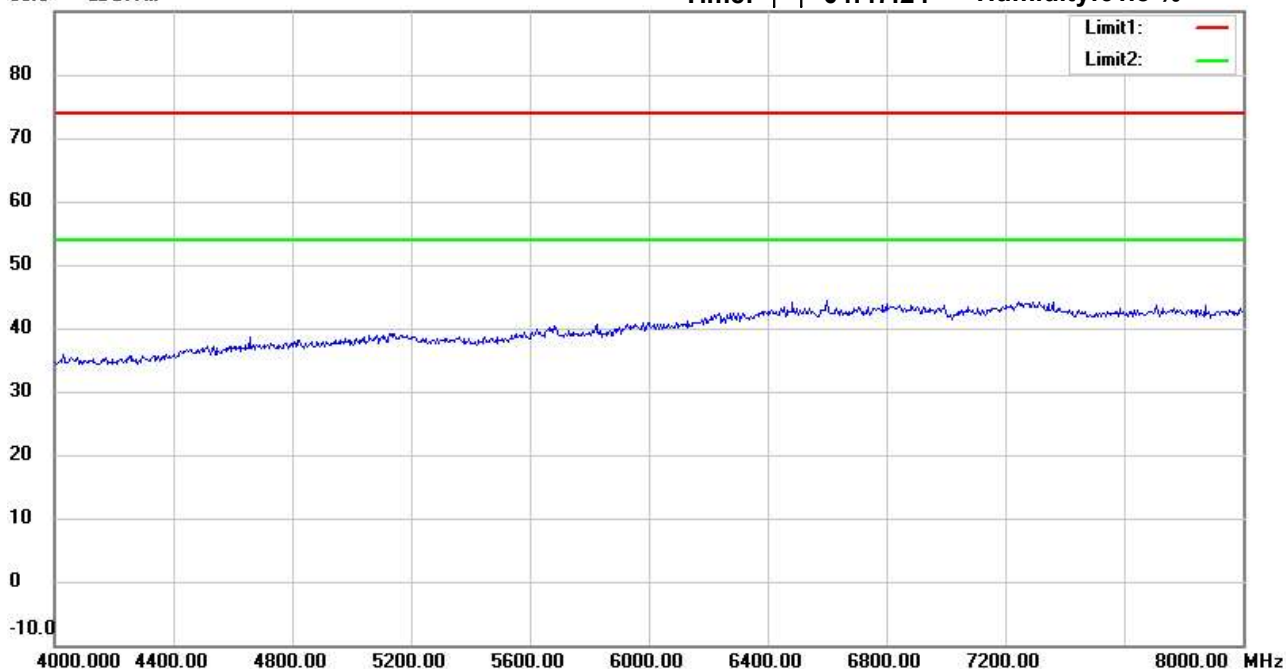

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: **Vertical**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #3


Date: 2023/11/28

Temperature: 23.8 °C

90.0 dBuV/m

Time: 下午 04:43:55

Humidity: 61.8 %

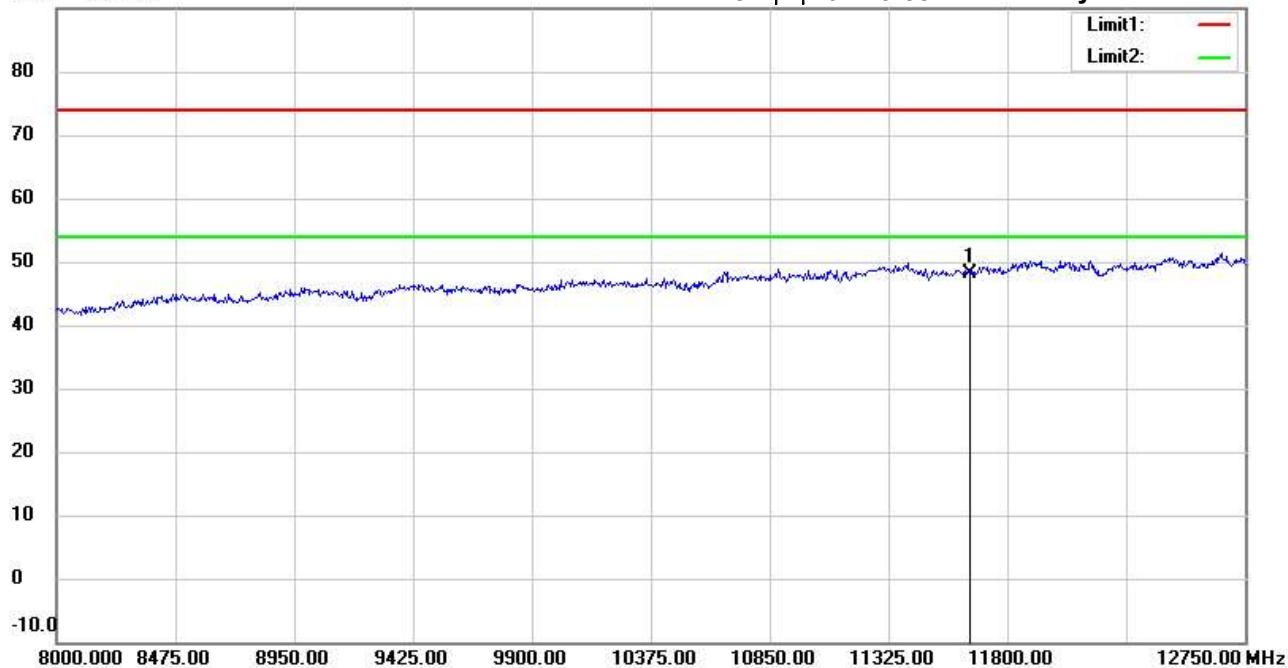

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11650.000	31.73	peak	16.48	48.21	74.00	150	260	-25.79	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #9

Date: 2023/11/28

Temperature: 23.8 °C

90.0 dBuV/m

Time: 下午 04:48:22

Humidity: 61.8 %



Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: **Vertical**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	11650.000	32.07	peak	16.48	48.55	74.00	150	254	-25.45	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #4


Date: 2023/11/28

Temperature: 23.8 °C

90.0 dBuV/m

Time: 下午 04:44:57

Humidity: 61.8 %

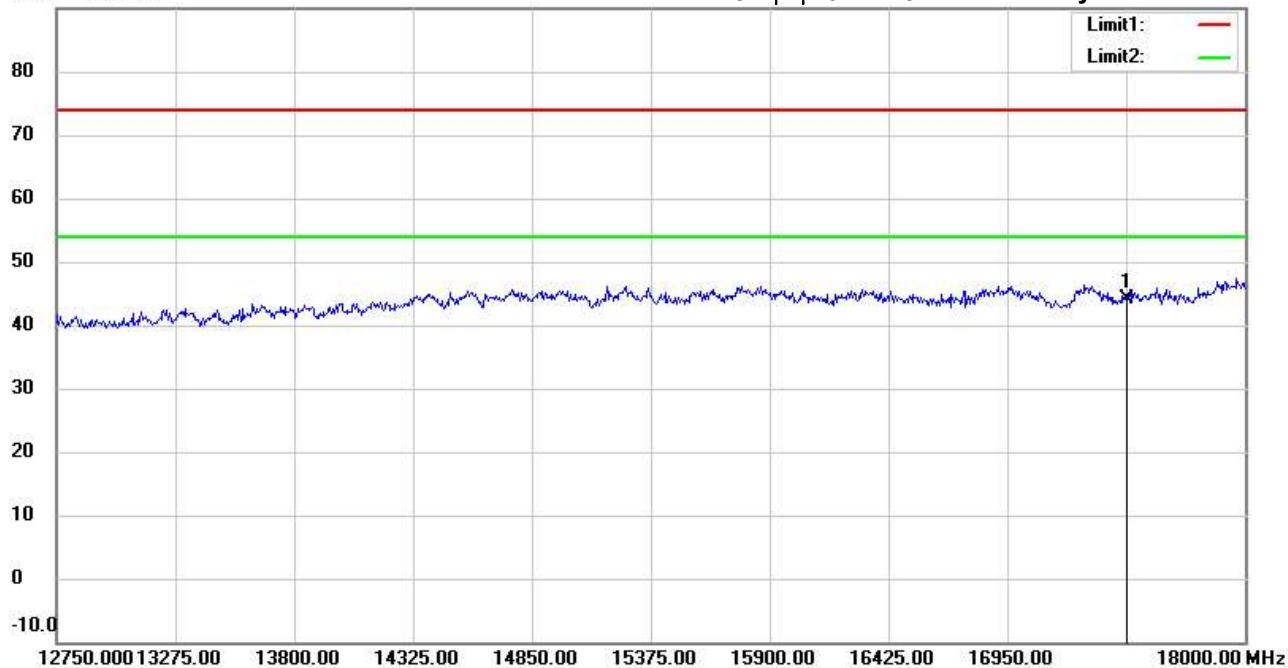

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17475.000	20.87	peak	23.21	44.08	74.00	150	83	-29.92	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #10


Date: 2023/11/28

Temperature: 23.8 °C

90.0 dBuV/m

Time: 下午 04:49:25

Humidity: 61.8 %

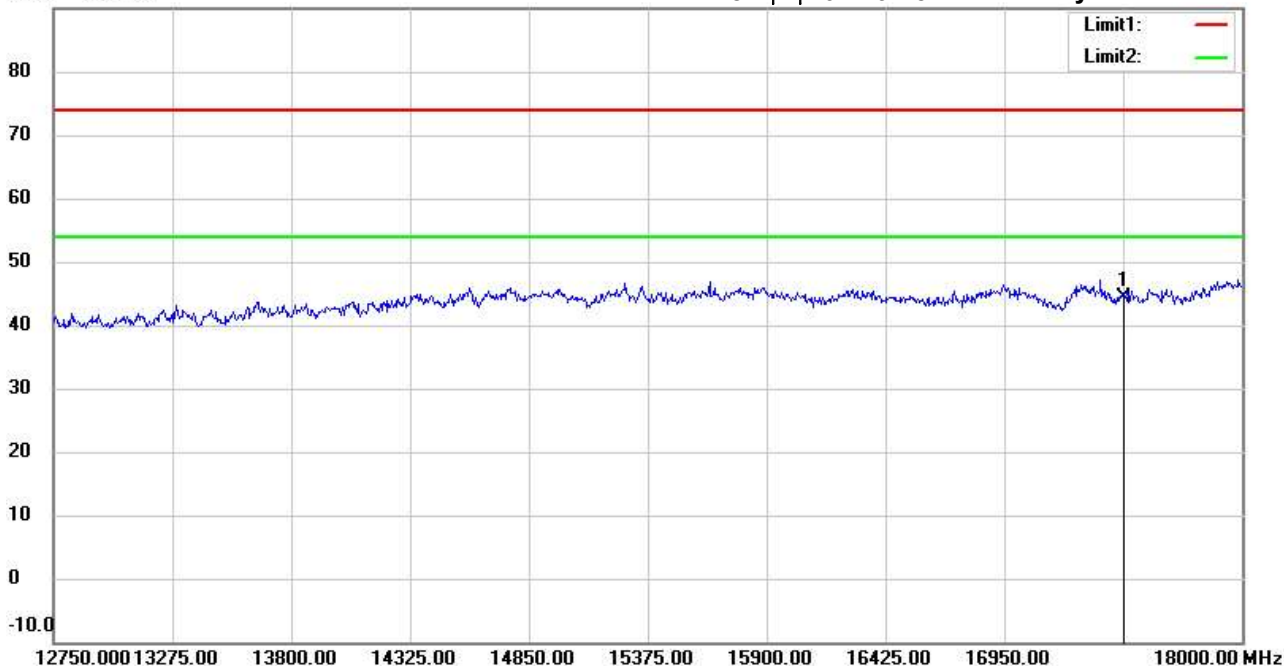

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: Vertical

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	17475.000	21.14	peak	23.21	44.35	74.00	150	168	-29.65	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#5


Date: 2023/11/28

Temperature:23.8 °C

90.0 dBuV/m

Time: 下午 04:45:08

Humidity:61.8 %

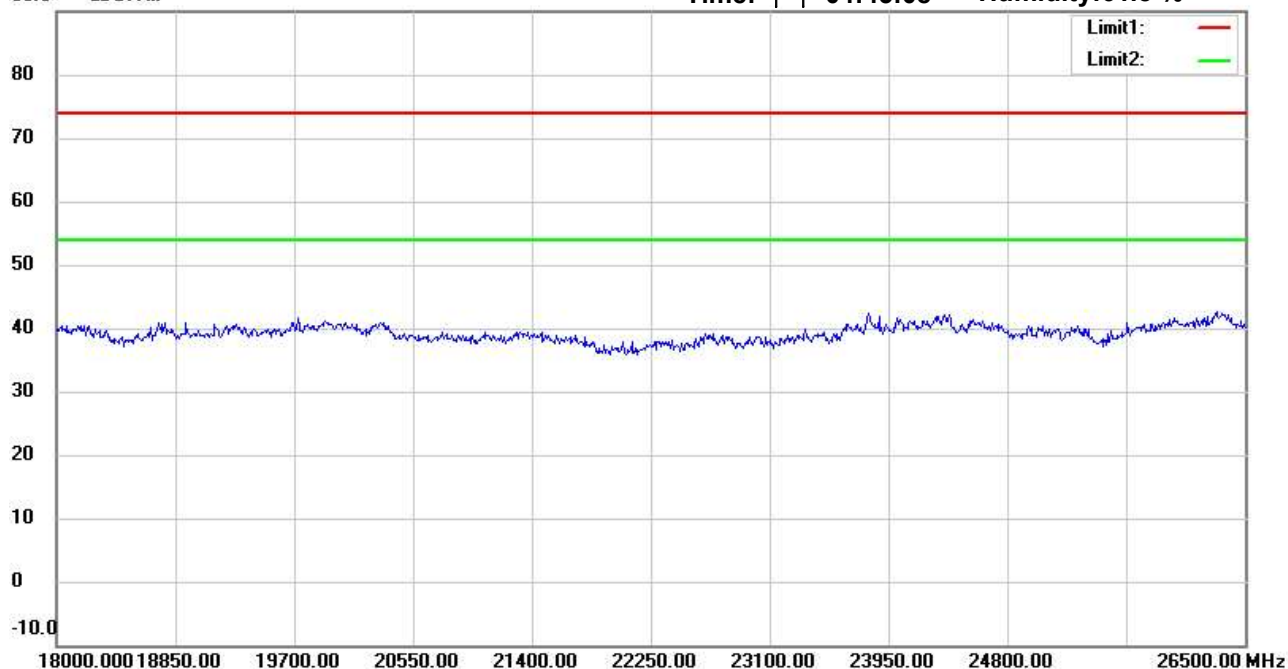

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#11


Date: 2023/11/28

Temperature:23.8 °C

90.0 dBuV/m

Time: 下午 04:49:36

Humidity:61.8 %

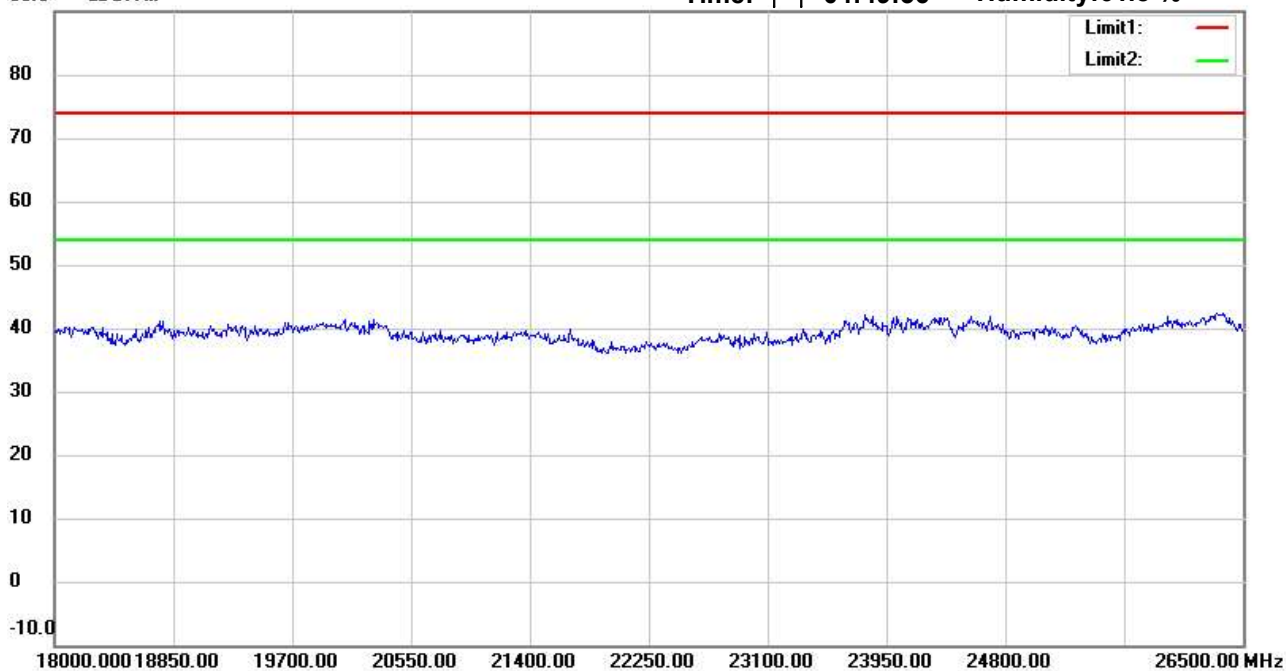

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: Vertical

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#6


Date: 2023/11/28

Temperature:23.8 °C

90.0 dBuV/m

Time: 下午 04:45:19

Humidity:61.8 %

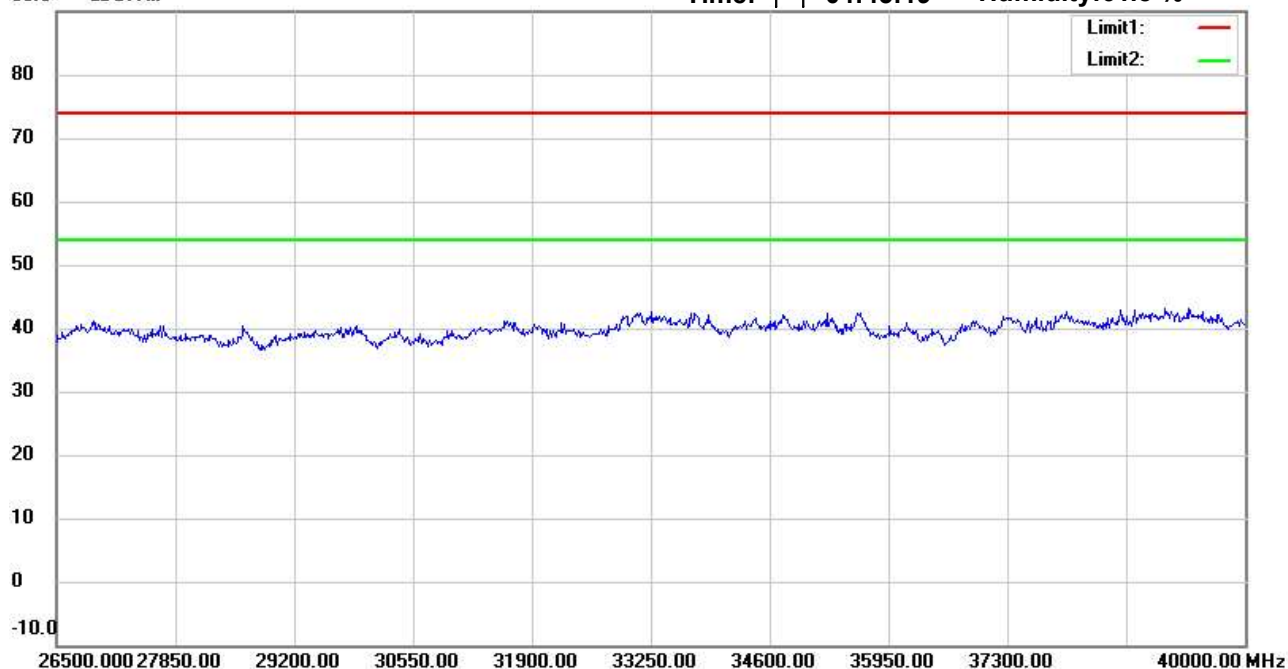

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: Horizontal

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#12


Date: 2023/11/28

Temperature:23.8 °C

90.0 dBuV/m

Time: 下午 04:49:47

Humidity:61.8 %

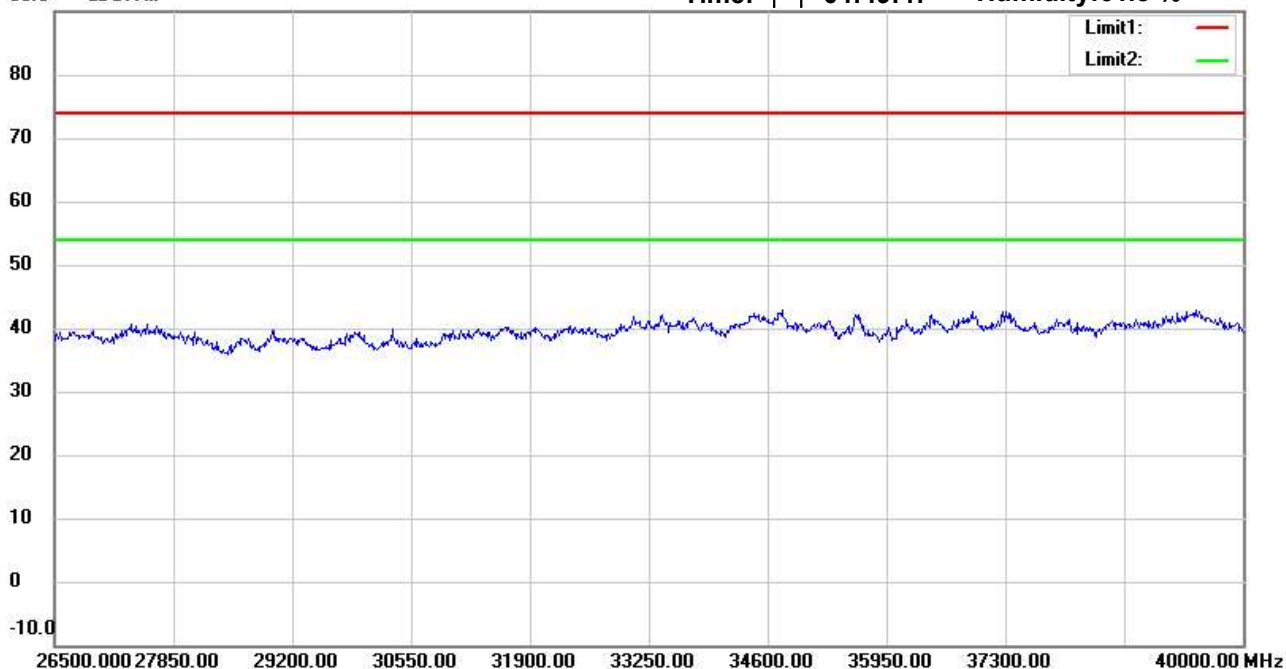

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n20 CH165

Note :

Polarization: Vertical

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#1


Date: 2023/11/28

Temperature:23.8 °C

90.0 dBuV/m

Time: 下午 05:16:17

Humidity:61.8 %

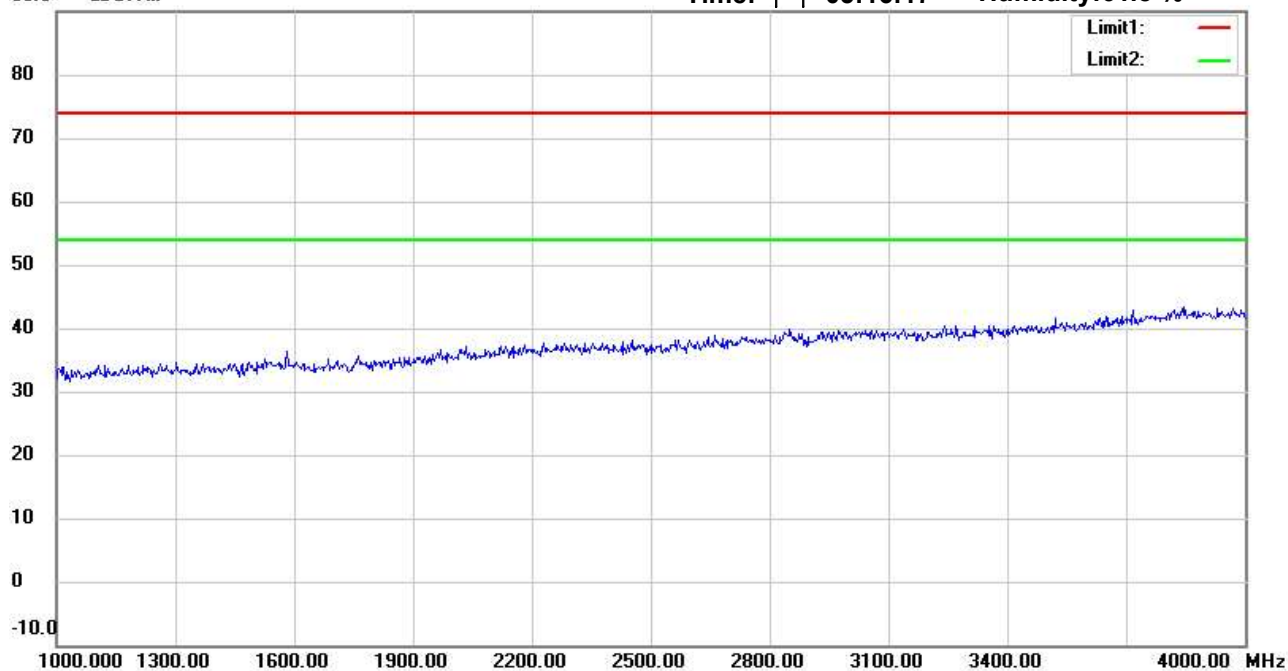

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n40 CH38

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#7


Date: 2023/11/28

Temperature:23.8 °C

90.0 dBuV/m

Time: 下午 05:20:10

Humidity:61.8 %

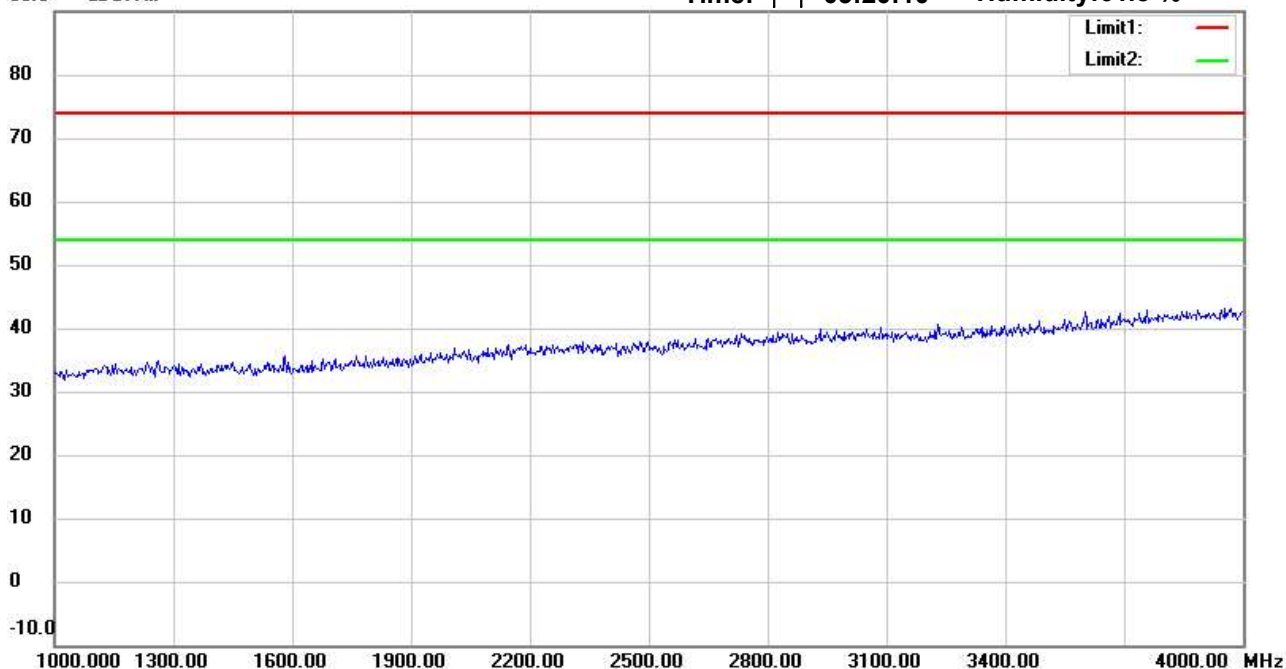

Site : Chamber

Condition : FCC_part 15E RE_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 802.11n40 CH38

Note :

Polarization: **Vertical**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin