

**FCC PART 15 SUBPART B, SUBPART C SECTION 15.231,
RSS GEN, & RSS 210
TEST REPORT**

for

**SHOCK AND DOOR WINDOW DETECTOR
Model: 2GIG-SHKDW1-345**

Prepared for

NORTEK SECURITY & CONTROL LLC
1950 CAMINO VIDA ROBLE, SUITE 150
CARLSBAD, CA 92008

Prepared by: _____

MATT HARRISON

Reviewed by: _____

JOEY MADLANGBAYAN

COMPATIBLE ELECTRONICS INC.
20621 PASCAL WAY
LAKE FOREST, CALIFORNIA 92630
(949) 587-0400

DATE: AUGUST 3rd, 2018

	REPORT	APPENDICES					TOTAL
	BODY	A	B	C	D	E	
PAGES	20	2	2	2	10	16	52

This report shall not be reproduced except in full, without the written approval of Compatible Electronics.



Brea Division
114 Olinda Drive
Brea, CA 92823
(714) 579-0500

Agoura Division
2337 Troutdale Drive
Agoura, CA 91301
(818) 597-0600

Silverado Division
19121 El Toro Road
Silverado, CA 92676
(949) 589-0700

Lake Forest Division
20621 Pascal Way
Lake Forest, CA 92630
(949) 587-0400

TABLE OF CONTENTS

Section / Title	PAGE
GENERAL REPORT SUMMARY	4
SUMMARY OF TEST RESULTS	5
1. PURPOSE	6
2. ADMINISTRATIVE DATA	7
2.1 Location of Testing	7
2.2 Traceability Statement	7
2.3 Cognizant Personnel	7
2.4 Date Test Sample was Received	7
2.5 Disposition of the Test Sample	7
2.6 Abbreviations and Acronyms	7
3. APPLICABLE DOCUMENTS	8
4. DESCRIPTION OF TEST CONFIGURATION	9
4.1 Description of Test Configuration	9
5. LISTS OF EUT, ACCESSORIES AND TEST EQUIPMENT	11
5.1 EUT and Accessory List	11
5.2 EMI Test Equipment	12
6. TEST SITE DESCRIPTION	13
6.1 Test Facility Description	13
6.2 EUT Mounting, Bonding and Grounding	13
6.3 Facility Environmental Characteristics	13
6.4 Measurement Uncertainty	13
7. CHARACTERISTICS OF THE TRANSMITTER	14
7.1 Channel Number and Frequencies	14
7.2 Antenna	14
7.3 EUT Test Software	14
8.1 RF Emissions	15
9. TEST PROCEDURE DEVIATIONS	20
10. CONCLUSIONS	20



LIST OF APPENDICES

APPENDIX	TITLE
A	Laboratory Accreditations and Recognitions
B	Modifications to the EUT
C	Additional Models Covered Under This Report
D	Diagrams, Charts, and Photos • Test Setup Diagrams • Antenna Factors • Radiated Photos
E	Radiated Data Sheets

LIST OF FIGURES

FIGURE	TITLE
1	Plot Map and Layout of Test Site Below 1GHz
2	Plot Map and Layout of Test Site Above 1GHz



GENERAL REPORT SUMMARY

This electromagnetic emission test report is generated by Compatible Electronics Inc., which is an independent testing and consulting firm. The test report is based on testing performed by Compatible Electronics personnel according to the measurement procedures described in the test specifications given below and in the "Test Procedures" section of this report.

The measurement data and conclusions appearing herein relate only to the sample tested and this report may not be reproduced in any form unless done so in full with the written permission of Compatible Electronics.

This report must not be used to claim product certification, approval or endorsement by NVLAP, NIST, or any agency of the federal government.

Device Tested: Shock and Door Window Detector
Model: 2GIG-SHKDW1-345
S/N: None

Product Description: The Shock/Door/Window Contact Sensor (2GIG-SHKDW1-345) is designed for use on doors, windows, and other objects that open and close. It communicates with the control panel using the 345 MHz frequency. When the surface it is mounted on is struck with sufficient force, a signal is continually sent to the control panel, as shock is discontinued a restoral message is sent. Additionally, when the magnet (which is mounted near the sensor) moves away from or closer to the door contact's sensor, signals are transmitted to the control panel. For added protection, it is also equipped with a cover tamper.

Modifications: The EUT was not modified in order to comply with specifications.

Manufacturer: Nortek Security & Control LLC
1950 Camino Vida Roble, Suite 150
Carlsbad, CA 92008

Test Dates: July 26th, 2018

Test Specifications Covered by Accreditation:



EMI requirements

CFR Title 47, Part 15 Subpart C Sections 15.205, 15.207, 15.209 and 15.231
RSS GEN & RSS 210



Test Procedure: ANSI C63.4 & C63.10

Brea Division
114 Olinda Drive
Brea, CA 92823
(714) 579-0500

Agoura Division
2337 Troutdale Drive
Agoura, CA 91301
(818) 597-0600

Silverado Division
19121 El Toro Road
Silverado, CA 92676
(949) 589-0700

Lake Forest Division
20621 Pascal Way
Lake Forest, CA 92630
(949) 587-0400

SUMMARY OF TEST RESULTS

TEST	DESCRIPTION	RESULTS
1	Conducted RF Emissions, 150 kHz - 30 MHz.	The EUT is battery powered; therefore, this test was deemed unnecessary and thus was not performed.
2	Radiated RF Emissions & Harmonics, 9 kHz – 3,450 MHz.	Complies with the limits of CFR Title 47, Part 15 Subpart C Section 15.209, 15.231, & RSS GEN.
3	-20 dB Occupied Bandwidth of the Emission	Complies with the limits of CFR Title 47, Part 15, Subpart C, section 15.231 & RSS 210.
4	Peak Radiated EMI	Complies with the limits of CFR Title 47, Part 15, Subpart C, section 15.231 & RSS 210.
5	Transmit Timeout	Complies with the limits of CFR Title 47, Part 15, Subpart C, section 15.231 & RSS 210.

**TABLE 1
SIX HIGHEST RADIATED EMISSIONS READINGS**

	Reading Type (PK / QP / AV)	Polarization (Vert / Horz)	Frequency (MHz)	Level (dBµV/m)	Limit (dBµV/m)	Delta (dB)	Test Distance
1	AV	V	345.00	76.51	77.16	-0.65	3-Meter
2	PK	V	345.00	96.49	97.16	-0.67	3-Meter
3	AV	H	345.00	75.92	77.16	-1.24	3-Meter
4	PK	H	345.00	95.90	97.16	-1.26	3-Meter
5	AV	V	345.00	73.55	77.16	-3.61	3-Meter
6	PK	V	345.00	93.53	97.16	-3.63	3-Meter



1. PURPOSE

This document is a qualification test report based on the Electromagnetic Interference (EMI) tests performed on the Shock and Door Window Detector Model: 2GIG-SHKDW1-345. The EMI measurements were performed according to the measurement procedure described in ANSI C63.10. The tests were performed in order to determine whether the electromagnetic emissions from the equipment under test, referred to as EUT (equipment under test) hereafter, are within the specification limits defined by the Code of Federal Regulations Title 47, Part 15 Subpart B section 15.109, Subpart C sections 15.205, 15.209, 15.231, RSS GEN, & RSS 210.



2. ADMINISTRATIVE DATA

2.1 Location of Testing

The tests described herein were performed at the test facility of Compatible Electronics, 20621 Pascal Way Lake Forest, California 92630.

2.2 Traceability Statement

The calibration certificates of all test equipment used during the test are on file at the location of the test. The calibration is traceable to the National Institute of Standards and Technology (NIST).

2.3 Cognizant Personnel

Nortek Security & Control LLC

Josh Hansen Engineering Manager, Regulatory

Compatible Electronics, Inc.

Matt Harrison Lab Manager
Joey Madlangbayan Safety Manager

2.4 Date Test Sample was Received

The test sample was received on July 3rd, 2018.

2.5 Disposition of the Test Sample

The test sample remains at Compatible Electronics, Inc. as of the date of this test report.

2.6 Abbreviations and Acronyms

The following abbreviations and acronyms may be used in this document.

RF	Radio Frequency
EMI	Electromagnetic Interference
EUT	Equipment Under Test
P/N	Part Number
S/N	Serial Number
HP	Hewlett Packard
ITE	Information Technology Equipment
CML	Corrected Meter Limit
LISN	Line Impedance Stabilization Network
NVLAP	National Voluntary Laboratory Accreditation Program
CFR	Code of Federal Regulations
PCB	Printed Circuit Board
TX	Transmit
RX	Receive



3. APPLICABLE DOCUMENTS

The following documents are referenced or used in the preparation of this Test Report.

SPEC	TITLE
CFR Title 47, Part 15	FCC Rules – Radio frequency devices (including digital devices)
ANSI C63.4 2014	Methods of measurement of radio-noise emissions from low-voltage electrical and electronic equipment in the range of 9 kHz to 40 GHz.
ANSI C63.10: 2013	American National Standard for Testing Unlicensed Wireless Devices
RSS GEN	General Requirements for Compliance of Radio Apparatus
RSS 210	Licence-exempt Radio Apparatus (All Frequency Bands): Category I Equipment



4. DESCRIPTION OF TEST CONFIGURATION

4.1 Description of Test Configuration

The Shock and Door Window Detector Model: 2GIG-SHKDW1-345 (EUT) was setup in a standalone tabletop configuration. The EUT was checked in all 3 axes. The worst case was found to be the Y-Axis. The EUT was continuously transmitting during the transmit tests and in standby mode for standby tests.

The EUT was tested with new batteries.

It was determined that the emissions were at their highest level when the EUT was transmitting in the configuration described above for Radiated Emissions. The final radiated data was taken in the above configuration. Please see Appendix E for the test data.

4.1.1 Photograph Test Configuration (X-Axis Shown)




4.1.2 Cable Construction and Termination

The EUT had no interconnecting cables.

4.1.3 Axis Orientation


Y axis

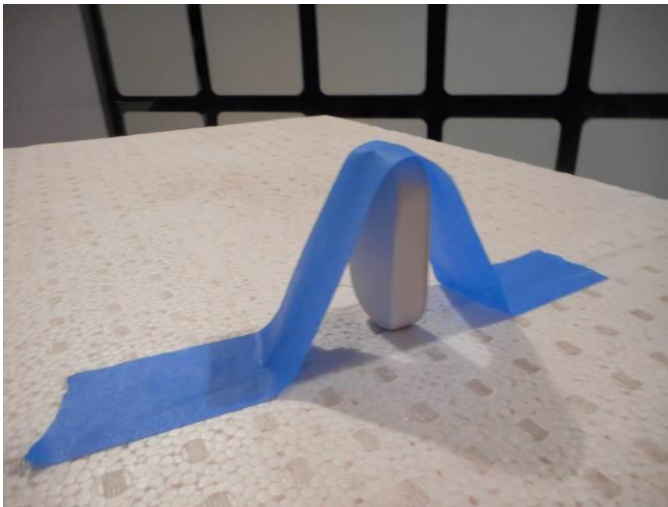

X Axis



Z AXIS

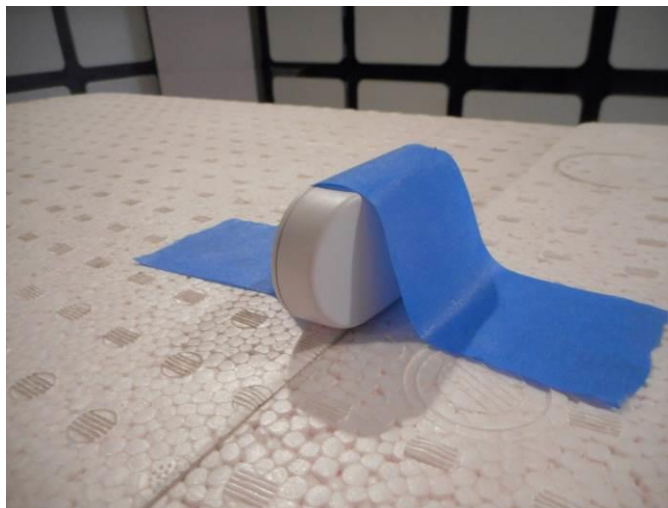

5. LISTS OF EUT, ACCESSORIES AND TEST EQUIPMENT**5.1 EUT and Accessory List**

#	EQUIPMENT TYPE	MANU-FACTURER	MODEL	SERIAL NUMBER
1	SHOCK AND DOOR WINDOW DETECTOR (EUT)	NORTEK SECURITY & CONTROL LLC	2GIG-SHKDW1-345	NONE
2	BATTERY	PANASONIC	CR2450	NONE



5.2 EMI Test Equipment

EQUIPMENT TYPE	MANUFACTURER	MODEL NUMBER	SERIAL NUMBER	CAL. DATE	CAL. DUE DATE
Computer	Compatible Electronics	NONE	NONE	N/A	N/A
EMI Receiver	Rohde & Schwarz	ESIB40	100218	03/05/2018	03/05/2019
Antenna, Loop	Com Power	AL-130	121049	02/09/2017	02/09/2019
Antenna, CombiLog	Com Power	AC-220	061105	03/12/2018	03/12/2019
Antenna, Horn 1-18GHz	Com Power	AH-118	071225	07/05/2018	07/05/2019
Mast, Antenna Positioner	Sunol Science Corporation	TWR 95-4	020808-3	N/A	N/A
Antenna Mast	Sunol Science Corporation	TWR 95-4	020808-3	N/A	N/A
Turntable	Sunol Science Corporation	FM 2001	N/A	N/A	N/A
Mast and Turntable Controller	Sunol Science Corporation	SC104V	020808-1	N/A	N/A



6. TEST SITE DESCRIPTION

6.1 Test Facility Description

Please refer to section 2.1 and the figures in Appendix D of this report for test location.

6.2 EUT Mounting, Bonding and Grounding

For below 1GHz the EUT was mounted 0.8-meter-high on a non-conductive surface, which was placed above the ground plane for below 1GHz.

For above 1GHz the EUT was mounted on a 1.5-meter-high non-conductive tabletop, which was placed on the ground plane.

The EUT was not grounded.

6.3 Facility Environmental Characteristics

When applicable refer to the data sheets in Appendix E for the relative humidity, air temperature, and barometric pressure.

6.4 Measurement Uncertainty

“Compatible Electronics’ U_{lab} value is less than U_{cispr} , thus based on this – compliance is deemed to occur if no measured disturbance exceeds the disturbance limit

$$u_c(y) = \sqrt{\sum_i c_i^2 u^2(x_i)}$$

Measurement		U_{cispr}	$U_{lab} = 2 u_c(y)$
Conducted disturbance (mains port)	(150 kHz – 30 MHz)	3,6 dB	2.88
Radiated disturbance (electric field strength on an open area test site or alternative test site)	(30 MHz – 1 000 MHz)	5,2 dB	3.53



7. CHARACTERISTICS OF THE TRANSMITTER

7.1 Channel Number and Frequencies

The EUT has one operating channel and the EUT has OOK modulation. The EUT has a fixed output power.

1 == 345 MHz

7.2 Antenna

The antenna is made up of an etched trace on the PCB.

7.3 EUT Test Software

Rev 99.07

Date: N/A

Location: Nortek Security & Control LLC. / Nortek Security & Control LLC 5919 Sea Otter Place, Suite 100, Carlsbad, CA 92010



8.

TEST PROCEDURES

The following sections describe the test methods and the specifications for the tests. Test results are also included in this section.


8.1**RF Emissions****8.1.1*****Conducted Emissions Test***

Test Results: *The EUT was battery operated; therefore, this test was deemed unnecessary and thus was not performed. If this test had been performed it would have been as below.*

The EMI receiver was used as a measuring meter. A quasi-peak and/or average reading was taken only where indicated in the data sheets. The LISN output was measured using the EMI receiver. The output of the second LISN was terminated by a 50-ohm termination. The effective measurement bandwidth used for this test was 9 kHz.

Please see section 6.2 of this report for mounting, bonding, and grounding of the EUT. The EUT received its power through the LISN, which was bonded to the ground plane. The EUT was set up with the minimum distances from any conductive surfaces as specified in ANSI 63.4. The excess power cord was wrapped in a figure eight pattern to form a bundle not exceeding 0.4 meters in length.

The conducted emissions from the EUT were maximized for operating mode as well as cable placement. The final data was collected under program control by the computer software.

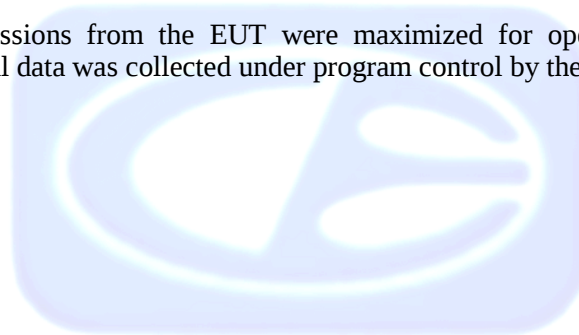

8.1.2 Radiated Emissions (Spurious and Harmonics) Test

The EMI receiver was used as a measuring meter. The receiver was used in the peak detect mode with the "Max Hold" feature activated. In this mode, the receiver records the highest measured reading over all the sweeps.

For spurious emissions the quasi-peak detector was used for frequencies below 1GHz and the average detector was used for frequencies above 1 GHz.

For the Fundamental & Harmonic emissions a duty cycle average was used.

The measurement bandwidths and transducers used for the radiated emissions test were:

FREQUENCY RANGE (MHz)	TRANSDUCER	EFFECTIVE MEASUREMENT BANDWIDTH
.009 to .150	Active Loop Antenna	200 Hz
.150 to 30	Active Loop Antenna	9 kHz
30 to 1000	Combilog Antenna	100 kHz (120kHz for QP Measurements)
1000 to 3450	Horn Antenna	1 MHz

The TDK FAC-3 shielded test chamber of Compatible Electronics, Inc. was used for radiated emissions testing. This test site is in full compliance with ANSI C63.4 & ANSI C63.10. Please see section 6.2 of this report for mounting, bonding and grounding of the EUT. The turntable supporting the EUT is remote controlled using a motor. The turntable permits EUT rotation of 360 degrees in order to maximize emissions. Also, the antenna mast allows height variation of the antenna from 1 meter to 4 meters. Data was collected in the worst case (highest emission) configuration of the EUT. At each reading, the EUT was rotated 360 degrees and the antenna height was varied from 1 to 4 meters in both vertical and horizontal polarizations (for E field radiated field strength).

Test Results:

The EUT complies with the limits of CFR Title 47 Part 15 Subpart B section 15.109, Subpart C sections 15.205, 15.209, 15.231, RSS GEN & RSS 210. The six highest emissions are listed in table 1.



8.1.3 *Peak radiated EMI*

The EUT was tested at a 3-meter test distance to obtain the final test data. The final qualification data sheets are located in Appendix E. This data also shows compliance at the band edges.

Duty Cycle Correction Factor = -20.00dB

$$\delta(\text{dB}) = 20 \log \left[\sum (nt_1 + mt_2 + \dots + \xi t_x) / T \right]$$

where

n is the number of pulses of duration t_1

m is the number of pulses of duration t_2

ξ is the number of pulses of duration t_x

T is the period of the pulse train or 100 ms if the pulse train length is greater than 100 ms

Pulse Type 1 = $52 * 158.51 \mu\text{S} = 8242.98 \mu\text{S}$

Pulse Type 2 = $6 * 295.59 \mu\text{S} = 1773.54 \mu\text{S}$

$8242.98 \mu\text{S} + 1773.54 \mu\text{S} = 10.01606 \text{ mS}$

Total On Time = 10.01606 mS

$10.01606 / 100 \text{ mS} = 0.1002$

$20 \log (0.1002) = -19.98 \text{ dB}$ correction factor

Duty Cycle Correction Factor Used = -19.98 dB

Test Results:

The EUT complies with Part 15, Subpart C, section 15.231 & RSS 210.



8.1.4 Bandwidth of the Fundamental

The -20 dB bandwidth was checked using the EMI Receiver in the spectrum analyzer mode to see that the emissions were wholly within the 0.25% of the operating frequency centered on the fundamental frequency. The RBW was set to 1-5% of the occupied bandwidth and the VBW was set to approximately three times the RBW. The span was to between two and five times the occupied bandwidth. A Plot of the -20 dB bandwidth is located in Appendix E.

Test Results:

The EUT complies with the requirements of CFR Title 47, Part 15, Subpart C, section 15.231 (c) for the -20 dB bandwidth of the fundamental. The EUT has a -20 dB bandwidth that is lies wholly within the 0.25% of the operating frequency centered on the fundamental frequency.

8.1.5 Occupied Bandwidth

The 99% occupied bandwidth was checked using EMI Receiver. The RBW was set to 1-5% of the occupied bandwidth and the VBW was set to approximately three times the RBW. The span was to between two and five times the occupied bandwidth. A Plot of the Occupied Bandwidth is located in Appendix E.

Test Results:

The EUT complies with the requirements of RSS GEN for the -20 dB bandwidth of the fundamental. The EUT has a -20 dB bandwidth that is lies wholly within the 0.25% of the operating frequency centered on the fundamental frequency.

8.1.6 Transmit Timeout

The Transmit timeout test was performed using the EMI Receiver to make sure the transmission coming from the transmitter would cease within 5 seconds after the activation. A Plot of the transmission duration is located in Appendix E.

Test Results:

The EUT complies with the requirements of CFR Title 47, Part 15, Subpart C, section 15.231 (c) & RSS 210 for Transmit Timeout less than 5 seconds.



8.1.7 Sample Calculations

A correction factor for the antenna, cable and a distance factor (if any) must be applied to the meter reading before a true field strength reading can be obtained. This Corrected Meter Reading is then compared to the specification limit in order to determine compliance with the limits.

The equation can be derived in the following manner:

Specification limit ($\mu\text{V/m}$) $\log \times 20$ = Specification Limit in dBuV

(Specification distance / test distance) $\log \times 40$ = distance factor

Note: When using an Active Antenna, the Antenna factor shall be subtracted due to the combination of the internal amplification and antenna loss. At lower frequencies the cable loss is negligible.

OR

Corrected Meter Reading = meter reading + F – A + C

where:

F = antenna factor

A = amplifier gain

C = cable loss

The correction factors for the antenna and the amplifier gain are attached in Appendix D of this report. The data sheets are attached in Appendix E.

The distance factor D is 0 when the test is performed at the required specification distance.



9. TEST PROCEDURE DEVIATIONS

The test procedures were not deviated from throughout all tests.

10. CONCLUSIONS

The Shock and Door Window Detector Model: 2GIG-SHKDW1-345 meets all of the relevant specification requirements defined in the Code of Federal Regulations Title 47, Part 15 Subpart C sections 15.205, 15.207, 15.209, 15.231, RSS GEN, & RSS 210.



APPENDIX A***LABORATORY ACCREDITATIONS AND
RECOGNITIONS***

Brea Division
114 Olinda Drive
Brea, CA 92823
(714) 579-0500

Agoura Division
2337 Troutdale Drive
Agoura, CA 91301
(818) 597-0600

Silverado Division
19121 El Toro Road
Silverado, CA 92676
(949) 589-0700

Lake Forest Division
20621 Pascal Way
Lake Forest, CA 92630
(949) 587-0400

LABORATORY ACCREDITATIONS AND RECOGNITIONS



For US, Canada, Australia/New Zealand, Japan, Taiwan, Korea, and the European Union, Compatible Electronics is currently accredited by NVLAP to ISO/IEC 17025.

For the most up-to-date version of our scopes and certificates please visit

<http://celectronics.com/quality/scope/>

Quote from ISO-ILAC-IAF Communiqué on 17025:

"A laboratory's fulfilment of the requirements of ISO/IEC 17025:2005 means the laboratory meets both the technical competence requirements and management system requirements that are necessary for it to consistently deliver technically valid test results and calibrations. The management system requirements in ISO/IEC 17025:2005 (Section 4) are written in language relevant to laboratory operations and meet the principles of ISO 9001:2008 Quality Management Systems — Requirements."

IC OAT's Test Site Registration Number: 2154C-1



Brea Division
114 Olinda Drive
Brea, CA 92823
(714) 579-0500

Agoura Division
2337 Troutdale Drive
Agoura, CA 91301
(818) 597-0600

Silverado Division
19121 El Toro Road
Silverado, CA 92676
(949) 589-0700

Lake Forest Division
20621 Pascal Way
Lake Forest, CA 92630
(949) 587-0400

APPENDIX B***MODIFICATIONS TO THE EUT***

Brea Division
114 Olinda Drive
Brea, CA 92823
(714) 579-0500

Agoura Division
2337 Troutdale Drive
Agoura, CA 91301
(818) 597-0600

Silverado Division
19121 El Toro Road
Silverado, CA 92676
(949) 589-0700

Lake Forest Division
20621 Pascal Way
Lake Forest, CA 92630
(949) 587-0400

MODIFICATIONS TO THE EUT

There were no modifications were made during testing.



APPENDIX C***ADDITIONAL MODELS COVERED
UNDER THIS REPORT***

Brea Division
114 Olinda Drive
Brea, CA 92823
(714) 579-0500

Agoura Division
2337 Troutdale Drive
Agoura, CA 91301
(818) 597-0600

Silverado Division
19121 El Toro Road
Silverado, CA 92676
(949) 589-0700

Lake Forest Division
20621 Pascal Way
Lake Forest, CA 92630
(949) 587-0400

ADDITIONAL MODELS COVERED UNDER THIS REPORT

USED FOR THE PRIMARY TEST

SHOCK AND DOOR WINDOW DETECTOR

MODEL: 2GIG-SHKDW1-345

S/N: NONE

No additional models were tested.



Brea Division
114 Olinda Drive
Brea, CA 92823
(714) 579-0500

Agoura Division
2337 Troutdale Drive
Agoura, CA 91301
(818) 597-0600

Silverado Division
19121 El Toro Road
Silverado, CA 92676
(949) 589-0700

Lake Forest Division
20621 Pascal Way
Lake Forest, CA 92630
(949) 587-0400

APPENDIX D***DIAGRAMS, CHARTS, AND PHOTOS***

Brea Division
114 Olinda Drive
Brea, CA 92823
(714) 579-0500

Agoura Division
2337 Troutdale Drive
Agoura, CA 91301
(818) 597-0600

Silverado Division
19121 El Toro Road
Silverado, CA 92676
(949) 589-0700

Lake Forest Division
20621 Pascal Way
Lake Forest, CA 92630
(949) 587-0400

FIGURE 1: PLOT MAP AND LAYOUT OF TEST SITE BELOW 1GHZ


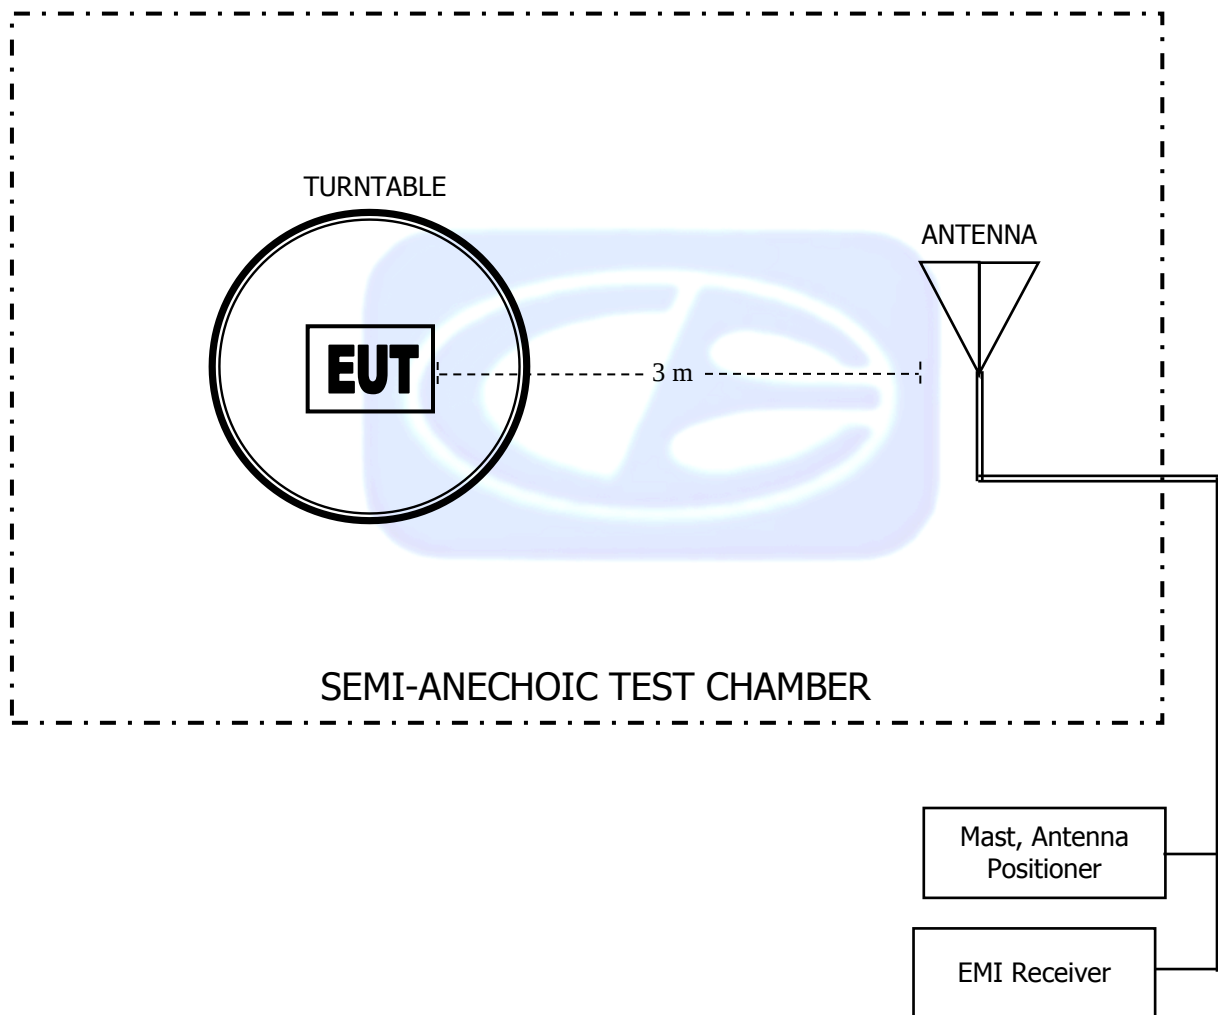


FIGURE 2: PLOT MAP AND LAYOUT OF TEST SITE ABOVE 1GHZ



COM-POWER AL-130**LOOP ANTENNA****S/N: 121049****CALIBRATION DUE: FEBRUARY 9, 2019**

FREQUENCY (MHz)	MAGNETIC (dB/m)	ELECTRIC (dB/m)	FREQUENCY (MHz)	MAGNETIC (dB/m)	ELECTRIC (dB/m)
0.009	-34.64	16.86	0.8	-36.32	15.18
0.01	-34.78	16.72	0.9	-36.22	15.28
0.02	-35.91	15.59	1.0	-36.22	15.28
0.03	-35.48	16.02	2.0	-35.91	15.59
0.04	-35.82	15.68	3.0	-35.91	15.59
0.05	-36.49	15.01	4.0	-36.01	15.49
0.06	-36.30	15.20	5.0	-35.80	15.70
0.07	-36.43	15.07	6.0	-36.00	15.50
0.08	-36.30	15.20	7.0	-35.90	15.60
0.09	-36.39	15.11	8.0	-35.70	15.80
0.1	-36.41	15.09	9.0	-35.70	15.80
0.2	-36.61	14.89	10.0	-35.60	15.90
0.3	-36.63	14.87	15.0	-36.52	14.98
0.4	-36.52	14.99	20.0	-35.75	15.75
0.5	-36.63	14.87	25.0	-37.78	13.72
0.6	-36.62	14.88	30.0	-38.62	12.88
0.7	-36.53	14.97			

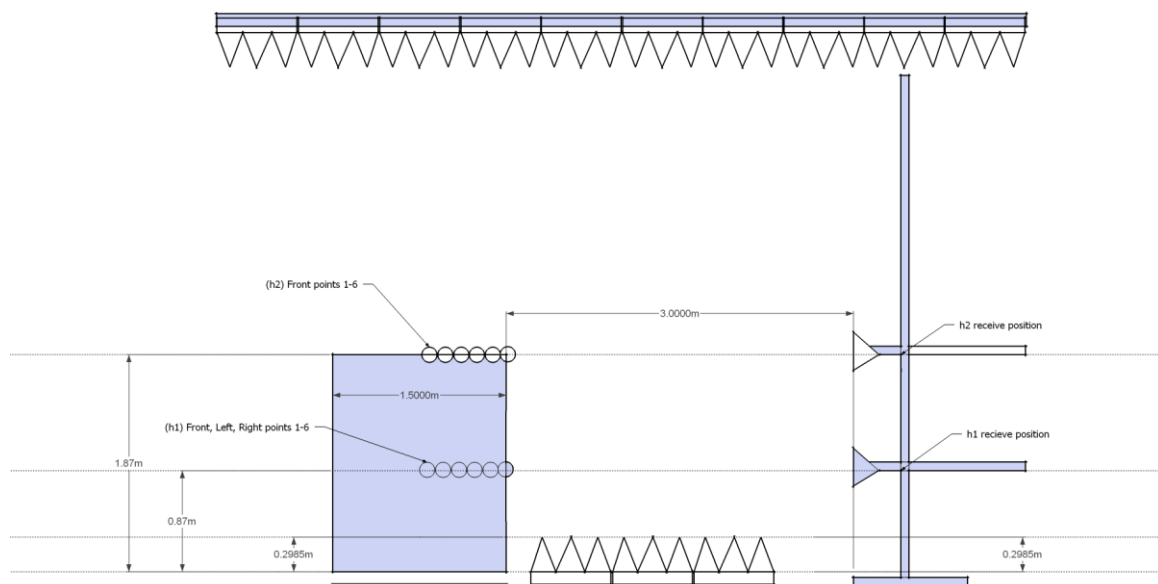

COM-POWER AC-220**LAB P - COMBILOG ANTENNA****S/N: 061105****CALIBRATION DUE: MARCH 12, 2019**

FREQUENCY (MHz)	FACTOR (dB)	FREQUENCY (MHz)	FACTOR (dB)
30	24.05	160	13.57
35	22.46	180	14.07
40	19.36	200	14.72
45	17.42	250	18.27
50	15.77	300	20.95
60	12.86	400	23.16
70	11.22	500	21.86
80	11.84	600	23.54
90	13.48	700	23.85
100	14.80	800	25.91
120	16.38	900	26.71
140	14.41	1000	27.60



COM-POWER AH-118**HORN ANTENNA****S/N: 071225****CALIBRATION DUE: JULY 5, 2019**

FREQUENCY (MHz)	FACTOR (dB)	FREQUENCY (MHz)	FACTOR (dB)
1000	24.45	9500	38.91
1500	25.34	10000	39.38
2000	28.06	10500	39.64
2500	28.82	11000	39.42
3000	29.80	11500	39.84
3500	30.65	12000	39.66
4000	31.28	12500	40.12
4500	32.24	13000	40.27
5000	33.09	13500	40.42
5500	33.55	14000	40.85
6000	34.45	14500	42.06
6500	35.37	15000	42.33
7000	36.91	15500	39.45
7500	37.39	16000	39.54
8000	37.62	16500	39.57
8500	37.40	17000	41.79
9000	37.39	17500	43.87
		18000	44.53



**FRONT VIEW**

NORTEK SECURITY & CONTROL LLC
SHOCK AND DOOR WINDOW DETECTOR
MODEL: 2GIG-SHKDW1-345
FCC SUBPART C - RADIATED EMISSIONS < 1GHz

**PHOTOGRAPH SHOWING THE EUT CONFIGURATION
FOR MAXIMUM EMISSIONS**

Brea Division
114 Olinda Drive
Brea, CA 92823
(714) 579-0500

Agoura Division
2337 Troutdale Drive
Agoura, CA 91301
(818) 597-0600

Silverado Division
19121 El Toro Road
Silverado, CA 92676
(949) 589-0700

Lake Forest Division
20621 Pascal Way
Lake Forest, CA 92630
(949) 587-0400

**REAR VIEW**

NORTEK SECURITY & CONTROL LLC
SHOCK AND DOOR WINDOW DETECTOR
MODEL: 2GIG-SHKDW1-345
FCC SUBPART C - RADIATED EMISSIONS < 1GHZ

**PHOTOGRAPH SHOWING THE EUT CONFIGURATION
FOR MAXIMUM EMISSIONS**



Brea Division
114 Olinda Drive
Brea, CA 92823
(714) 579-0500

Agoura Division
2337 Troutdale Drive
Agoura, CA 91301
(818) 597-0600

Silverado Division
19121 El Toro Road
Silverado, CA 92676
(949) 589-0700

Lake Forest Division
20621 Pascal Way
Lake Forest, CA 92630
(949) 587-0400



FRONT VIEW

NORTEK SECURITY & CONTROL LLC
SHOCK AND DOOR WINDOW DETECTOR
MODEL: 2GIG-SHKDW1-345
FCC SUBPART C - RADIATED EMISSIONS > 1GHZ

**PHOTOGRAPH SHOWING THE EUT CONFIGURATION
FOR MAXIMUM EMISSIONS**



Brea Division
114 Olinda Drive
Brea, CA 92823
(714) 579-0500

Agoura Division
2337 Troutdale Drive
Agoura, CA 91301
(818) 597-0600

Silverado Division
19121 El Toro Road
Silverado, CA 92676
(949) 589-0700

Lake Forest Division
20621 Pascal Way
Lake Forest, CA 92630
(949) 587-0400



REAR VIEW

NORTEK SECURITY & CONTROL LLC
SHOCK AND DOOR WINDOW DETECTOR
MODEL: 2GIG-SHKDW1-345
FCC SUBPART C - RADIATED EMISSIONS > 1GHZ

**PHOTOGRAPH SHOWING THE EUT CONFIGURATION
FOR MAXIMUM EMISSIONS**



Brea Division
114 Olinda Drive
Brea, CA 92823
(714) 579-0500

Agoura Division
2337 Troutdale Drive
Agoura, CA 91301
(818) 597-0600

Silverado Division
19121 El Toro Road
Silverado, CA 92676
(949) 589-0700

Lake Forest Division
20621 Pascal Way
Lake Forest, CA 92630
(949) 587-0400

APPENDIX E***RADIATED EMISSIONS DATA SHEETS***

Brea Division
114 Olinda Drive
Brea, CA 92823
(714) 579-0500

Agoura Division
2337 Troutdale Drive
Agoura, CA 91301
(818) 597-0600

Silverado Division
19121 El Toro Road
Silverado, CA 92676
(949) 589-0700

Lake Forest Division
20621 Pascal Way
Lake Forest, CA 92630
(949) 587-0400

Title: FCC 15.209

7/26/2018 12:22:14 PM

File: Radiated Pre-Scan 30-1000Mhz.set

Sequence: Preliminary Scan

Operator: Matt Harrison

EUT Type: 2GIG-SHKDW1-345

EUT Condition: Constantly transmitting @ 345 MHz in Y-Axis


Comments: Standalone

Temp: 71f

Hum: 48%

Battery Powered

Compatible Electronics, Inc. FAC-3 (Lab P)

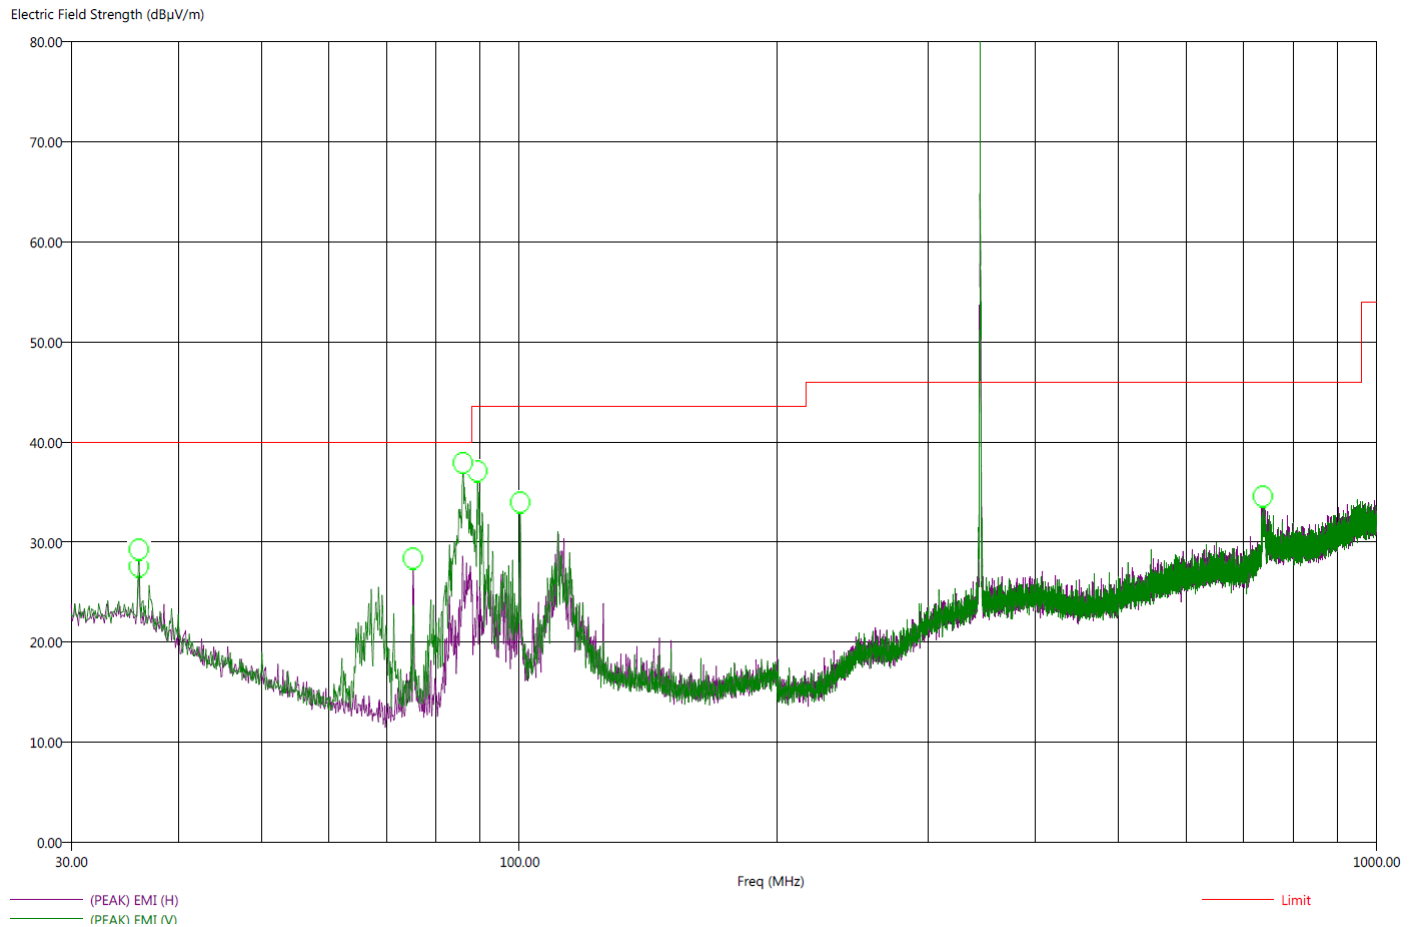

*There were no radiated emissions found below 30 MHz or above 1GHz.
No additional emissions were found in standby mode.*



Brea Division
114 Olinda Drive
Brea, CA 92823
(714) 579-0500

Agoura Division
2337 Troutdale Drive
Agoura, CA 91301
(818) 597-0600

Silverado Division
19121 El Toro Road
Silverado, CA 92676
(949) 589-0700

Lake Forest Division
20621 Pascal Way
Lake Forest, CA 92630
(949) 587-0400

Title: FCC 15.209

7/26/2018 1:31:37 PM

File: Radiated Final 30-1000Mhz.set

Sequence: Final Measurements

Operator: Matt Harrison

EUT Type: 2GIG-SHKDW1-345

EUT Condition: Constantly transmitting @ 345 MHz in Y-Axis

Comments: Standalone

Temp: 71f

Hum: 48%

Battery Powered

Compatible Electronics, Inc. FAC-3 (Lab P)

Freq (MHz)	(QP) Margin (dB)	(QP) EMI (dBμV/m)	(PEAK) EMI (dBμV/m)	Limit (dBμV/m)	Pol	Ttbl Agl (deg)	Twr Ht (cm)	Transducer (dB)	Cable (dB)
36.00	-11.10	28.90	32.30	40.00	H	84.00	174.47	21.81	0.47
36.00	-12.29	27.71	31.47	40.00	V	189.25	172.58	21.78	0.47
75.20	-17.26	22.74	27.76	40.00	H	357.50	387.41	11.55	0.69
86.00	-9.81	30.19	33.24	40.00	V	38.00	188.05	12.85	0.75
89.40	-12.84	30.68	33.23	43.52	V	196.50	201.29	13.39	0.76
100.30	-7.15	36.37	40.84	43.52	V	17.00	191.23	14.82	0.91

*There were no radiated emissions other than harmonics found below 30 MHz or above 1GHz.**No additional emissions were found in standby mode.*

Brea Division
114 Olinda Drive
Brea, CA 92823
(714) 579-0500

Agoura Division
2337 Troutdale Drive
Agoura, CA 91301
(818) 597-0600

Silverado Division
19121 El Toro Road
Silverado, CA 92676
(949) 589-0700

Lake Forest Division
20621 Pascal Way
Lake Forest, CA 92630
(949) 587-0400

FUNDAMENTAL & HARMONICS



DATA SHEETS



Brea Division
114 Olinda Drive
Brea, CA 92823
(714) 579-0500

Agoura Division
2337 Troutdale Drive
Agoura, CA 91301
(818) 597-0600

Silverado Division
19121 El Toro Road
Silverado, CA 92676
(949) 589-0700

Lake Forest Division
20621 Pascal Way
Lake Forest, CA 92630
(949) 587-0400

FUNDAMENTAL FIELD STRENGTH

FCC 15.231

Company: Nortek
EUT: Shock and Door Window Detector
Model: 2GIG-SHKDW1-345
Duty Cycle Correction Factor: -19.98

Date: 7/26/2018
Lab: P
Tested By: Matt H.

Compatible Electronics, Inc. FAC-3

Freq. (MHz)	Level (dBuV/m)	Pol (v/h)	Limit	Margin	Peak / QP / Avg	Table	Tower	Comments
345.00	95.90	H	97.16	-1.26	Peak	282.00	1.00	X-Axis
345.00	75.92	H	77.16	-1.24	Avg	282.00	1.00	X-Axis
345.00	83.92	V	97.16	-13.24	Peak	160.00	3.20	X-Axis
345.00	63.94	V	77.16	-13.22	Avg	160.00	3.20	X-Axis
345.00	93.01	H	97.16	-4.15	Peak	108.00	2.50	Z-Axis
345.00	73.03	H	77.16	-4.13	Avg	108.00	2.50	Z-Axis
345.00	93.53	V	97.16	-3.63	Peak	222.00	1.90	Z-Axis
345.00	73.55	V	77.16	-3.61	Avg	222.00	1.90	Z-Axis
345.00	91.10	H	97.16	-6.06	Peak	180.00	1.80	Y-Axis
345.00	71.12	H	77.16	-6.04	Avg	180.00	1.80	Y-Axis
345.00	96.49	V	97.16	-0.67	Peak	130.00	1.80	Y-Axis
345.00	76.51	V	77.16	-0.65	Avg	130.00	1.80	Y-Axis



HARMONICS - HORIZONTAL

FCC 15.231

Company: Nortek
EUT: Shock and Door Window Detector
Model: 2GIG-SHKDW1-345
Duty Cycle Correction Factor: -19.98

Date: 7/26/2018
Lab: P
Tested By: Matt H.

Freq. (MHz)	Level (dBuV/m)	Pol (v/h)	Limit (dBuV/m)	Margin (dB)	Peak / QP / Avg	Ant. Height (m)	Table Angle (deg)	Comments
690.00	--	H	66.00	--	Peak	--	--	No Emissions Found
690.00	--	H	46.00	--	Avg	--	--	No Emissions Found
1035.00	--	H	73.98	--	Peak	--	--	No Emissions Found
1035.00	--	H	53.98	--	Avg	--	--	No Emissions Found
1380.00	--	H	73.98	--	Peak	--	--	No Emissions Found
1380.00	--	H	53.98	--	Avg	--	--	No Emissions Found
1725.00	--	H	73.98	--	Peak	--	--	No Emissions Found
1725.00	--	H	53.98	--	Avg	--	--	No Emissions Found
2070.00	--	H	73.98	--	Peak	--	--	No Emissions Found
2070.00	--	H	53.98	--	Avg	--	--	No Emissions Found
2415.00	--	H	73.98	--	Peak	--	--	No Emissions Found
2415.00	--	H	53.98	--	Avg	--	--	No Emissions Found
2760.00	--	H	73.98	--	Peak	--	--	No Emissions Found
2760.00	--	H	53.98	--	Avg	--	--	No Emissions Found
3105.00	--	H	73.98	--	Peak	--	--	No Emissions Found
3105.00	--	H	53.98	--	Avg	--	--	No Emissions Found
3450.00	--	H	73.98	--	Peak	--	--	No Emissions Found
3450.00	--	H	53.98	--	Avg	--	--	No Emissions Found

Test distance
3 meter



HARMONICS - VERTICAL

FCC 15.231

Company: Nortek
 EUT: Shock and Door Window Detector
 Model: 2GIG-SHKDW1-345
 Duty Cycle Correction Factor: -19.98

Date: 7/26/2018
 Lab: P
 Tested By: Matt H.

Freq. (MHz)	Level (dBuV/m)	Pol (v/h)	Limit (dBuV/m)	Margin (dB)	Peak / QP / Avg	Ant. Height (m)	Table Angle (deg)	Comments
690.00	--	V	66.00	--	Peak	--	--	No Emissions Found
690.00	--	V	46.00	--	Avg	--	--	No Emissions Found
1035.00	--	V	73.98	--	Peak	--	--	No Emissions Found
1035.00	--	V	53.98	--	Avg	--	--	No Emissions Found
1380.00	--	V	73.98	--	Peak	--	--	No Emissions Found
1380.00	--	V	53.98	--	Avg	--	--	No Emissions Found
1725.00	--	V	73.98	--	Peak	--	--	No Emissions Found
1725.00	--	V	53.98	--	Avg	--	--	No Emissions Found
2070.00	--	V	73.98	--	Peak	--	--	No Emissions Found
2070.00	--	V	53.98	--	Avg	--	--	No Emissions Found
2415.00	--	V	73.98	--	Peak	--	--	No Emissions Found
2415.00	--	V	53.98	--	Avg	--	--	No Emissions Found
2760.00	--	V	73.98	--	Peak	--	--	No Emissions Found
2760.00	--	V	53.98	--	Avg	--	--	No Emissions Found
3105.00	--	V	73.98	--	Peak	--	--	No Emissions Found
3105.00	--	V	53.98	--	Avg	--	--	No Emissions Found
3450.00	--	V	73.98	--	Peak	--	--	No Emissions Found
3450.00	--	V	53.98	--	Avg	--	--	No Emissions Found

Test distance
 3 meter



Brea Division
 114 Olinda Drive
 Brea, CA 92823
 (714) 579-0500

Agoura Division
 2337 Troutdale Drive
 Agoura, CA 91301
 (818) 597-0600

Silverado Division
 19121 El Toro Road
 Silverado, CA 92676
 (949) 589-0700

Lake Forest Division
 20621 Pascal Way
 Lake Forest, CA 92630
 (949) 587-0400



DUTY CYCLE PLOTS




Brea Division
114 Olinda Drive
Brea, CA 92823
(714) 579-0500

Agoura Division
2337 Troutdale Drive
Agoura, CA 91301
(818) 597-0600

Silverado Division
19121 El Toro Road
Silverado, CA 92676
(949) 589-0700

Lake Forest Division
20621 Pascal Way
Lake Forest, CA 92630
(949) 587-0400

DUTY CYCLE

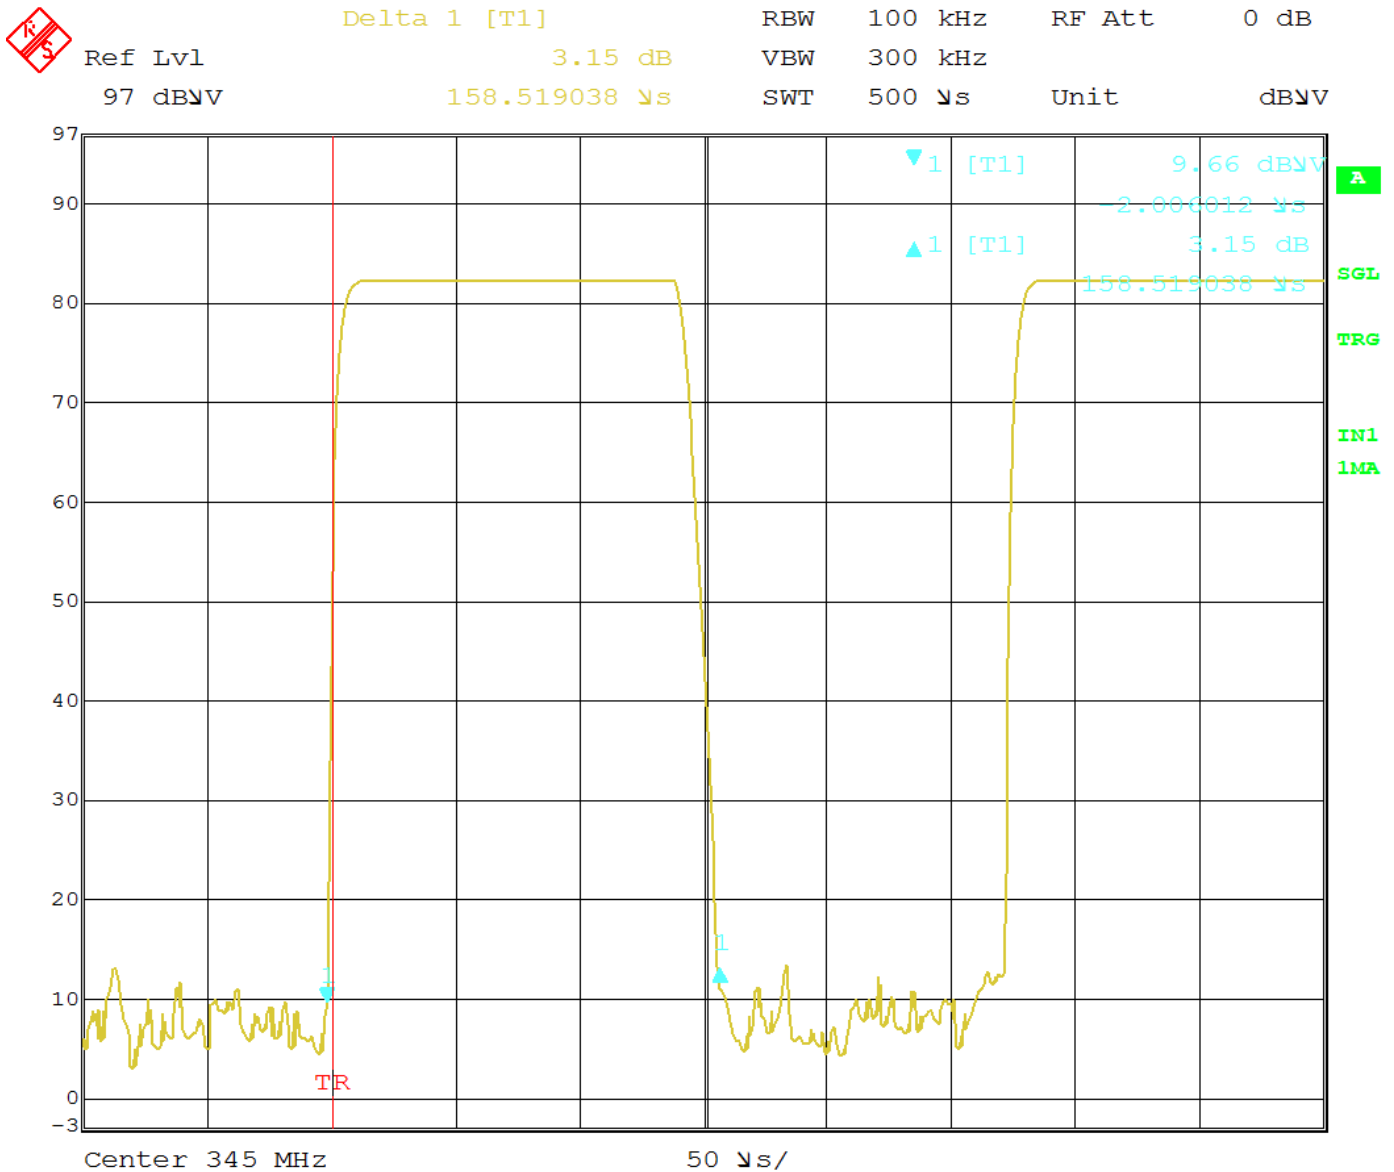

Title: 2GIG-SHKDW1-345

Comment A: Shock Alarm

Time of Pulse Type 1 = 158.519038 μ S



Brea Division
114 Olinda Drive
Brea, CA 92823
(714) 579-0500

Agoura Division
2337 Troutdale Drive
Agoura, CA 91301
(818) 597-0600

Silverado Division
19121 El Toro Road
Silverado, CA 92676
(949) 589-0700

Lake Forest Division
20621 Pascal Way
Lake Forest, CA 92630
(949) 587-0400

DUTY CYCLE

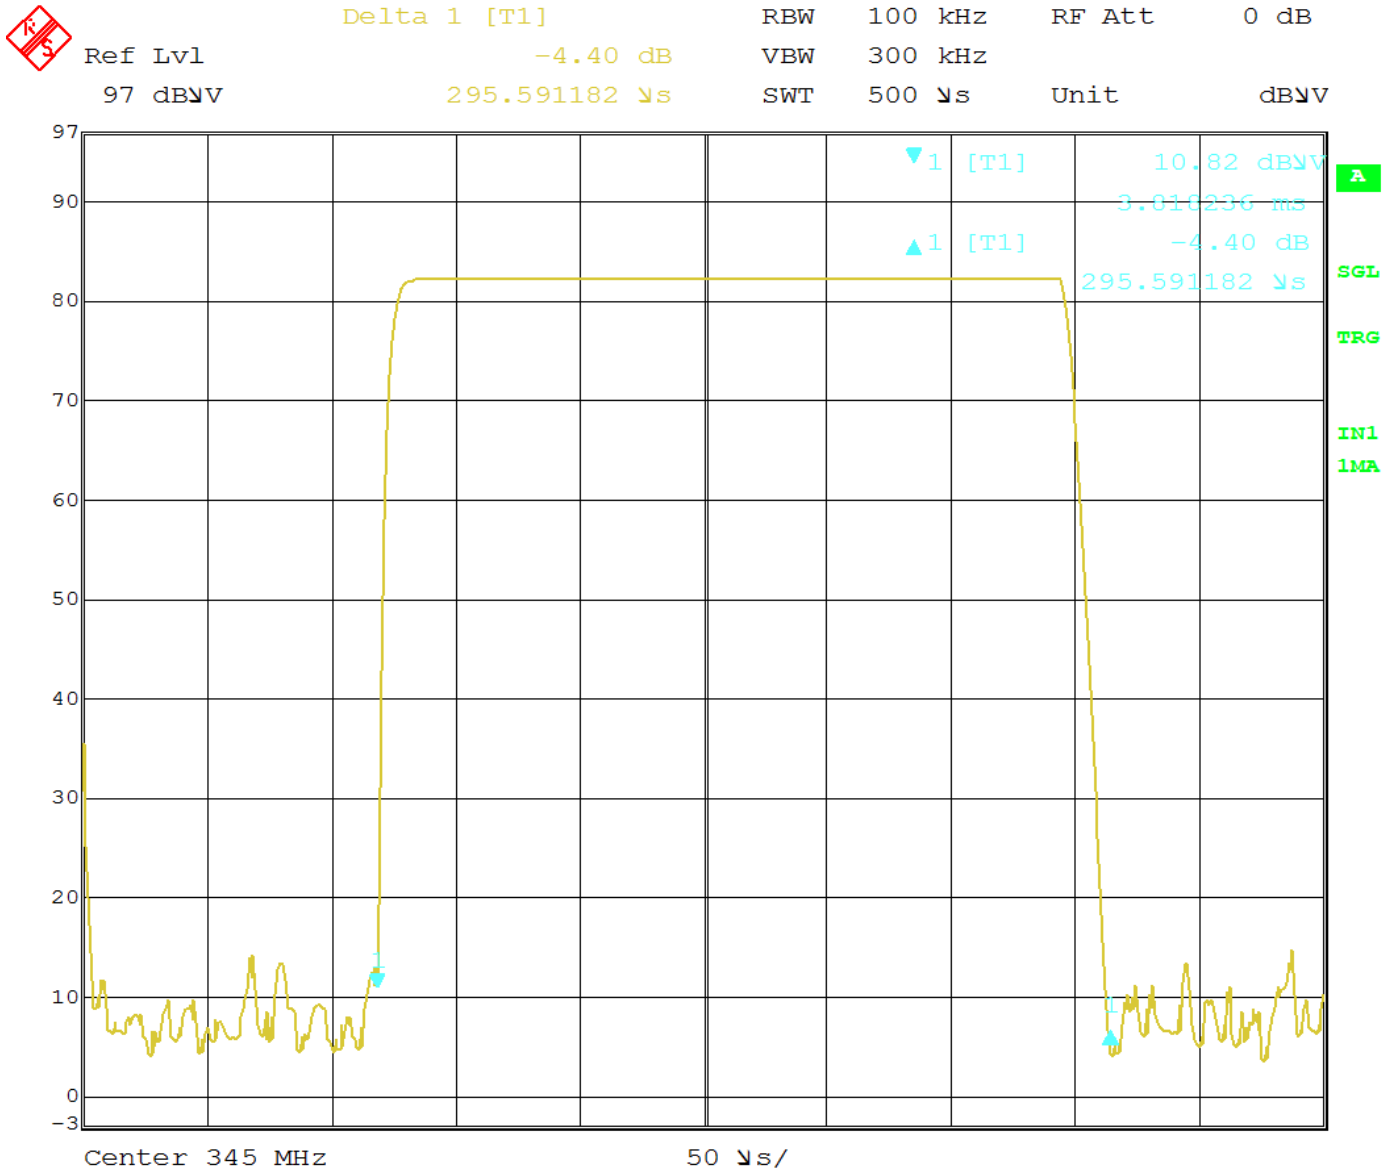

Title: 2GIG-SHKDW1-345

Comment A: Shock Alarm

Time of Pulse Type 2 = 295.591182 μ S


Brea Division
114 Olinda Drive
Brea, CA 92823
(714) 579-0500

Agoura Division
2337 Troutdale Drive
Agoura, CA 91301
(818) 597-0600


Silverado Division
19121 El Toro Road
Silverado, CA 92676
(949) 589-0700

Lake Forest Division
20621 Pascal Way
Lake Forest, CA 92630
(949) 587-0400

DUTY CYCLE



Marker 1 [T1] RBW 100 kHz RF Att 0 dB
 Ref Lvl 14.22 dBV VBW 300 kHz
 97 dBV 196.793587 ms SWT 200 ms Unit dBV

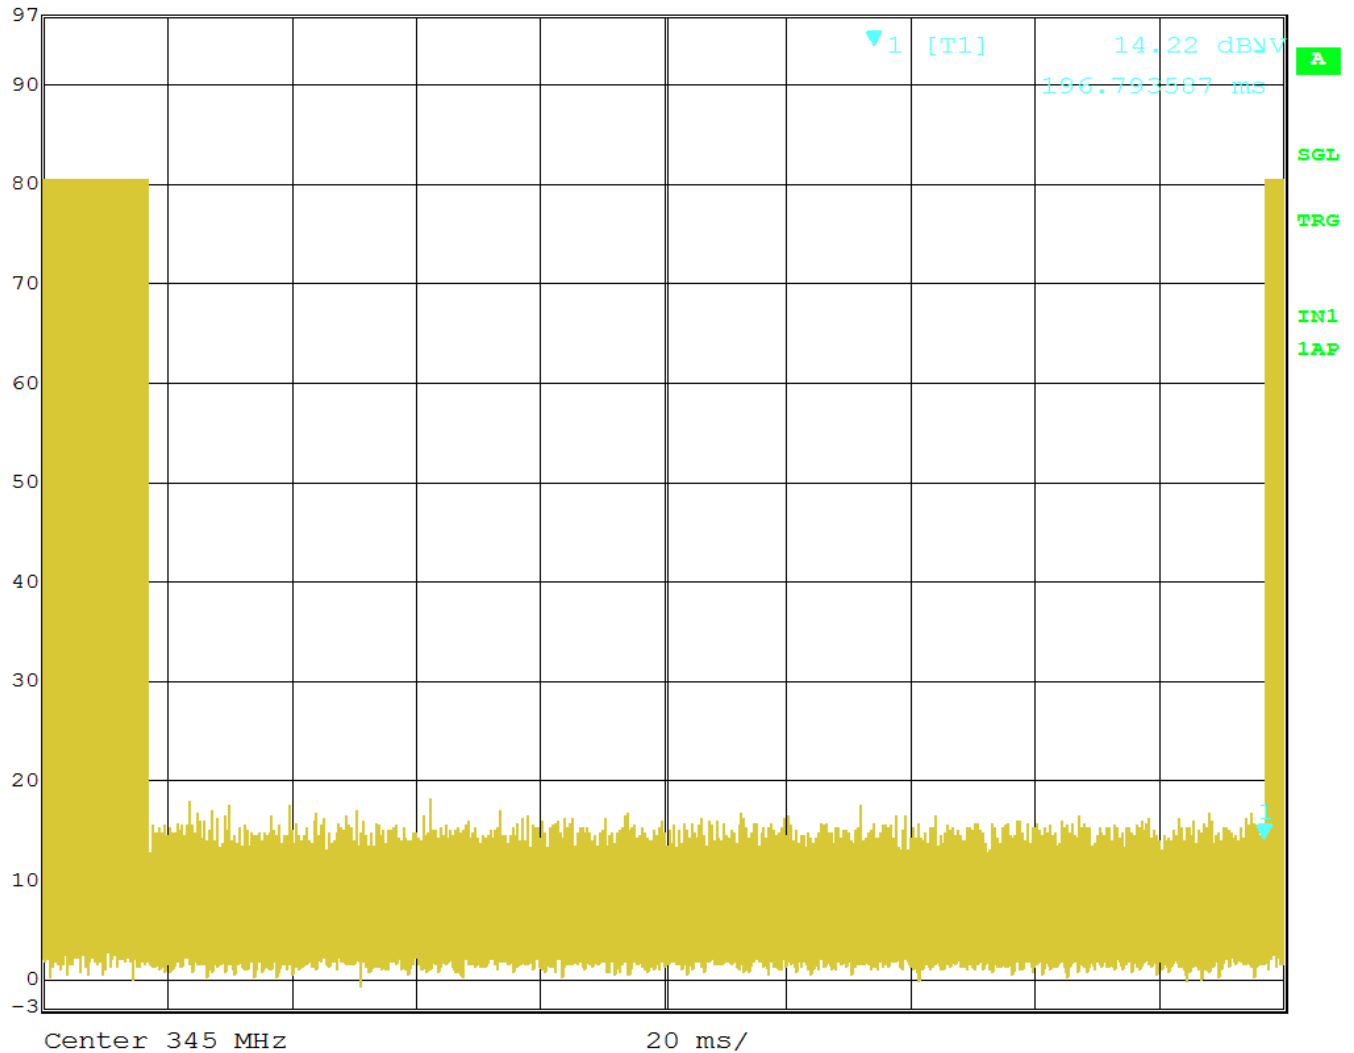

Title: 2GIG-SHKDW1-345

Comment A: Shock Alarm

Total On Time in a 100 ms Span = 10.016537 mS




Brea Division
 114 Olinda Drive
 Brea, CA 92823
 (714) 579-0500

Agoura Division
 2337 Troutdale Drive
 Agoura, CA 91301
 (818) 597-0600

Silverado Division
 19121 El Toro Road
 Silverado, CA 92676
 (949) 589-0700

Lake Forest Division
 20621 Pascal Way
 Lake Forest, CA 92630
 (949) 587-0400

Duty Cycle

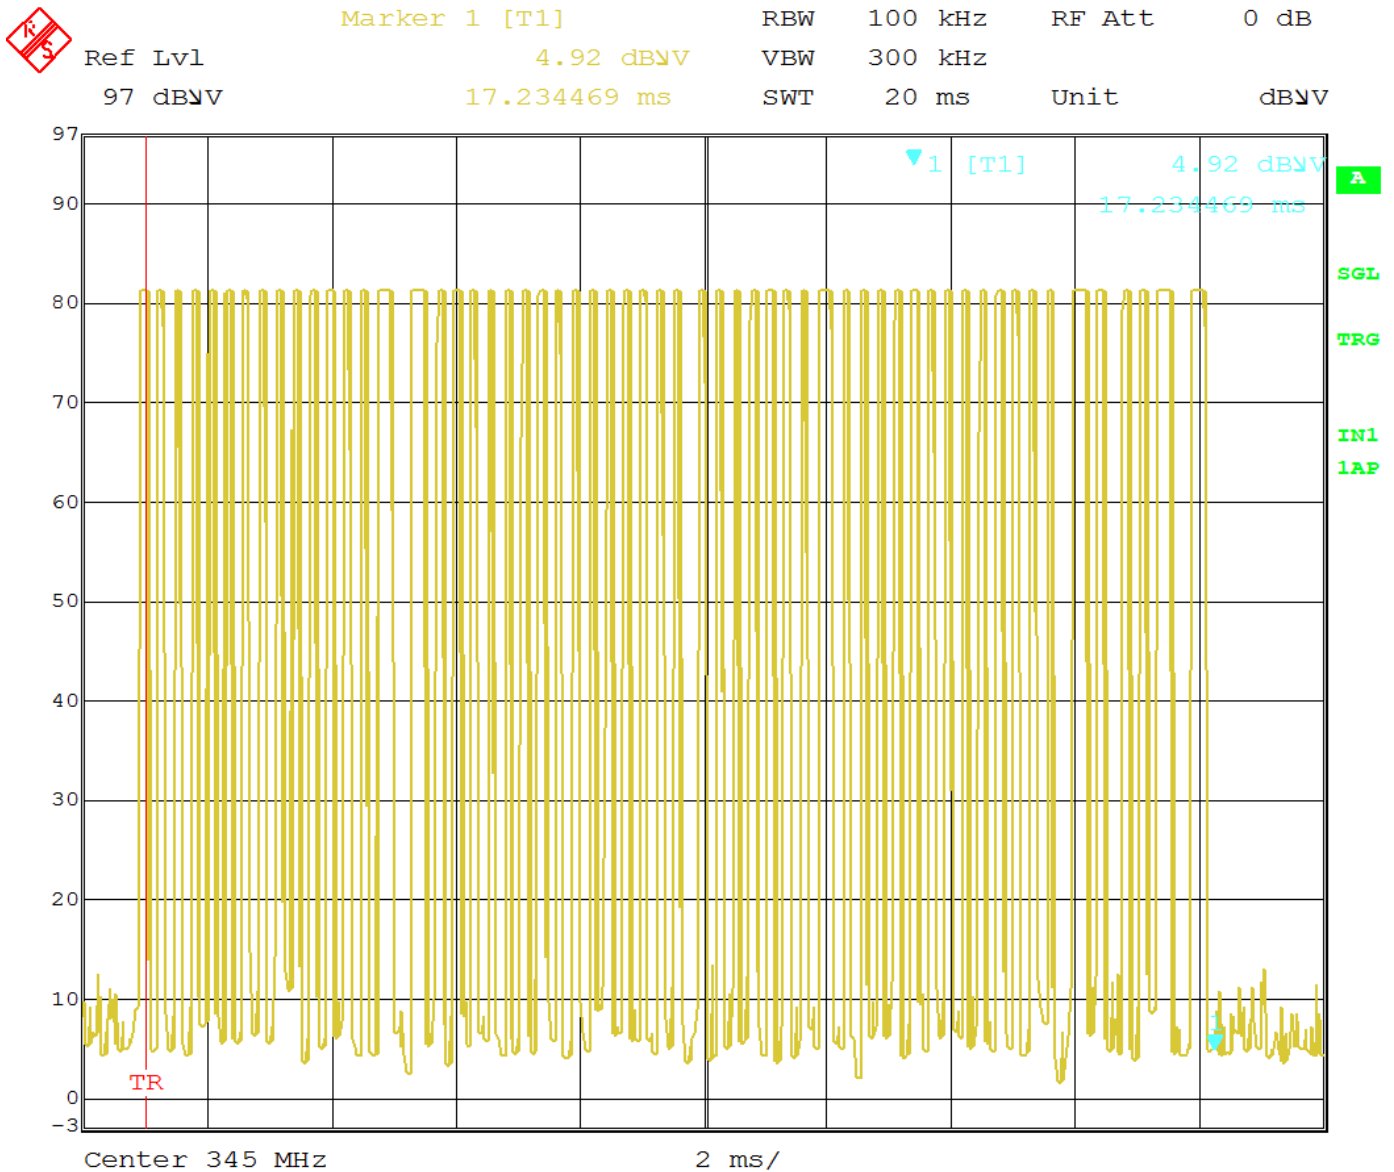

Title: 2GIG-SHKDW1-345

Comment A: Shock Alarm

Number of Pulses in Worst Case 100 ms = 58

Pulse Type 1 On Time = 158.519038 μ S *52 = 8242.989976 μ S

Pulse Type 2 On Time = 295.591182 μ S *6 = 1773.547092 μ S

8242.989976 μ S + 1773.547092 μ S = 10.01653707 ms

Duty Cycle = 10.01653707 ms / 100 ms = 0.1002

The Peak to Average Duty Cycle Correction = -19.98 dB



***TRANSMIT TIMEOUT
DATA***



TRANSMIT TIMEOUT


FCC 15.231

Company: Nortek
EUT: Shock and Door Window Detector
Model: 2GIG-SHKDW1-345

Date: 11/2/2018
Lab: P
Tested By: Matt H.

Freq. (MHz)	Time (S)	Limit (S)	Margin	Comments
345.00	2.84	5.00	-2.16	Polling Transmission

The Polling Transmissions was the worst-case transmit timeout

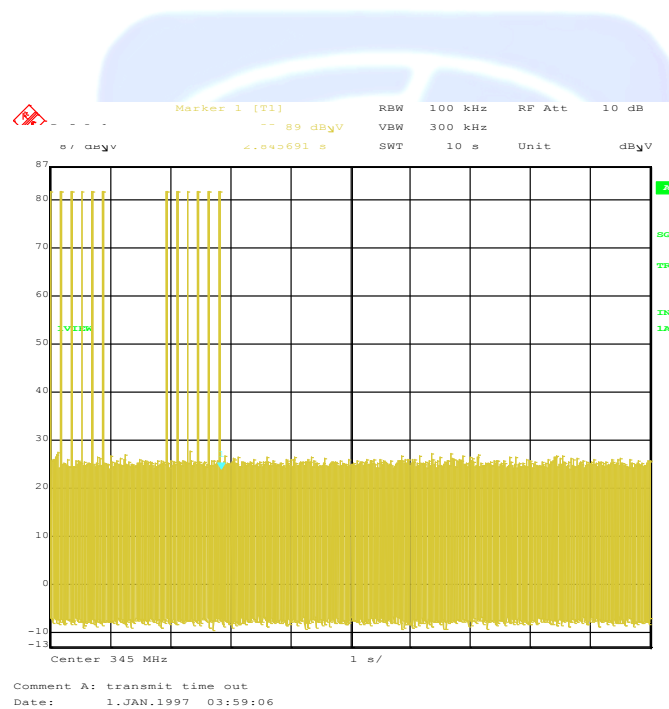

Brea Division
114 Olinda Drive
Brea, CA 92823
(714) 579-0500

Agoura Division
2337 Troutdale Drive
Agoura, CA 91301
(818) 597-0600

Silverado Division
19121 El Toro Road
Silverado, CA 92676
(949) 589-0700

Lake Forest Division
20621 Pascal Way
Lake Forest, CA 92630
(949) 587-0400

***-20 dB & Occupied Bandwidth
DATA***



Brea Division
114 Olinda Drive
Brea, CA 92823
(714) 579-0500

Agoura Division
2337 Troutdale Drive
Agoura, CA 91301
(818) 597-0600

Silverado Division
19121 El Toro Road
Silverado, CA 92676
(949) 589-0700

Lake Forest Division
20621 Pascal Way
Lake Forest, CA 92630
(949) 587-0400

-20dB & 99% BANDWIDTHS

FCC 15.231

Company: Nortek
EUT: Shock and Door Window Detector
Model: 2GIG-SHKDW1-345

Date: 7/26/2018
Lab: P
Tested By: Matt H.

Freq. (MHz)	Bandwidth (kHz)	Limit (kHz)	Margin	Comments
345.00	599.19	862.50	-263.31	-20dB
345.00	52.68	N/A	N/A	99%

