


Project Information			
Project No:	E202211048579	EUT:	E202211048579-0001
Channel	810	Band:	GSM1900
Mode:	GPRS	Voltage:	DC 3.7V
Environment:	Temp: 25.6℃; Humi:54%RH	Engineer:	Zhang Zishan
Date:	2022-11-25 16:45:50		

Test Graph

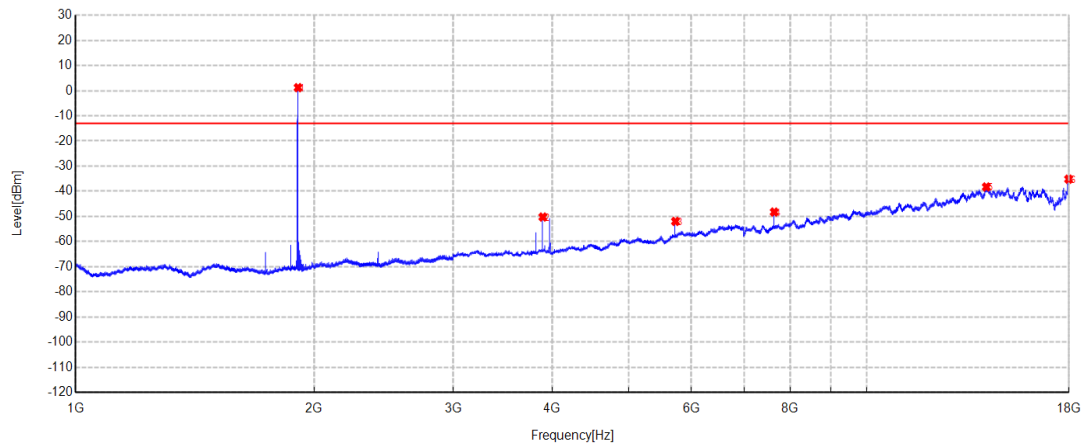

Suspected Data List


NO.	Freq. [MHz]	Reading [dBm]	Level [dBm]	Limit [dBm]	Margin [dB]	Factor [dB]	Detector	Polarity
1	1909.8	13.84	1.20	/	/	-12.64	RMS	Vertical
2	3894.75	-45.78	-50.25	-13.00	37.25	-4.47	RMS	Vertical
3	5729.25	-53.25	-51.99	-13.00	38.99	1.26	RMS	Vertical
4	7638.75	-54.43	-48.27	-13.00	35.27	6.16	RMS	Vertical
5	14164.5	-60.27	-38.29	-13.00	25.29	21.98	RMS	Vertical
6	17998.5	-57.81	-35.20	-13.00	22.20	22.61	RMS	Vertical

NOTE: NO.1 is the fundamental frequency signal.

----- The following blanks -----

Project Information			
Project No:	E202211048579	EUT:	E202211048579-0001
Channel	661	Band:	GSM1900
Mode:	GPRS	Voltage:	DC 3.7V
Environment:	Temp: 25.6°C; Humi:54%RH	Engineer:	Zhang Zishan
Date:	2022-11-18 14:47:35		

Test Graph

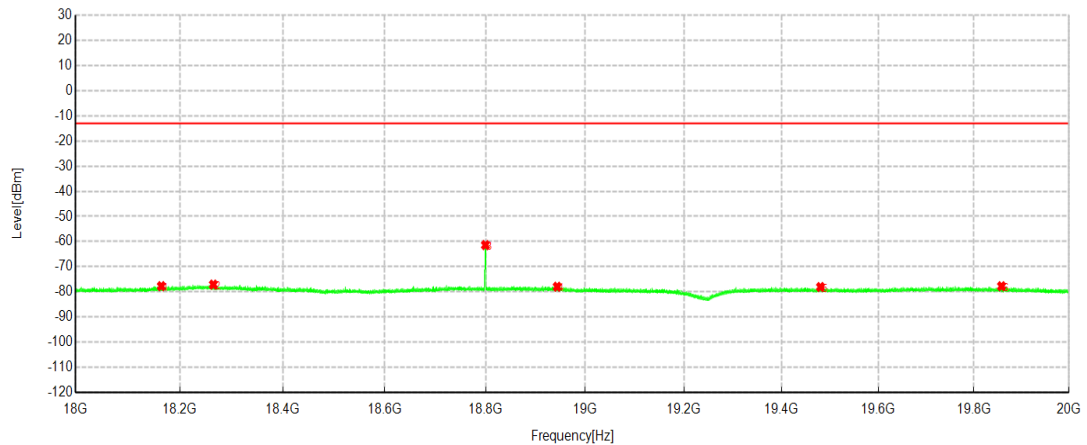


Suspected Data List

NO.	Freq. [MHz]	Reading [dBm]	Level [dBm]	Limit [dBm]	Margin [dB]	Factor [dB]	Detector	Polarity
1	18164.0866	-62.25	-77.74	-13.00	64.74	-15.49	RMS	Horizontal
2	18264.5706	-62.02	-77.12	-13.00	64.12	-15.10	RMS	Horizontal
3	18799.632	-45.68	-61.41	-13.00	48.41	-15.73	RMS	Horizontal
4	18943.3977	-61.62	-77.97	-13.00	64.97	-16.35	RMS	Horizontal
5	19480.1392	-61.94	-78.08	-13.00	65.08	-16.14	RMS	Horizontal
6	19857.9943	-62.32	-77.76	-13.00	64.76	-15.44	RMS	Horizontal

----- The following blanks -----

Project Information			
Project No:	E202211048579	EUT:	E202211048579-0001
Channel	661	Band:	GSM1900
Mode:	GPRS	Voltage:	DC 3.7V
Environment:	Temp: 25.6°C; Humi:54%RH	Engineer:	Zhang Zishan
Date:	2022-11-18 14:48:21		

Test Graph

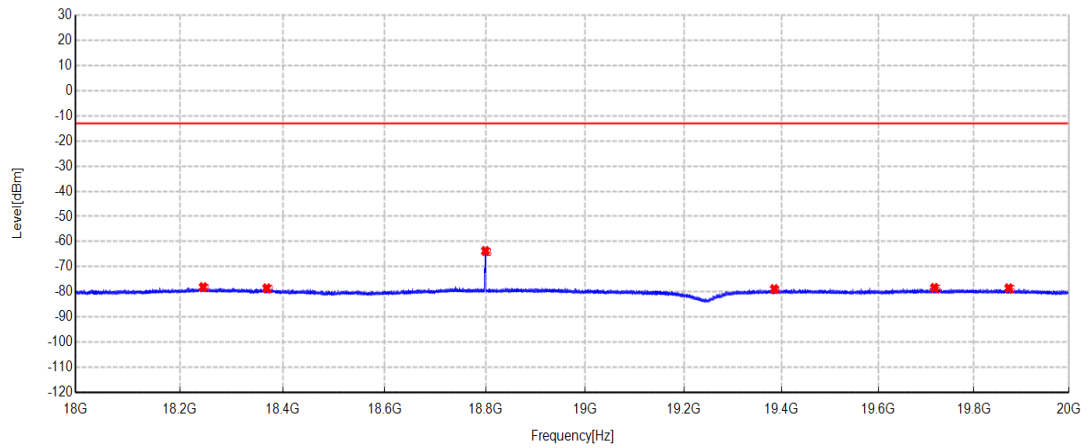


Suspected Data List

NO.	Freq. [MHz]	Reading [dBm]	Level [dBm]	Limit [dBm]	Margin [dB]	Factor [dB]	Detector	Polarity
1	18244.8898	-62.08	-78.12	-13.00	65.12	-16.04	RMS	Vertical
2	18368.3347	-61.88	-78.59	-13.00	65.59	-16.71	RMS	Vertical
3	18799.552	-47.35	-63.75	-13.00	50.75	-16.40	RMS	Vertical
4	19384.7754	-62.26	-78.88	-13.00	65.88	-16.62	RMS	Vertical
5	19717.1087	-62.34	-78.42	-13.00	65.42	-16.08	RMS	Vertical
6	19873.1949	-62.39	-78.56	-13.00	65.56	-16.17	RMS	Vertical

----- The following blanks -----

Project Information			
Project No:	E202211048579	EUT:	E202211048579-0001
Channel	512	Band:	GSM1900
Mode:	GPRS	Voltage:	DC 3.7V
Environment:	Temp: 25.6°C; Humi:54%RH	Engineer:	Zhang Zishan
Date:	2022-11-30 10:25:08		

Test Graph

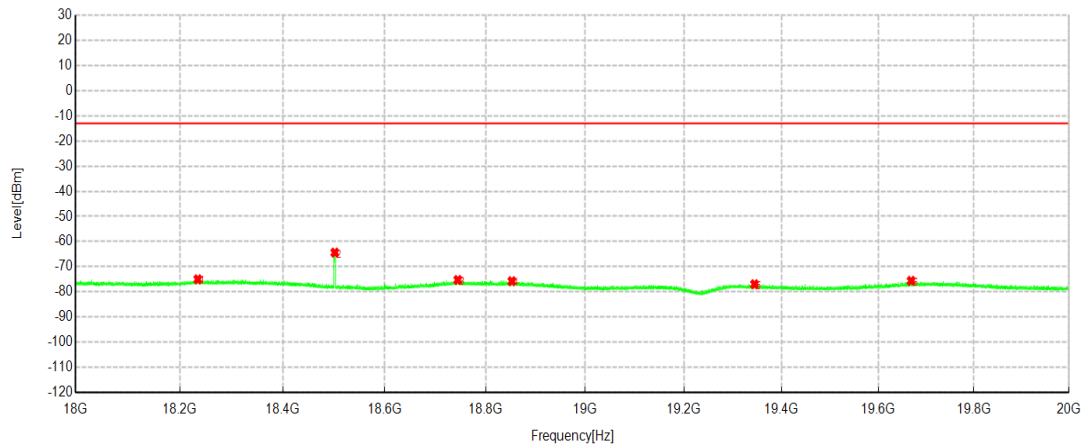


Suspected Data List

NO.	Freq. [MHz]	Reading [dBm]	Level [dBm]	Limit [dBm]	Margin [dB]	Factor [dB]	Detector	Polarity
1	18234.6494	-59.93	-75.02	-13.00	62.02	-15.09	RMS	Horizontal
2	18501.5401	-47.59	-64.40	-13.00	51.40	-16.81	RMS	Horizontal
3	18744.6698	-59.72	-75.27	-13.00	62.27	-15.55	RMS	Horizontal
4	18852.5141	-59.81	-75.77	-13.00	62.77	-15.96	RMS	Horizontal
5	19344.2938	-61.10	-76.97	-13.00	63.97	-15.87	RMS	Horizontal
6	19668.3867	-60.13	-75.62	-13.00	62.62	-15.49	RMS	Horizontal

----- The following blanks -----

Project Information			
Project No:	E202211048579	EUT:	E202211048579-0001
Channel	512	Band:	GSM1900
Mode:	GPRS	Voltage:	DC 3.7V
Environment:	Temp: 25.6°C; Humi:54%RH	Engineer:	Zhang Zishan
Date:	2022-11-30 10:25:54		

Test Graph

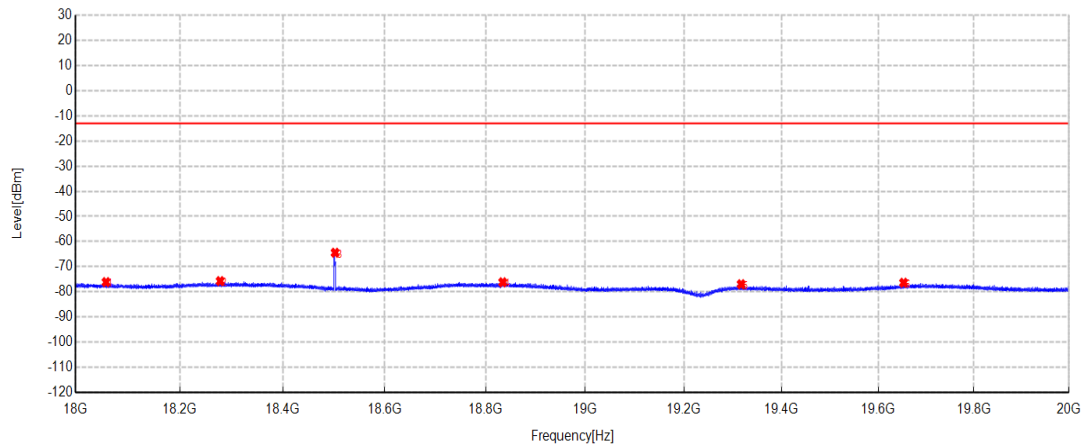


Suspected Data List

NO.	Freq. [MHz]	Reading [dBm]	Level [dBm]	Limit [dBm]	Margin [dB]	Factor [dB]	Detector	Polarity
1	18057.8423	-59.13	-76.14	-13.00	63.14	-17.01	RMS	Vertical
2	18277.8511	-59.55	-75.73	-13.00	62.73	-16.18	RMS	Vertical
3	18502.1801	-46.98	-64.44	-13.00	51.44	-17.46	RMS	Vertical
4	18834.1934	-59.68	-76.20	-13.00	63.20	-16.52	RMS	Vertical
5	19316.8527	-60.45	-76.98	-13.00	63.98	-16.53	RMS	Vertical
6	19652.7061	-60.10	-76.39	-13.00	63.39	-16.29	RMS	Vertical

----- The following blanks -----

Project Information			
Project No:	E202211048579	EUT:	E202211048579-0001
Channel	810	Band:	GSM1900
Mode:	GPRS	Voltage:	DC 3.7V
Environment:	Temp: 25.6°C; Humi:54%RH	Engineer:	Zhang Zishan
Date:	2022-11-30 10:27:56		

Test Graph

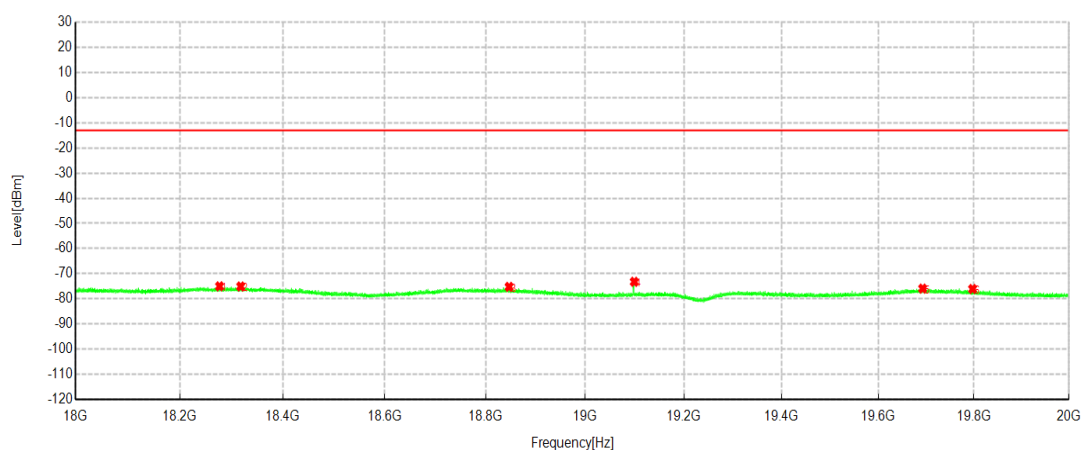


Suspected Data List

NO.	Freq. [MHz]	Reading [dBm]	Level [dBm]	Limit [dBm]	Margin [dB]	Factor [dB]	Detector	Polarity
1	18276.6511	-59.83	-75.02	-13.00	62.02	-15.19	RMS	Horizontal
2	18317.6927	-59.60	-75.09	-13.00	62.09	-15.49	RMS	Horizontal
3	18846.9939	-59.30	-75.24	-13.00	62.24	-15.94	RMS	Horizontal
4	19098.924	-56.99	-73.22	-13.00	60.22	-16.23	RMS	Horizontal
5	19692.4677	-60.53	-75.93	-13.00	62.93	-15.40	RMS	Horizontal
6	19797.1119	-60.80	-76.09	-13.00	63.09	-15.29	RMS	Horizontal

----- The following blanks -----

Project Information			
Project No:	E202211048579	EUT:	E202211048579-0001
Channel	810	Band:	GSM1900
Mode:	GPRS	Voltage:	DC 3.7V
Environment:	Temp: 25.6℃; Humi:54%RH	Engineer:	Zhang Zishan
Date:	2022-11-30 10:28:42		

Test Graph

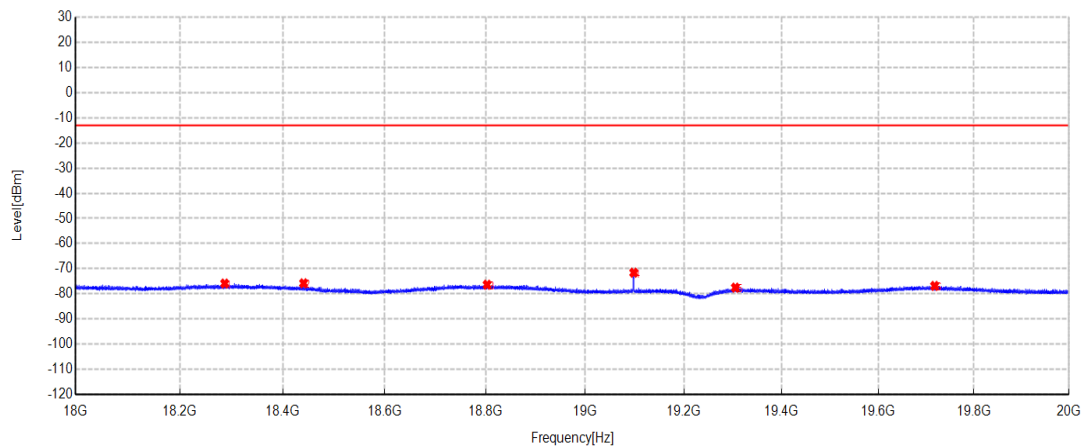

Suspected Data List

NO.	Freq. [MHz]	Reading [dBm]	Level [dBm]	Limit [dBm]	Margin [dB]	Factor [dB]	Detector	Polarity
1	18286.6515	-59.67	-75.90	-13.00	62.90	-16.23	RMS	Vertical
2	18440.3376	-58.68	-75.81	-13.00	62.81	-17.13	RMS	Vertical
3	18803.0721	-59.97	-76.38	-13.00	63.38	-16.41	RMS	Vertical
4	19097.9639	-54.74	-71.59	-13.00	58.59	-16.85	RMS	Vertical
5	19304.9322	-61.02	-77.54	-13.00	64.54	-16.52	RMS	Vertical
6	19717.5887	-60.77	-76.85	-13.00	63.85	-16.08	RMS	Vertical

Remark:

The disturbance below 30MHz was very low, and the above harmonics were the highest point could be found when testing, so only the worst case data had been displayed.

We have tested all modulation and all Bandwidth , but only the worst case data presented in this report.

----- The following blanks -----

APPENDIX A. PHOTOGRAPH OF THE TEST CONNECTION DIAGRAM

Please refer to the attached document E202211048579-4 Test Photo.

APPENDIX B. PHOTOGRAPHS OF EUT

Please refer to the attached document E202211048579-5 EUT Photo.

----- End of Report -----