



Address: No. 99, Sec. 1, Balian Rd., Xizhi Dist., New Taipei City
Tel: +886-2-2646-1508
Fax: +886-2-2646-1533

Radiated Emission Measurement

Operator: Sora

File : 3

Data : #1


Date: 2024/7/2

Temperature: 22 °C

-20.0 dBm

Time: 上午 10:11:58

Humidity: 55 %

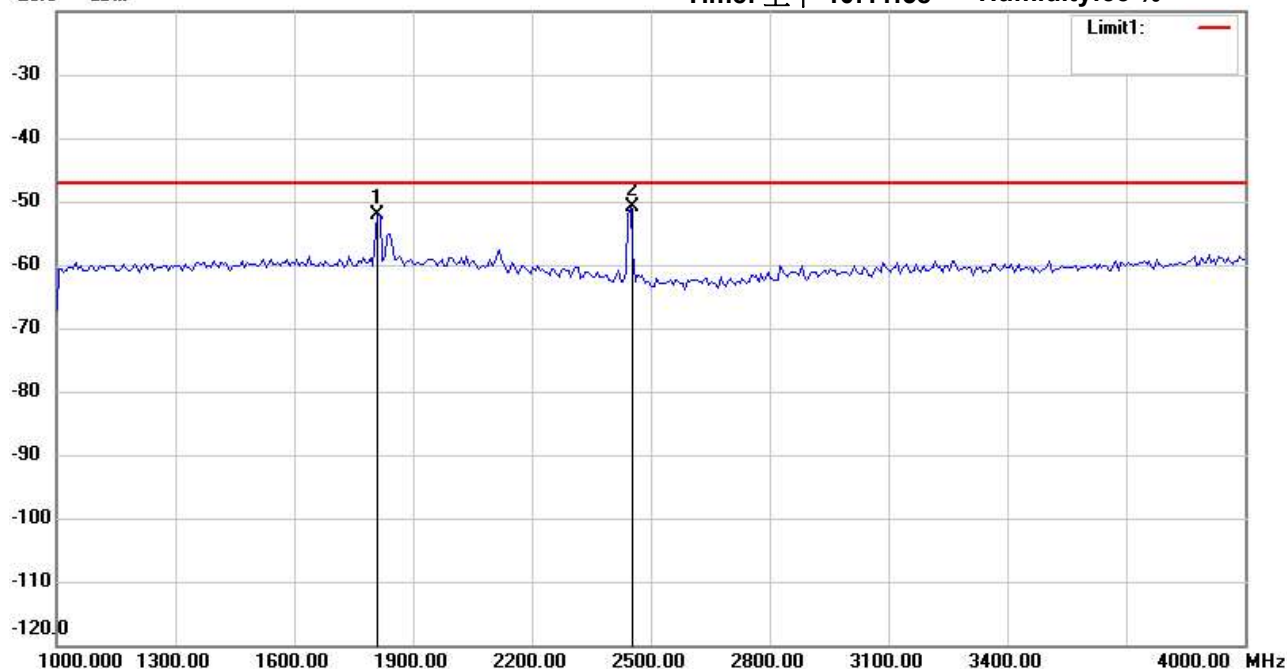

Site : 966A Chamber

Condition : ETSI EN300_422-RX_Spurious

EUT : W6M22405-23507

M/N:

Test Mode : Rx 607MHz

Note :

Polarization: **Horizontal**

Power : 120 V.a.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	1811.623	-55.74	peak	3.72	-52.02	-47.00	150	155	-5.02	
*	2448.898	-52.04	peak	1.25	-50.79	-47.00	150	105	-3.79	

*:Maximum data x:Over limit !:over margin



Address: No. 99, Sec. 1, Balian Rd., Xizhi Dist., New Taipei City
Tel: +886-2-2646-1508
Fax: +886-2-2646-1533

Radiated Emission Measurement

Operator: Sora

File : 3

Data : #2


Date: 2024/7/2

Temperature: 22 °C

-20.0 dBm

Time: 上午 10:13:57

Humidity: 55 %

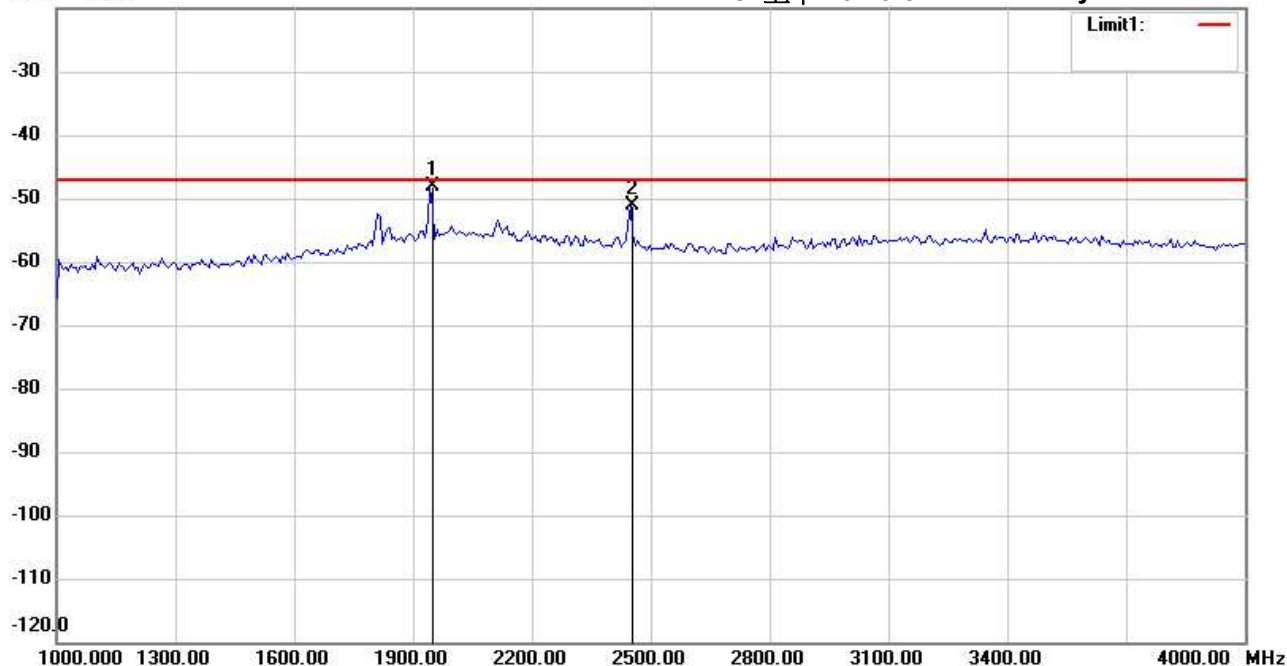

Site : 966A Chamber

Condition : ETSI EN300_422-RX_Spurious

EUT : W6M22405-23507

M/N:

Test Mode : Rx 607MHz

Note :

Polarization: Vertical

Power : 120 V.a.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBm)	Detector	Corr. factor (dB)	Result (dBm)	Limit (dBm)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
*	1943.888	-55.79	peak	7.75	-48.04	-47.00	150	245	-1.04	
	2448.898	-57.38	peak	6.38	-51.00	-47.00	150	305	-4.00	

*:Maximum data x:Over limit !:over margin