






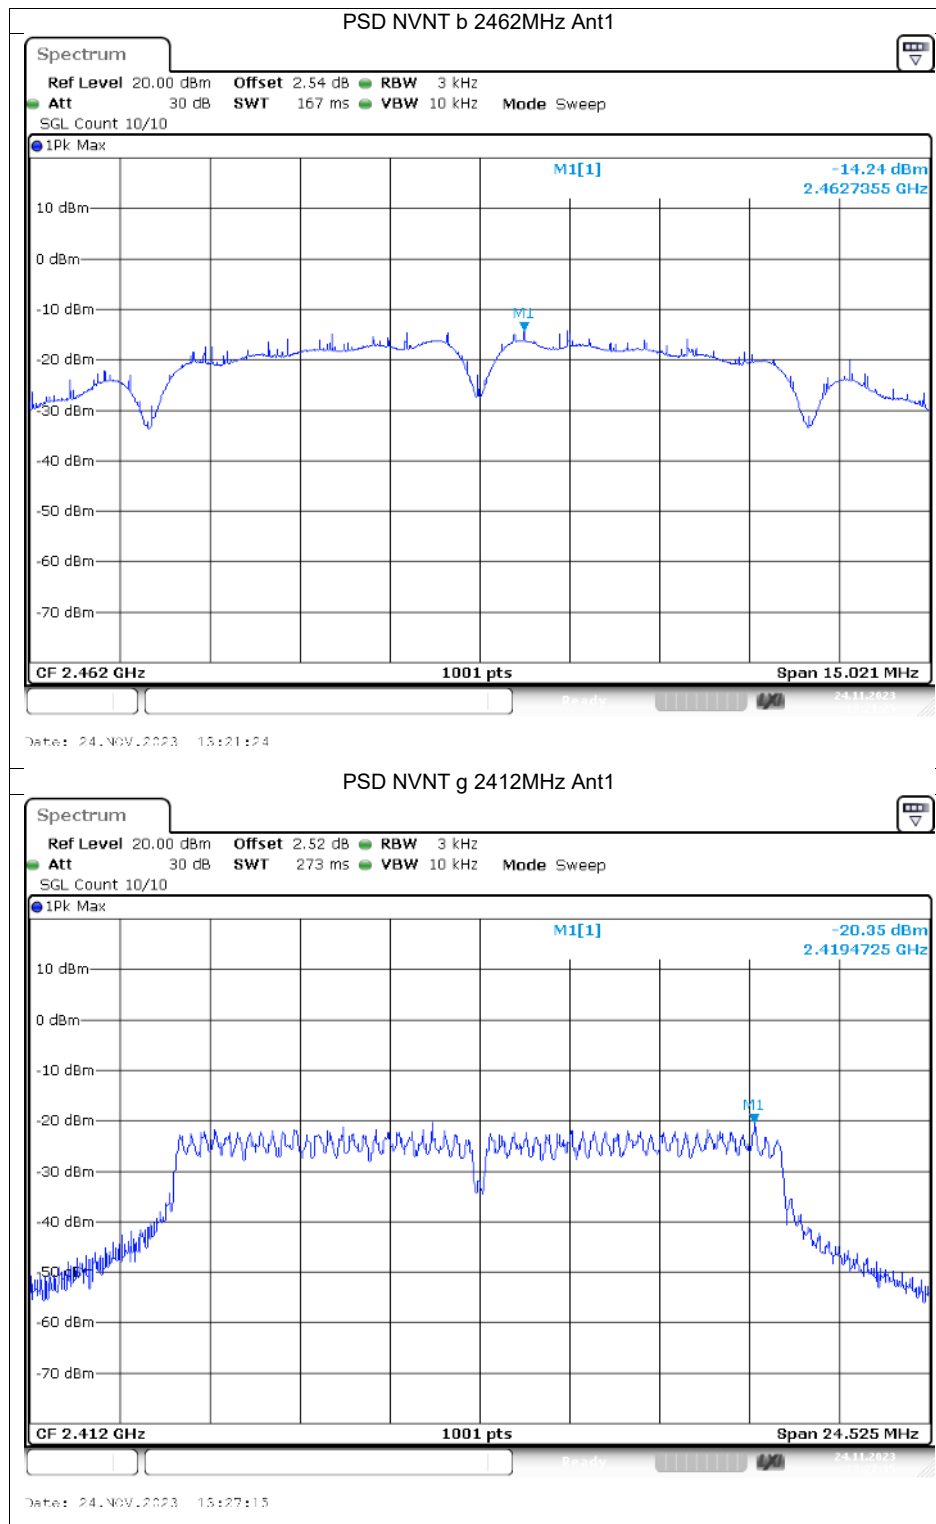

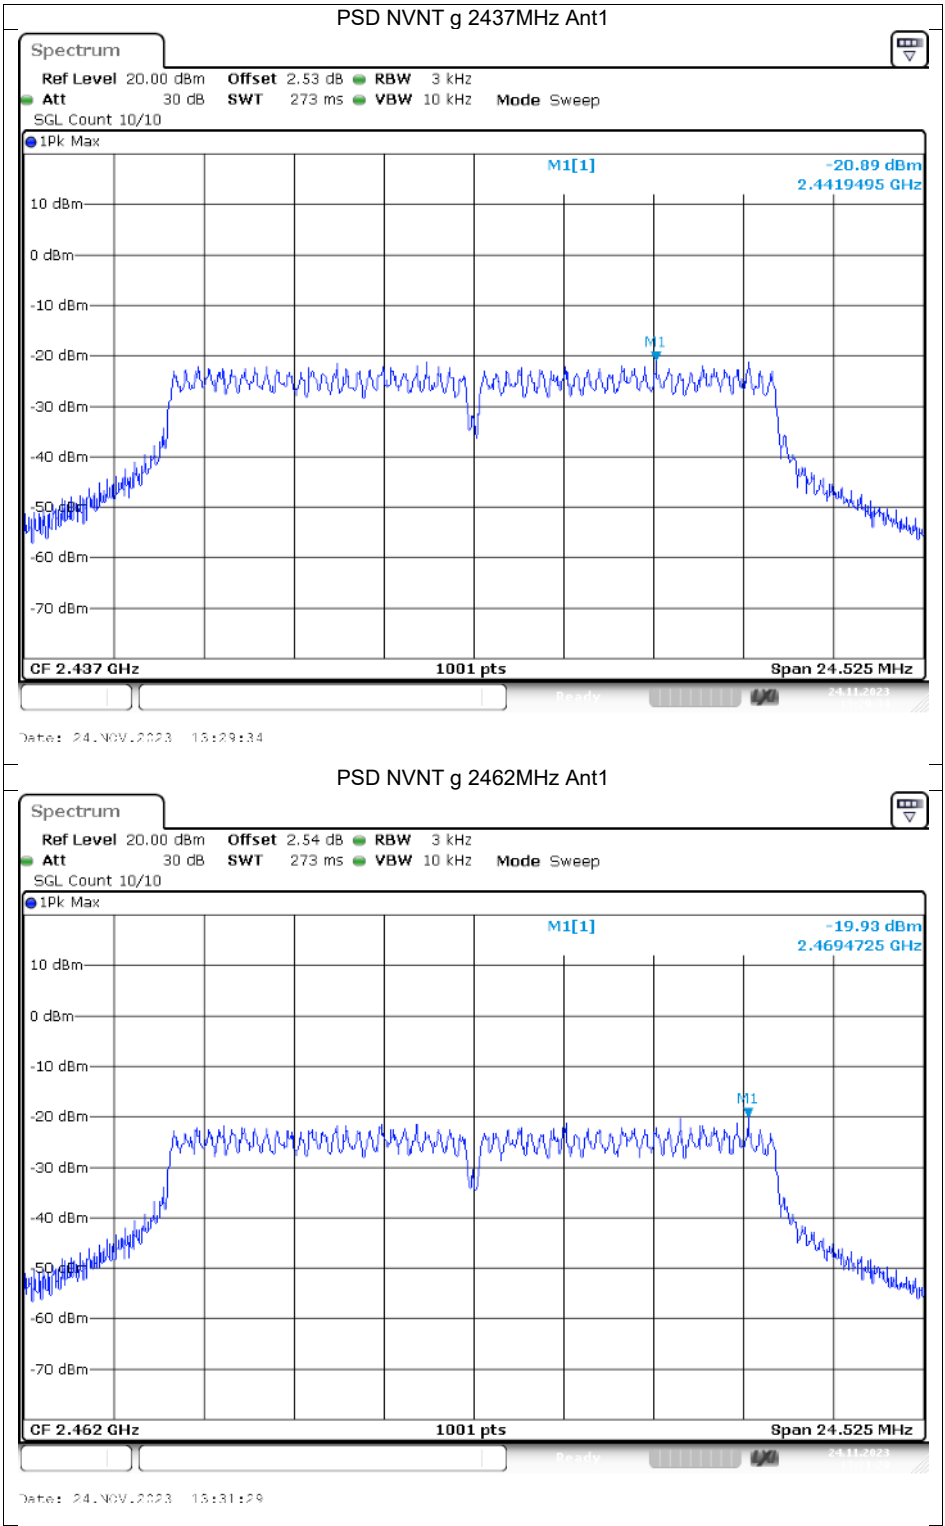

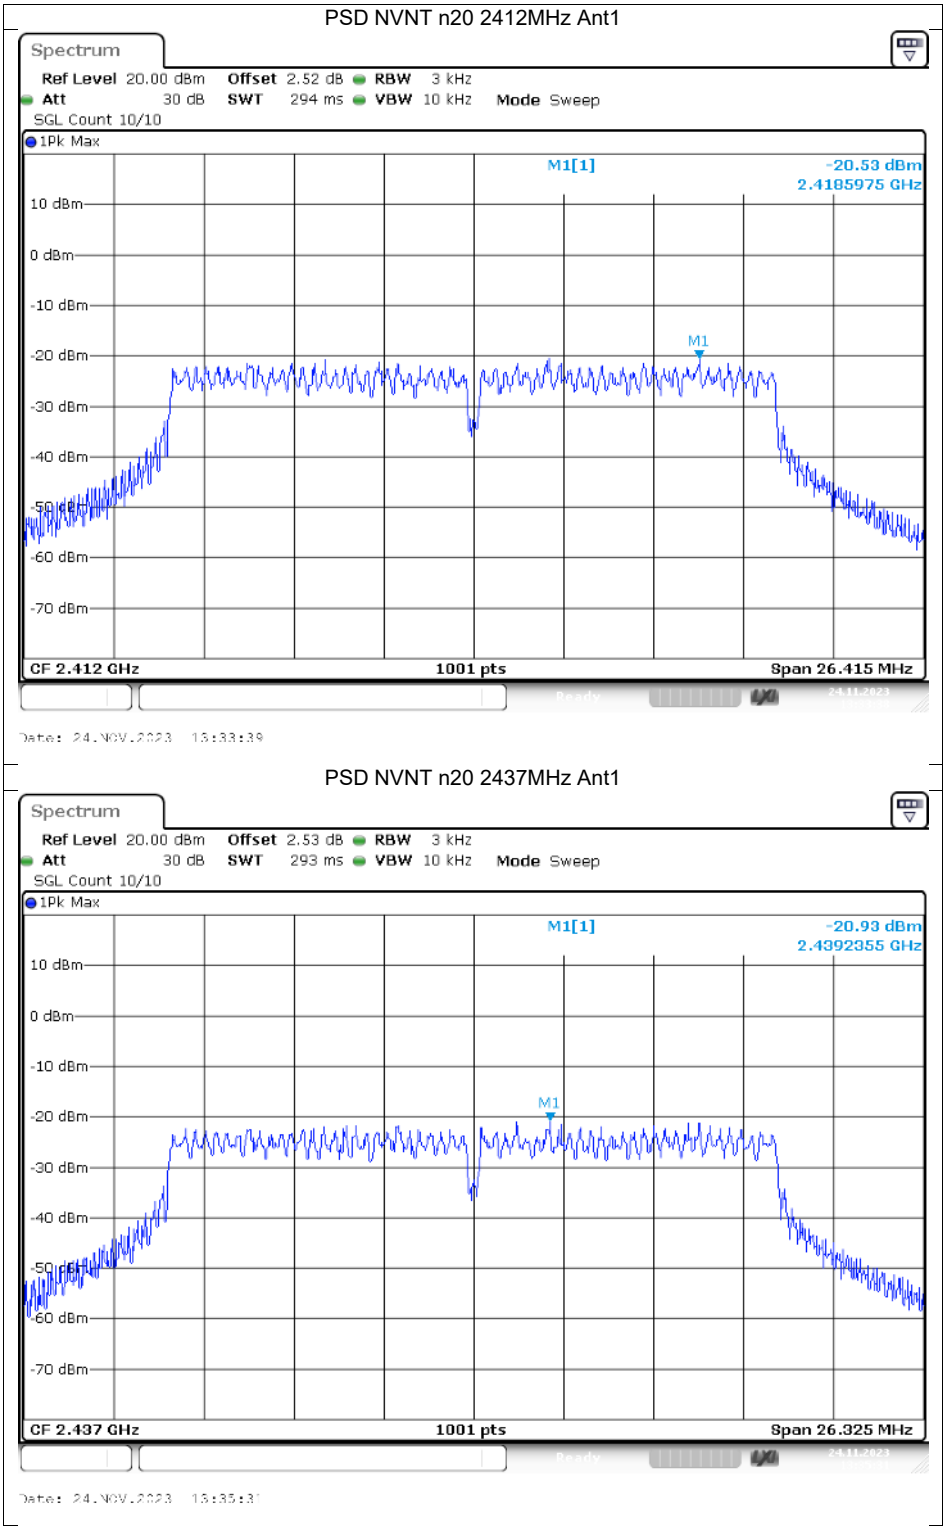


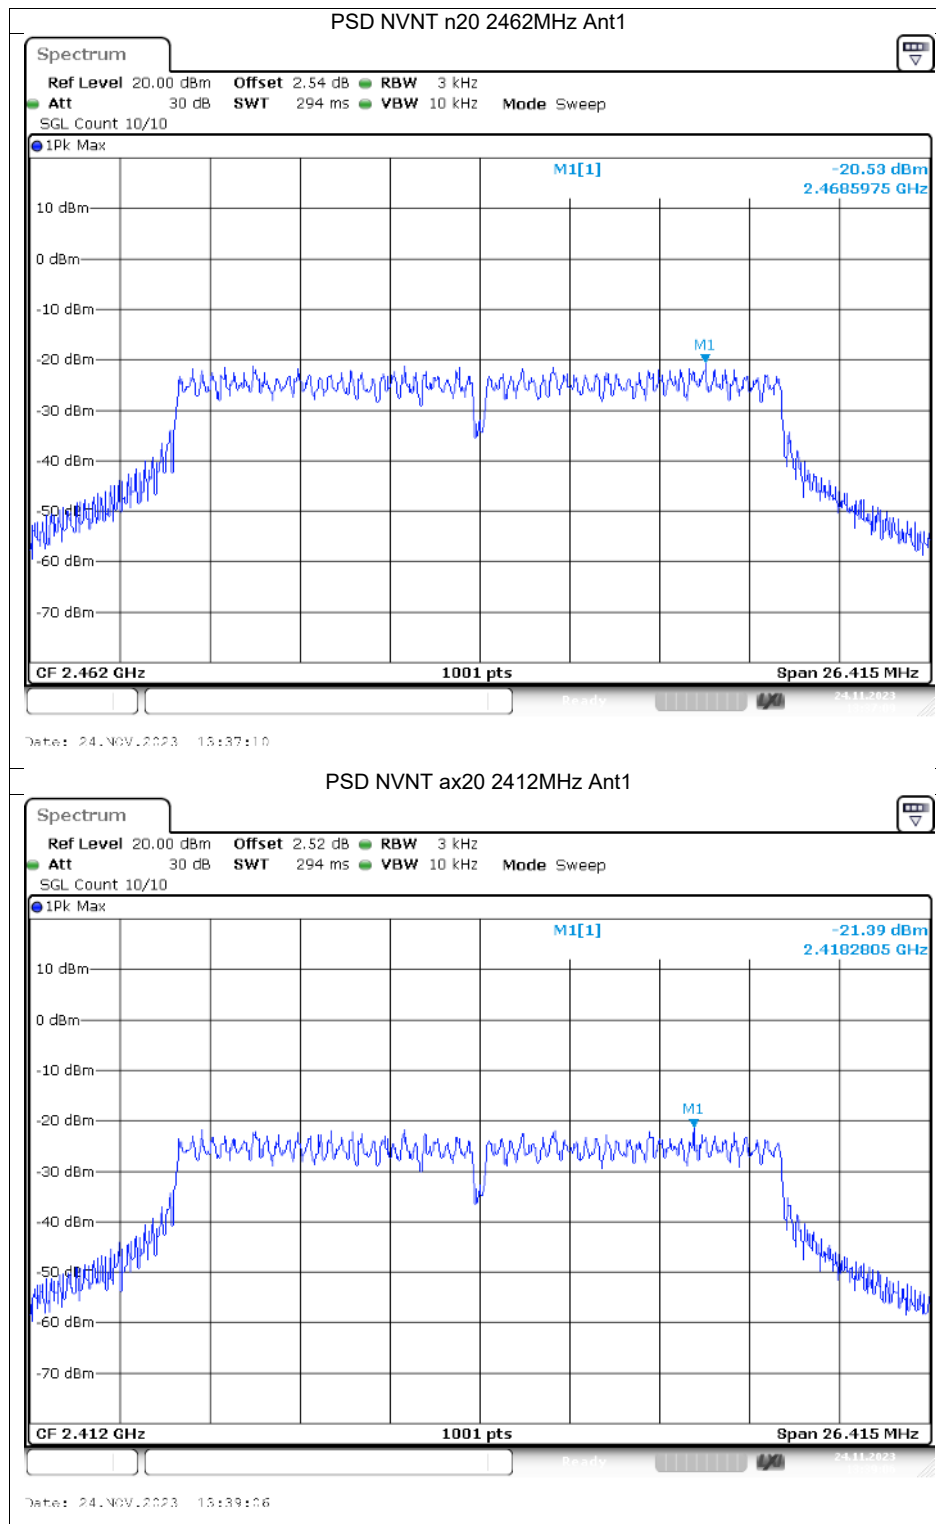


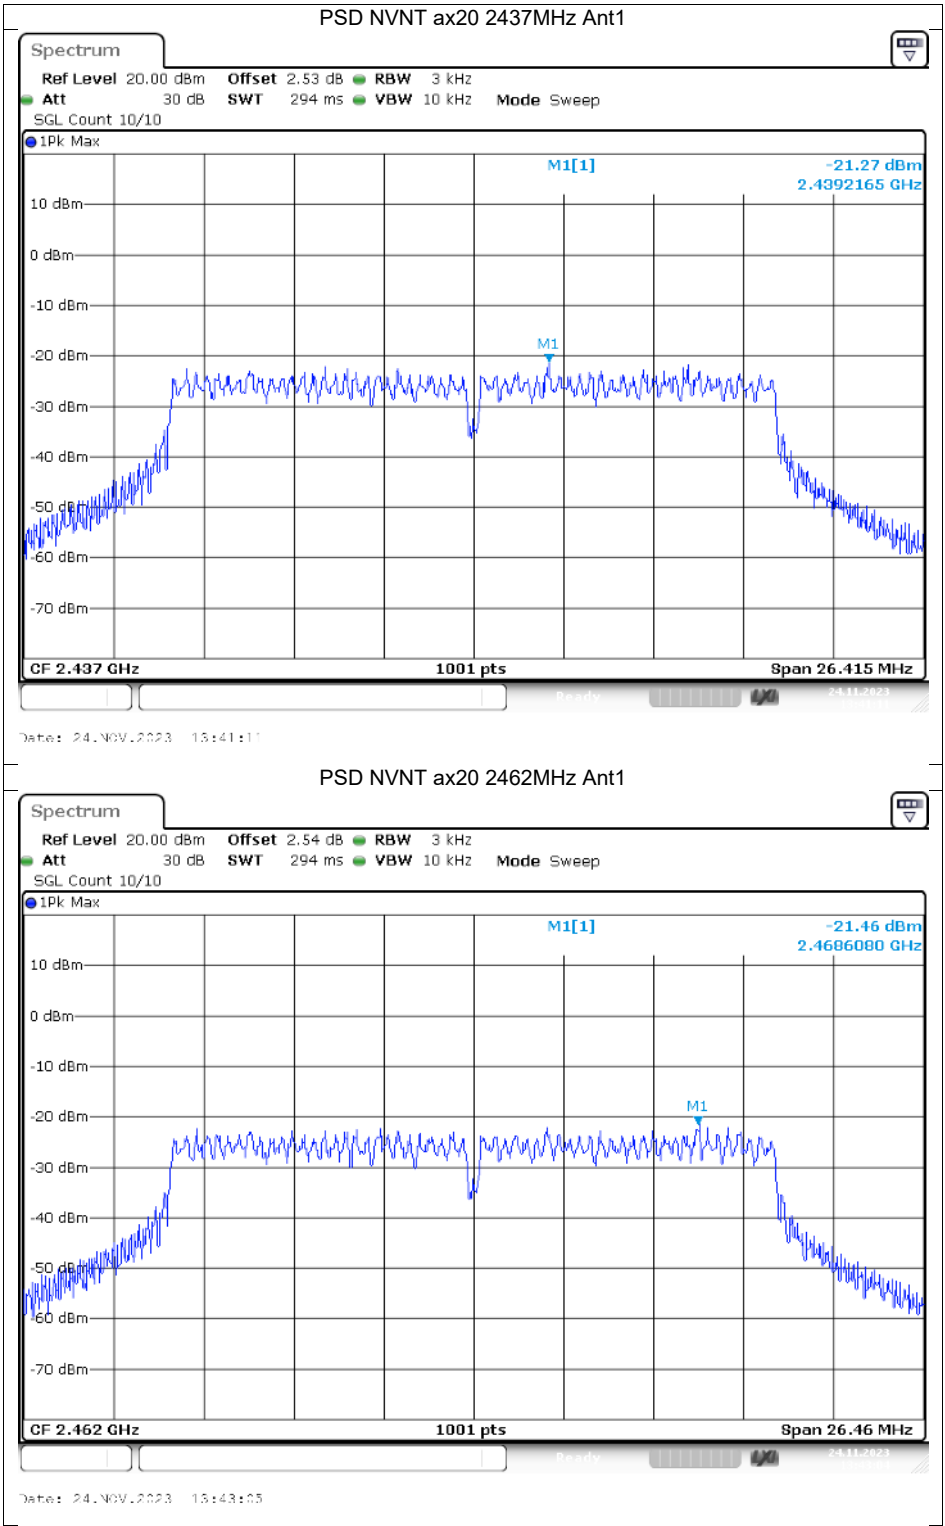



Band Edge


Condition	Mode	Frequency (MHz)	Antenna	Max Value (dBc)	Limit (dBc)	Verdict
NVNT	b	2412	Ant1	-44.92	-20	Pass
NVNT	b	2462	Ant1	-51.4	-20	Pass
NVNT	g	2412	Ant1	-31.63	-20	Pass
NVNT	g	2462	Ant1	-49.22	-20	Pass
NVNT	n20	2412	Ant1	-31.85	-20	Pass
NVNT	n20	2462	Ant1	-49.65	-20	Pass
NVNT	ax20	2412	Ant1	-30.86	-20	Pass
NVNT	ax20	2462	Ant1	-48.27	-20	Pass

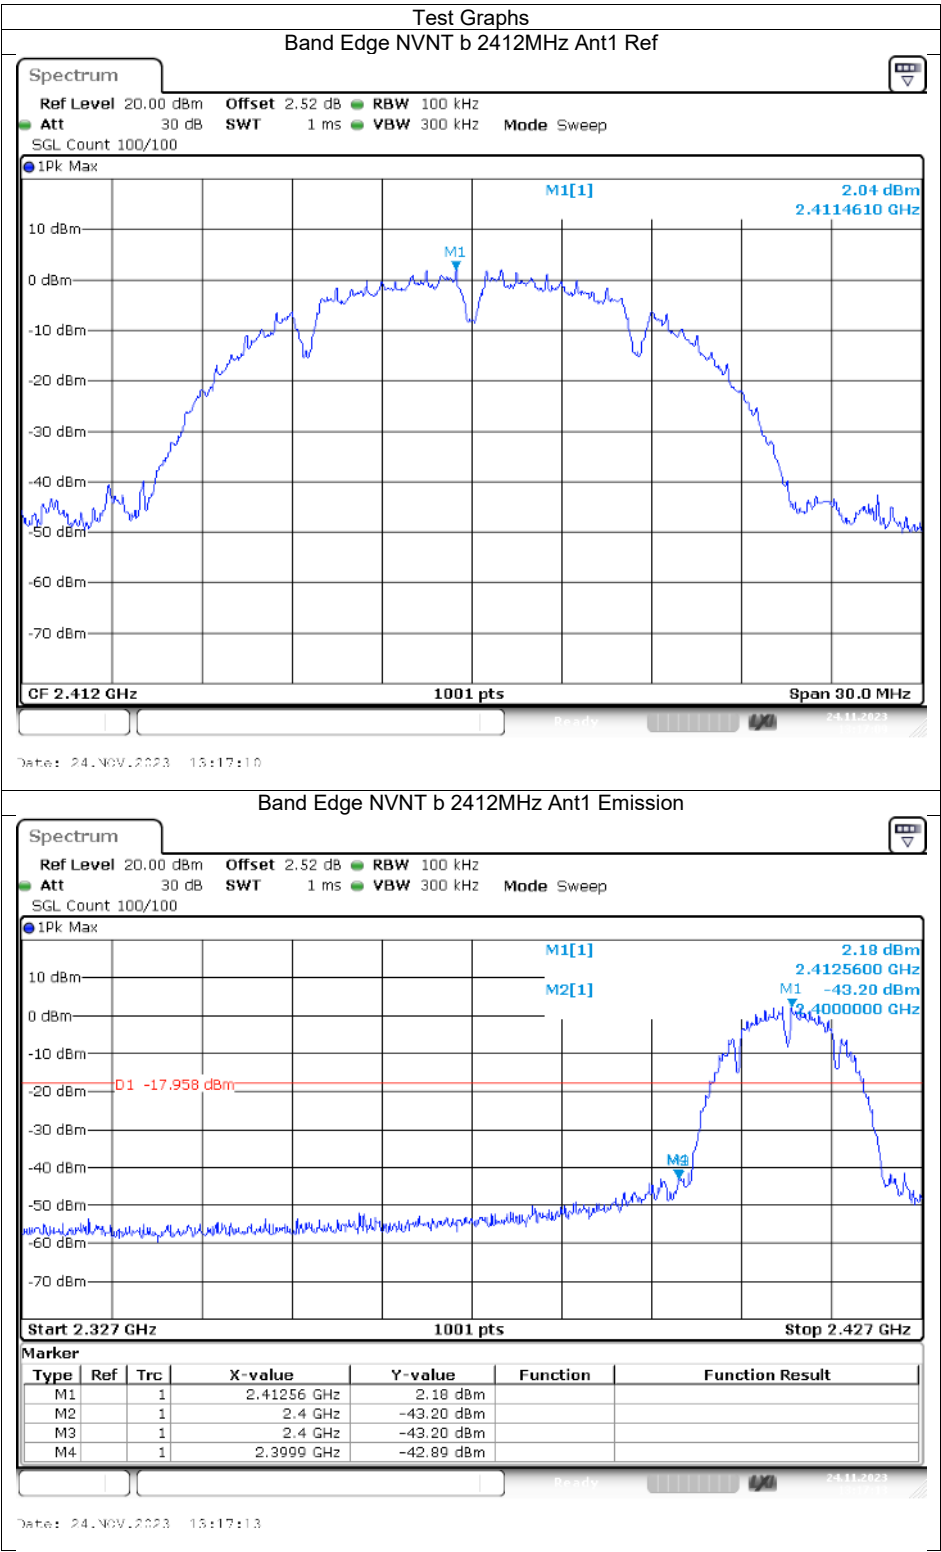


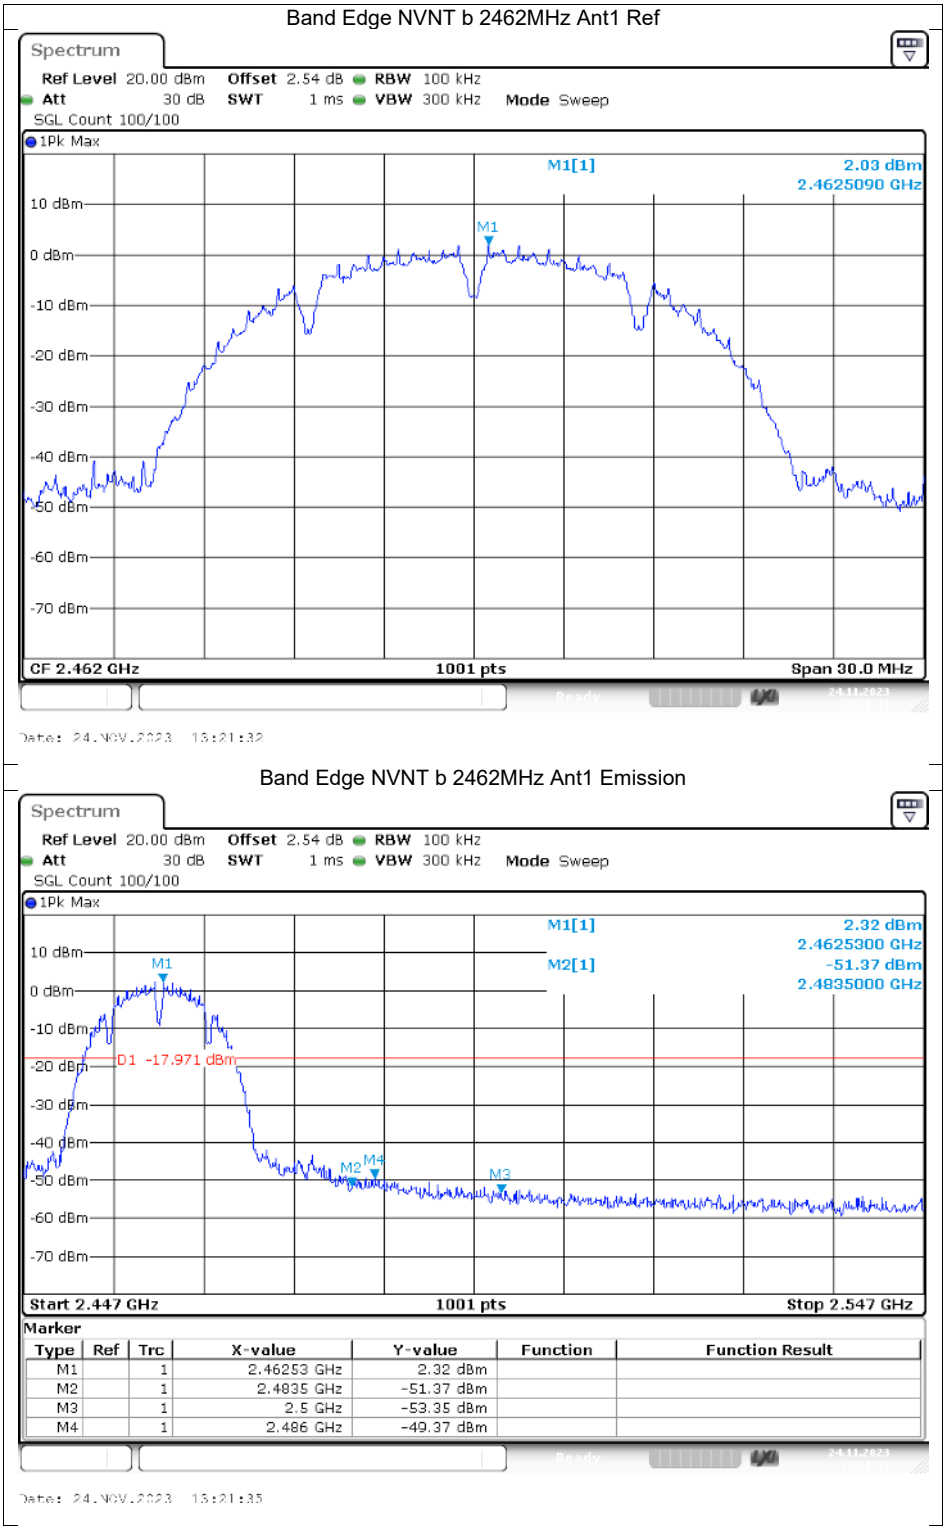


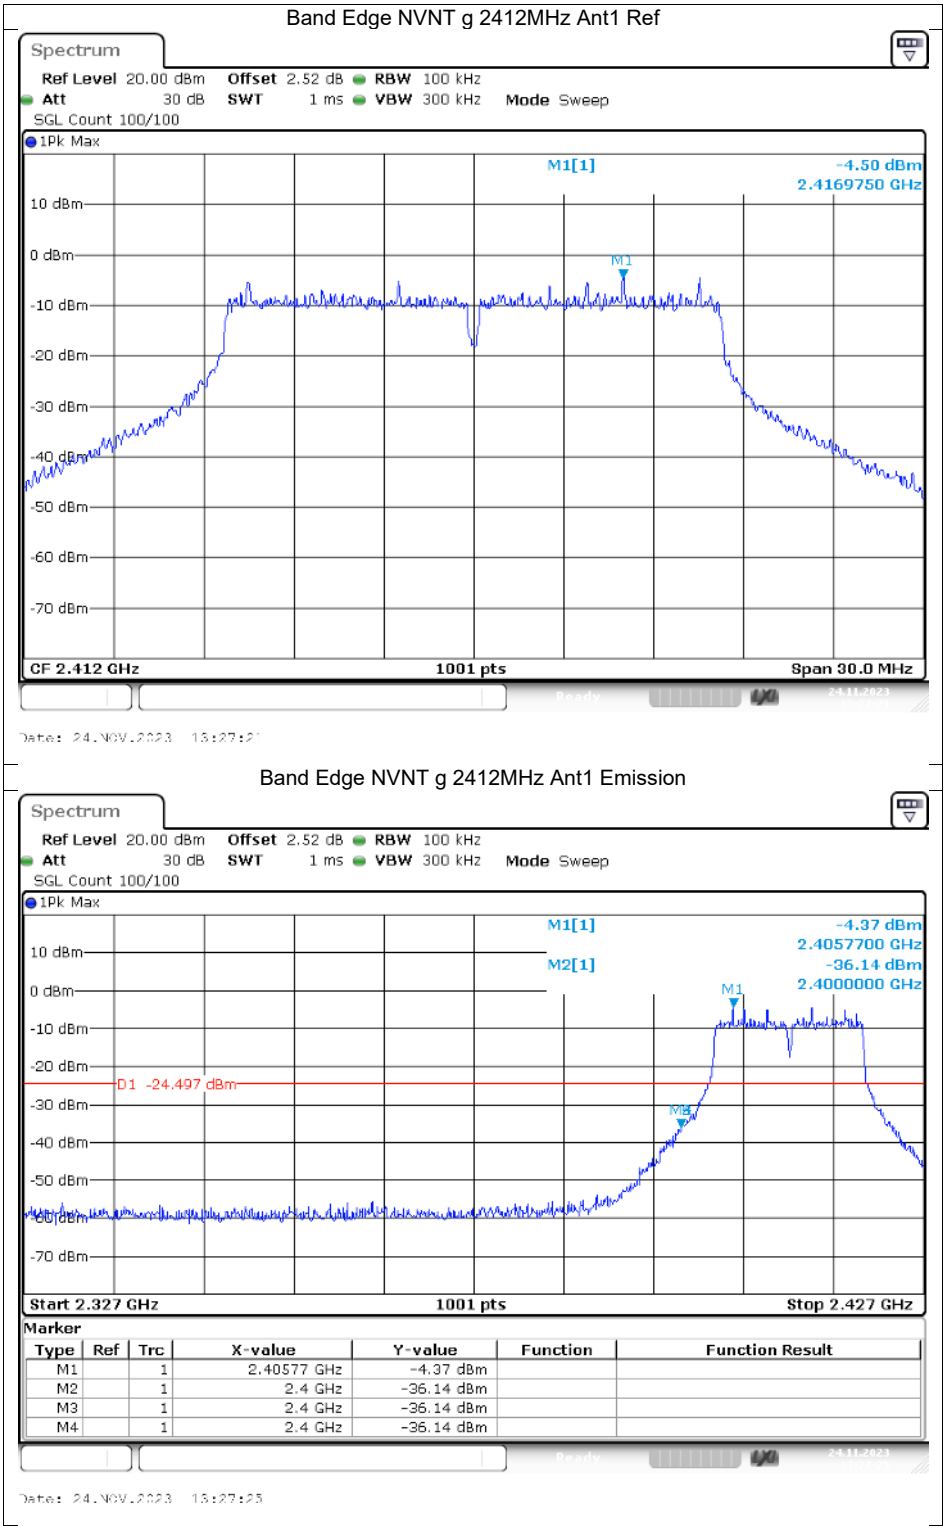


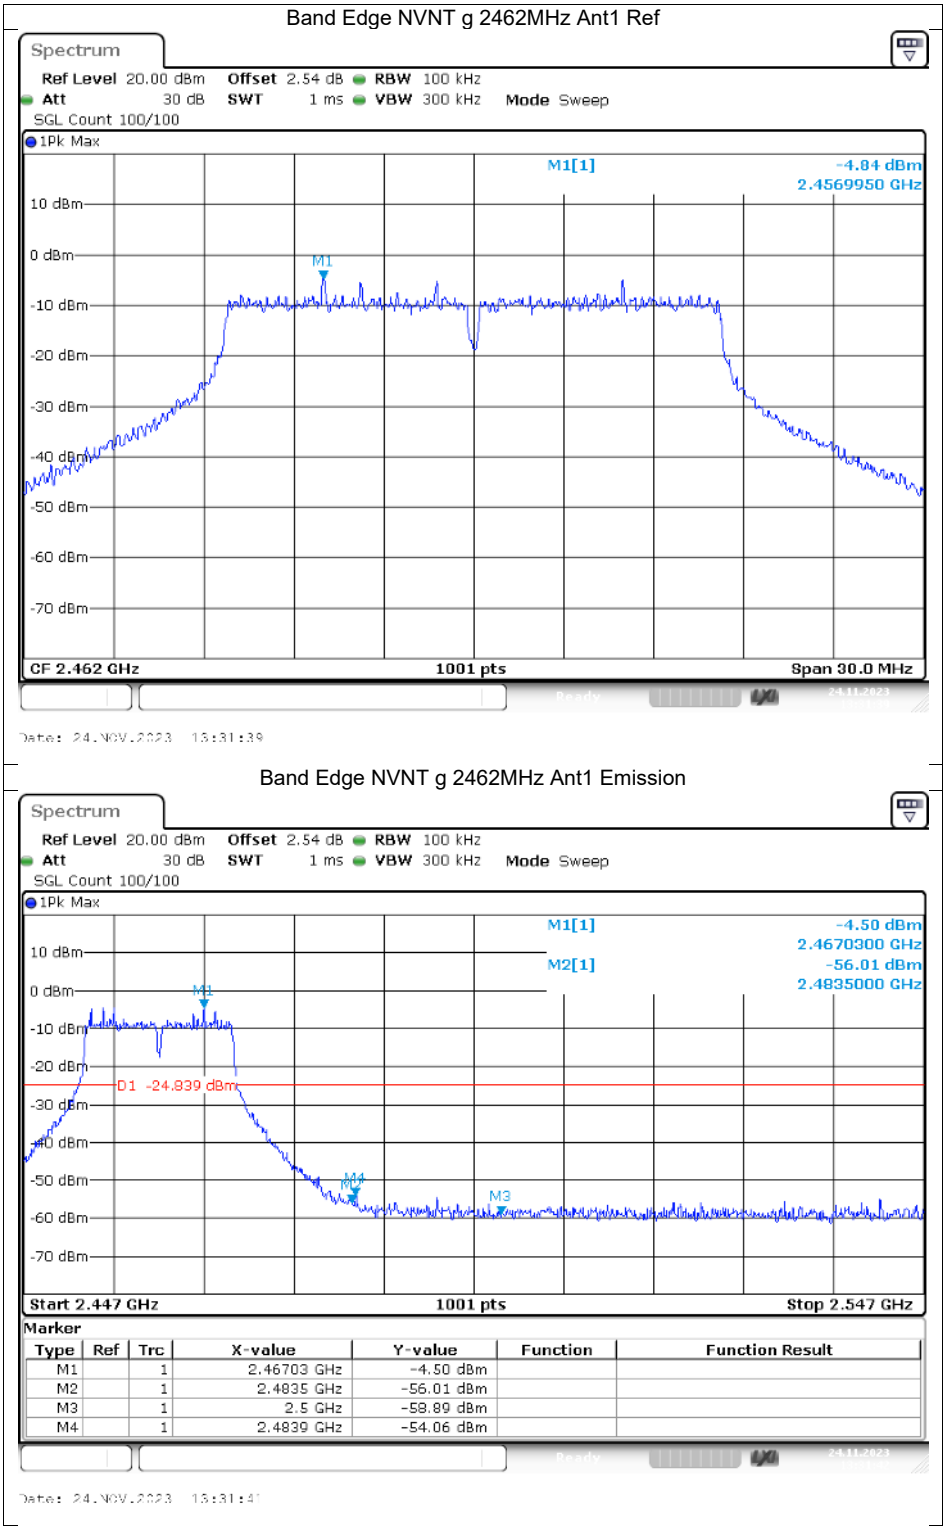

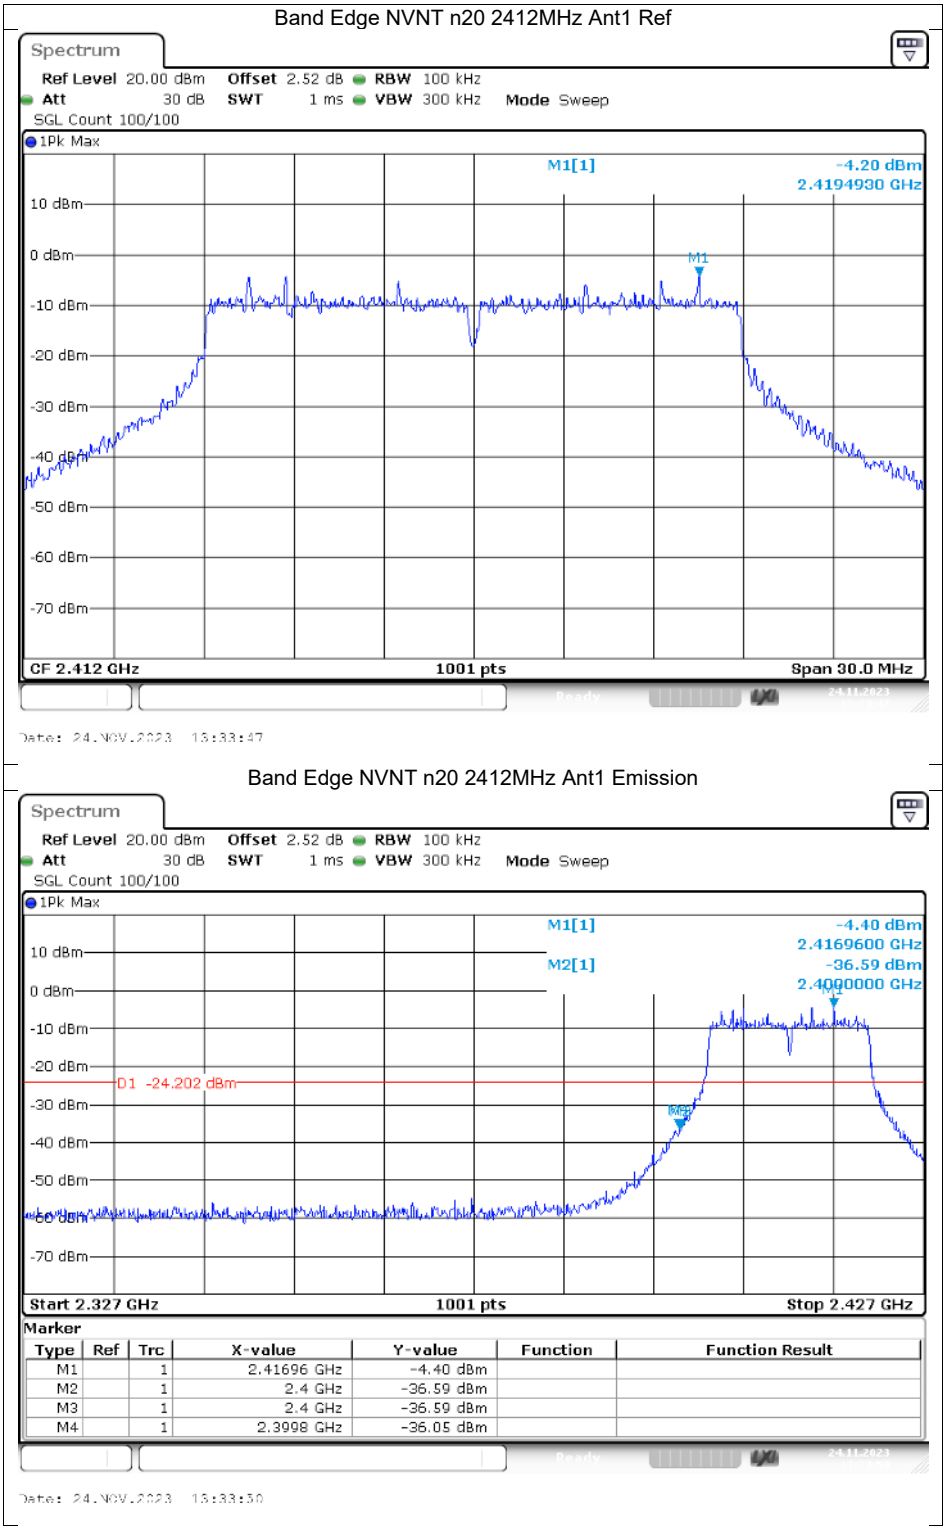

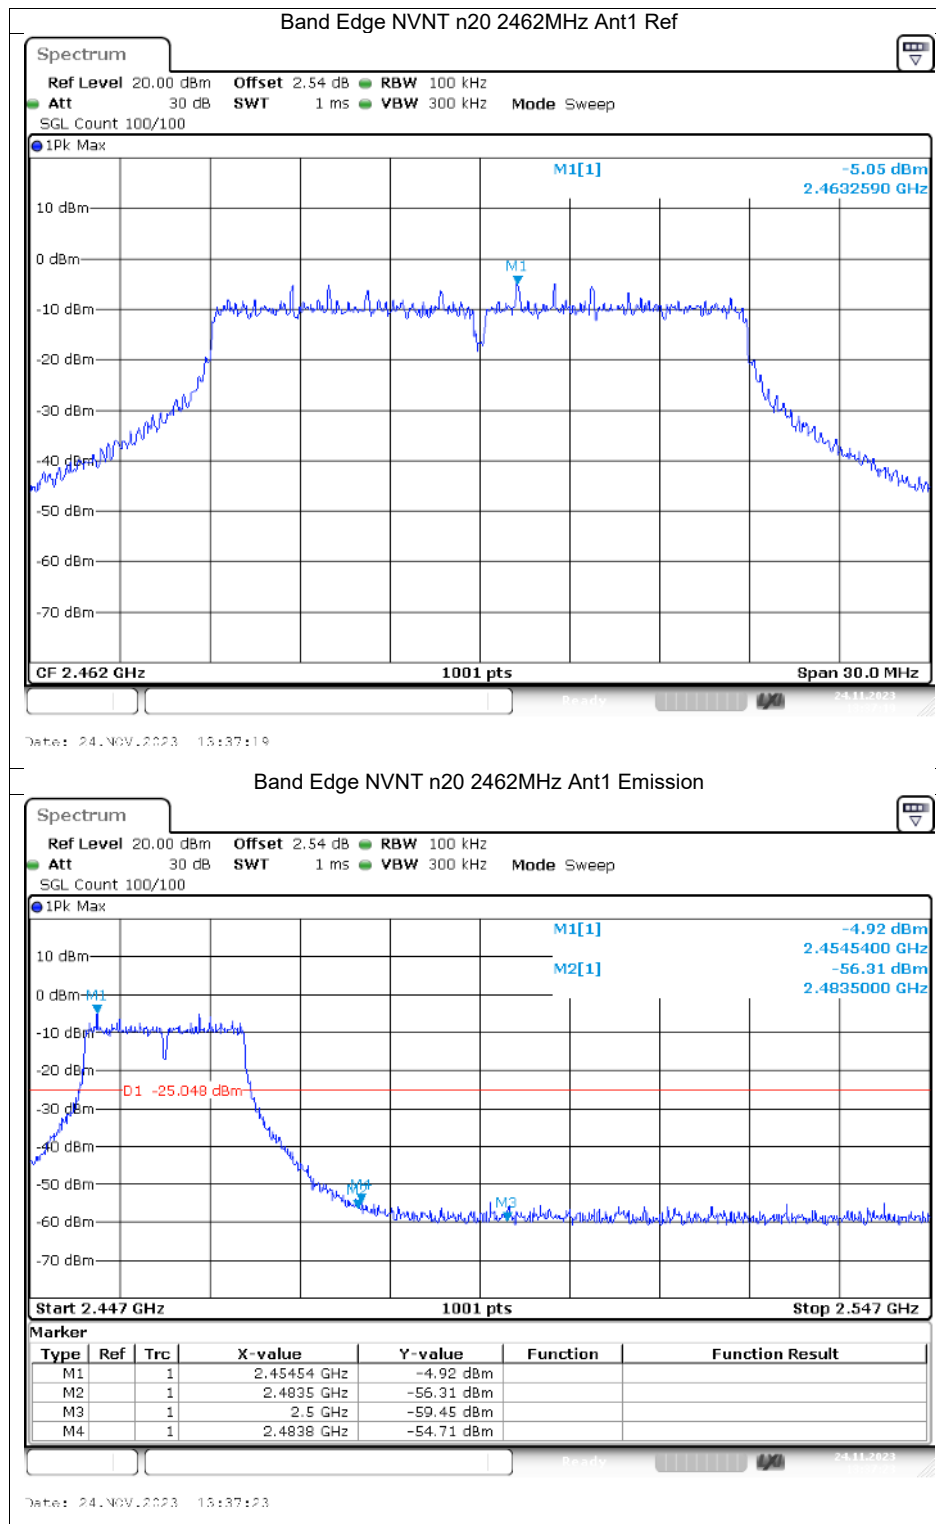


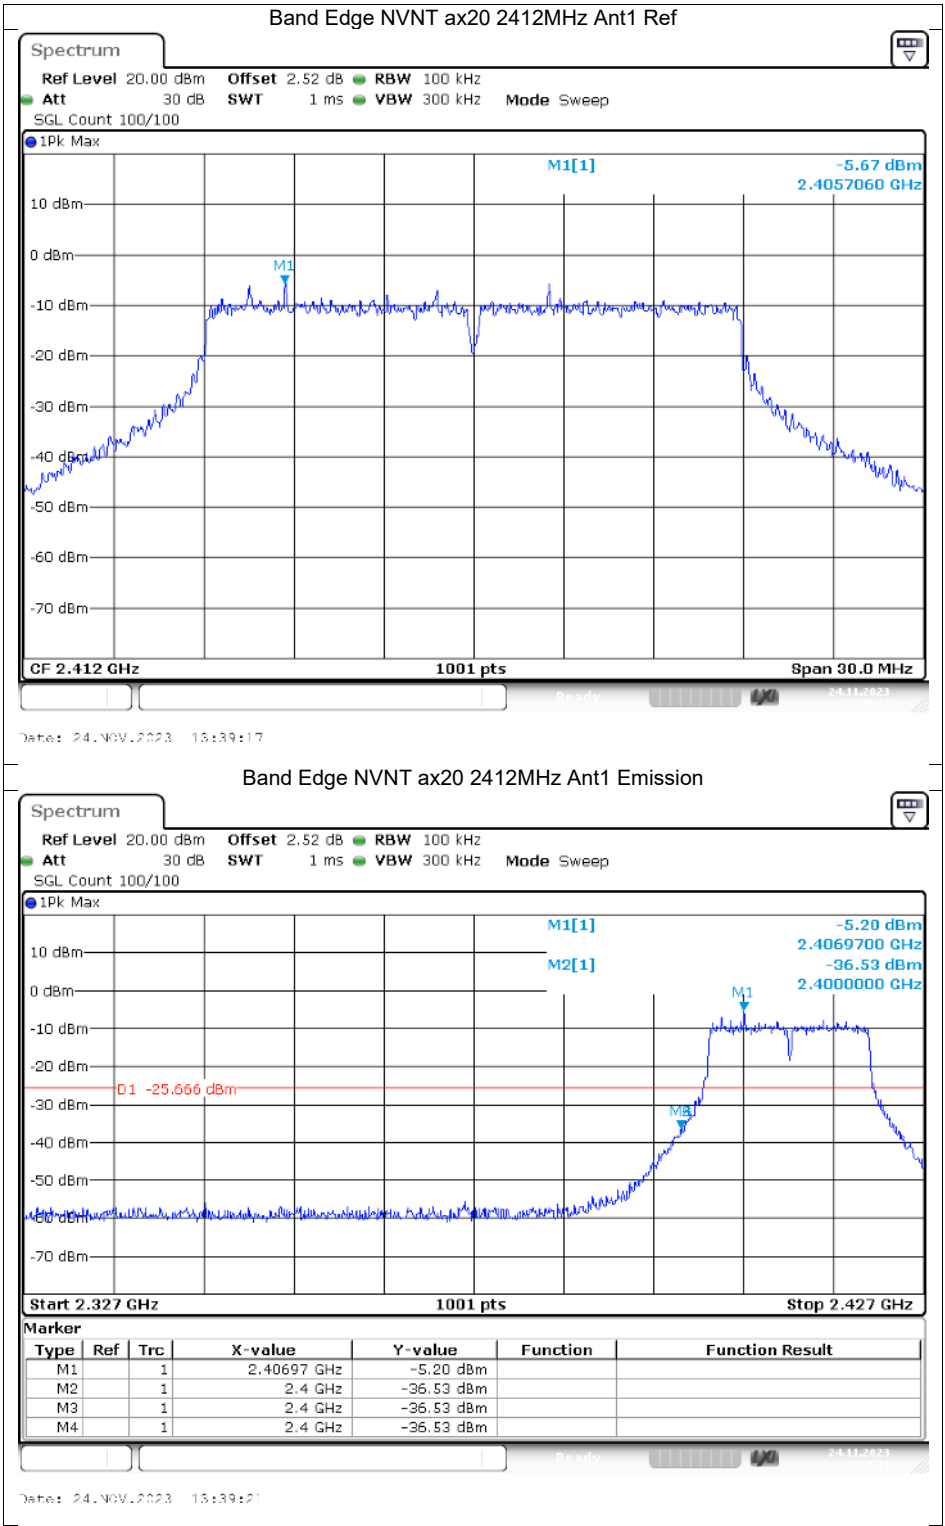


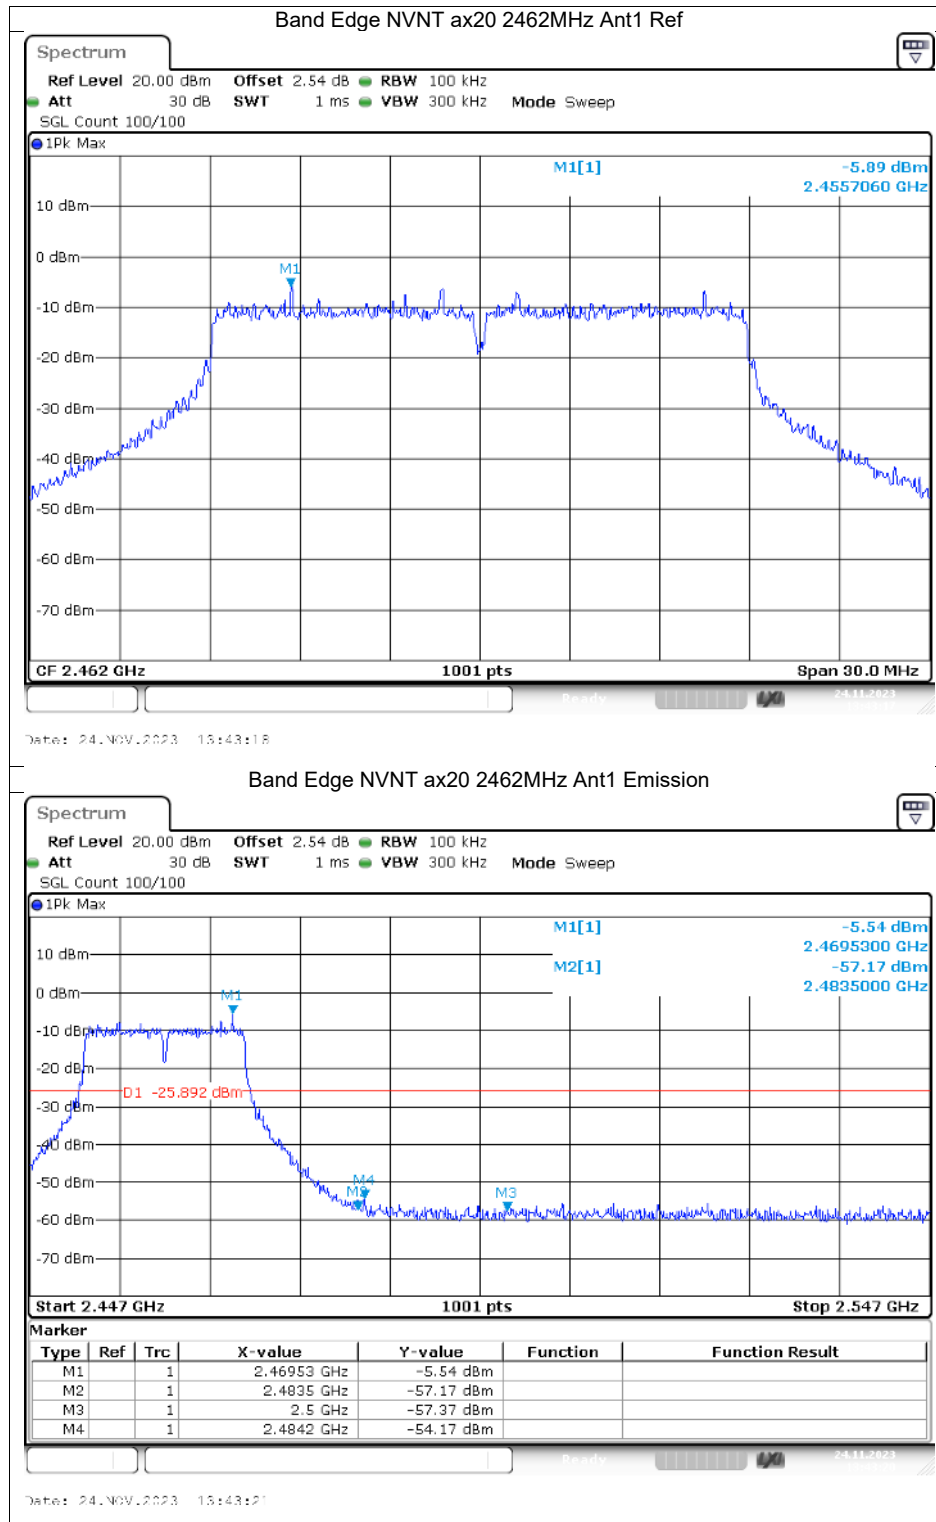



Conducted RF Spurious Emission


Condition	Mode	Frequency (MHz)	Antenna	Max Value (dBc)	Limit (dBc)	Verdict
NVNT	b	2412	Ant1	-40.87	-20	Pass
NVNT	b	2437	Ant1	-39.32	-20	Pass
NVNT	b	2462	Ant1	-40.35	-20	Pass
NVNT	g	2412	Ant1	-33.2	-20	Pass
NVNT	g	2437	Ant1	-31.87	-20	Pass
NVNT	g	2462	Ant1	-33.94	-20	Pass
NVNT	n20	2412	Ant1	-33.59	-20	Pass
NVNT	n20	2437	Ant1	-32.22	-20	Pass
NVNT	n20	2462	Ant1	-32.17	-20	Pass
NVNT	ax20	2412	Ant1	-32.29	-20	Pass
NVNT	ax20	2437	Ant1	-30.86	-20	Pass
NVNT	ax20	2462	Ant1	-32.37	-20	Pass

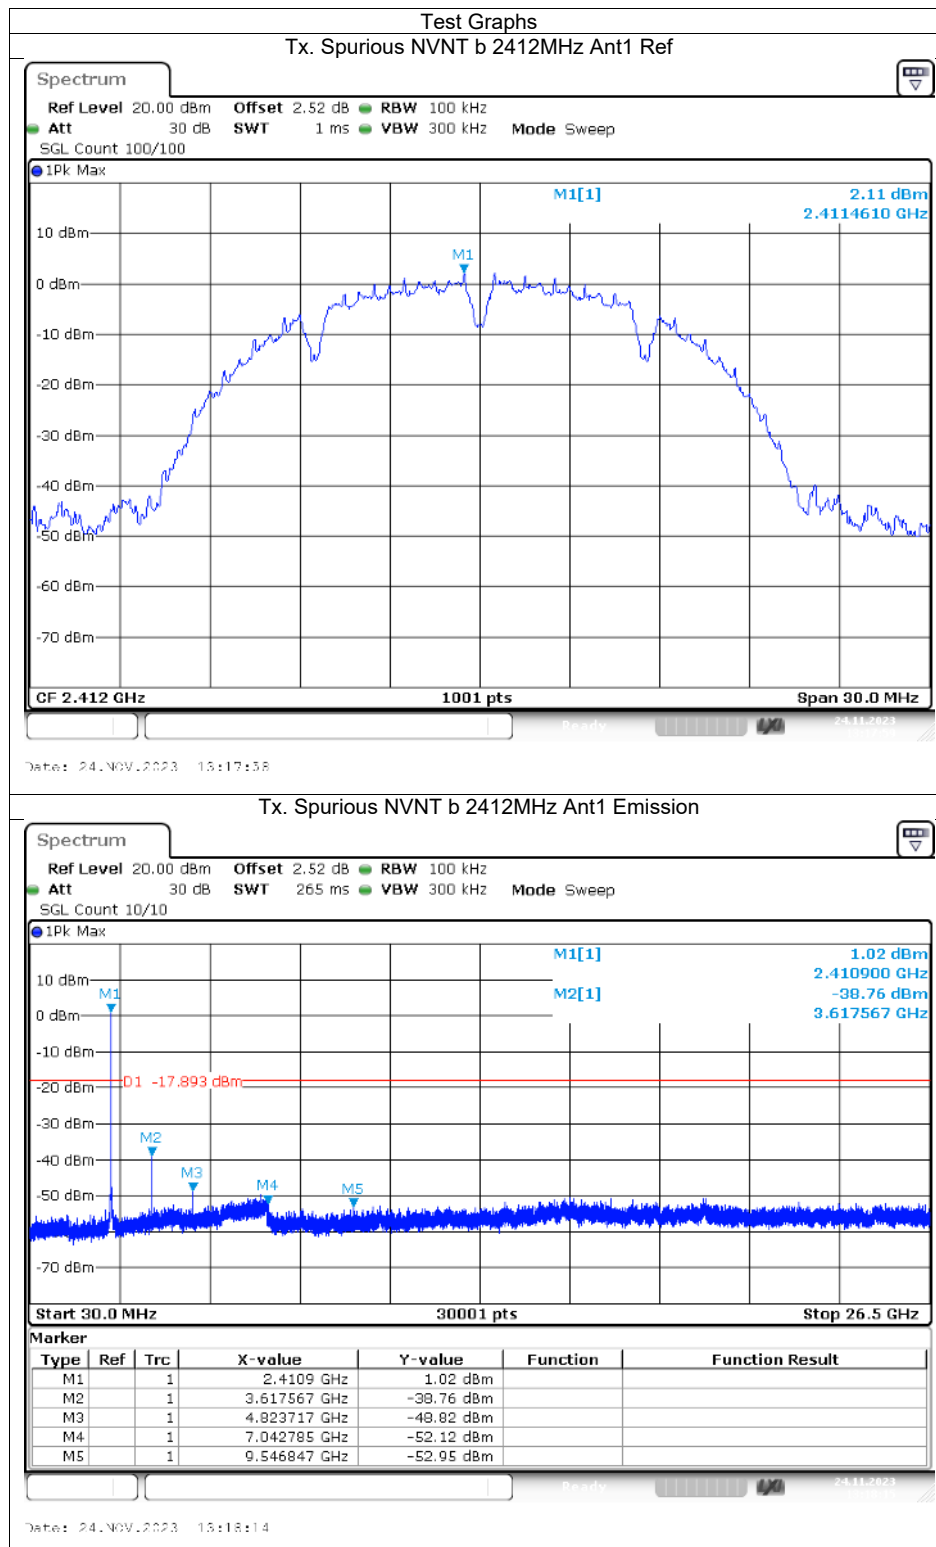


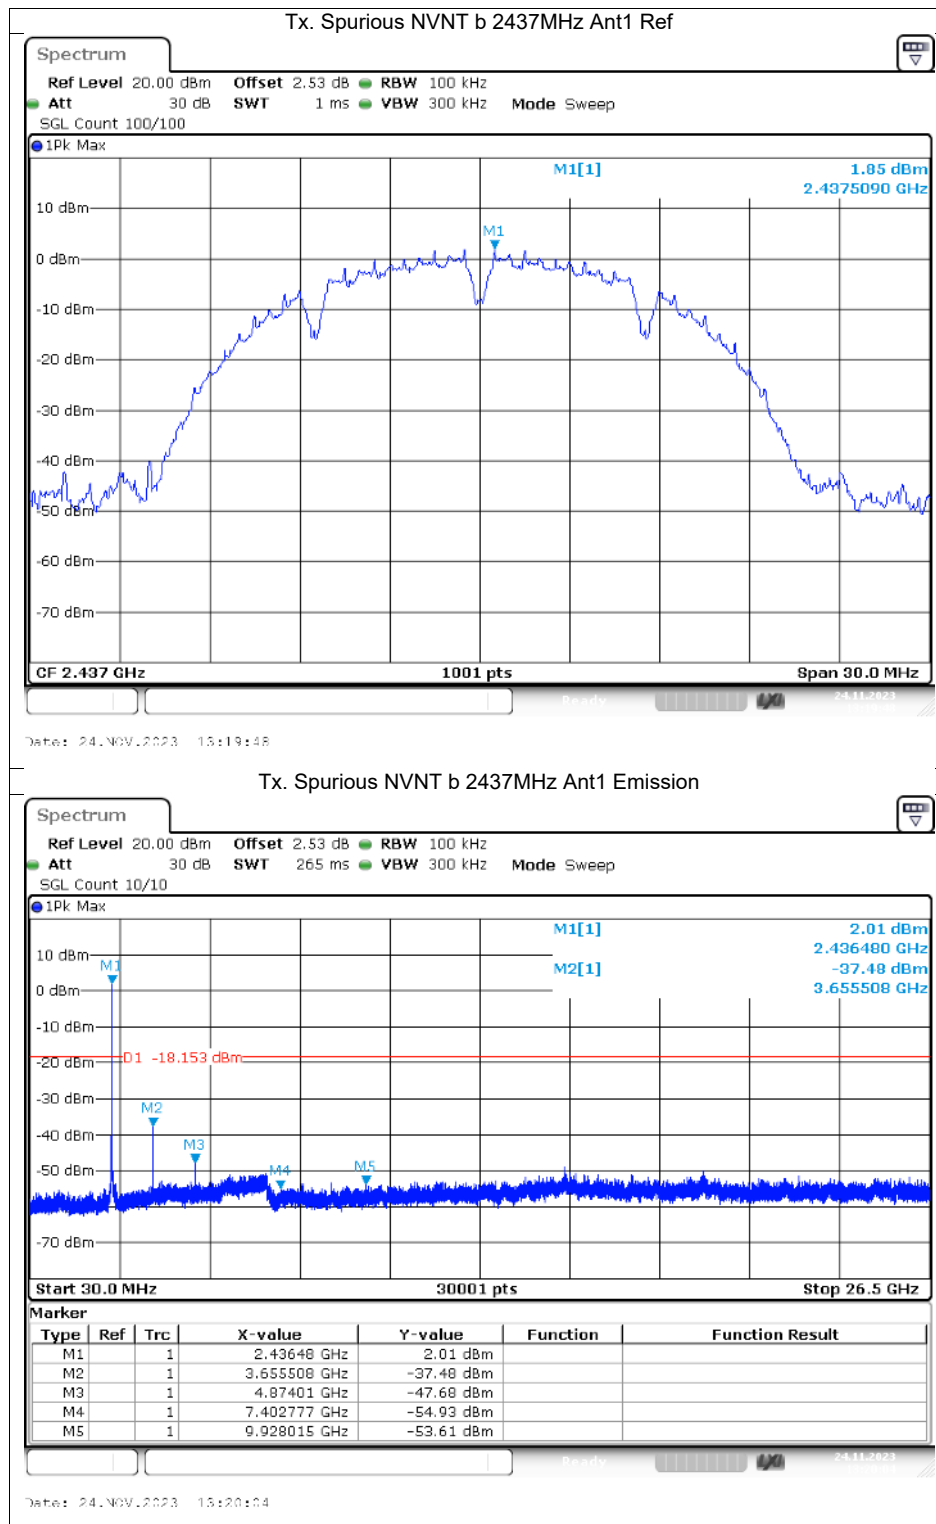


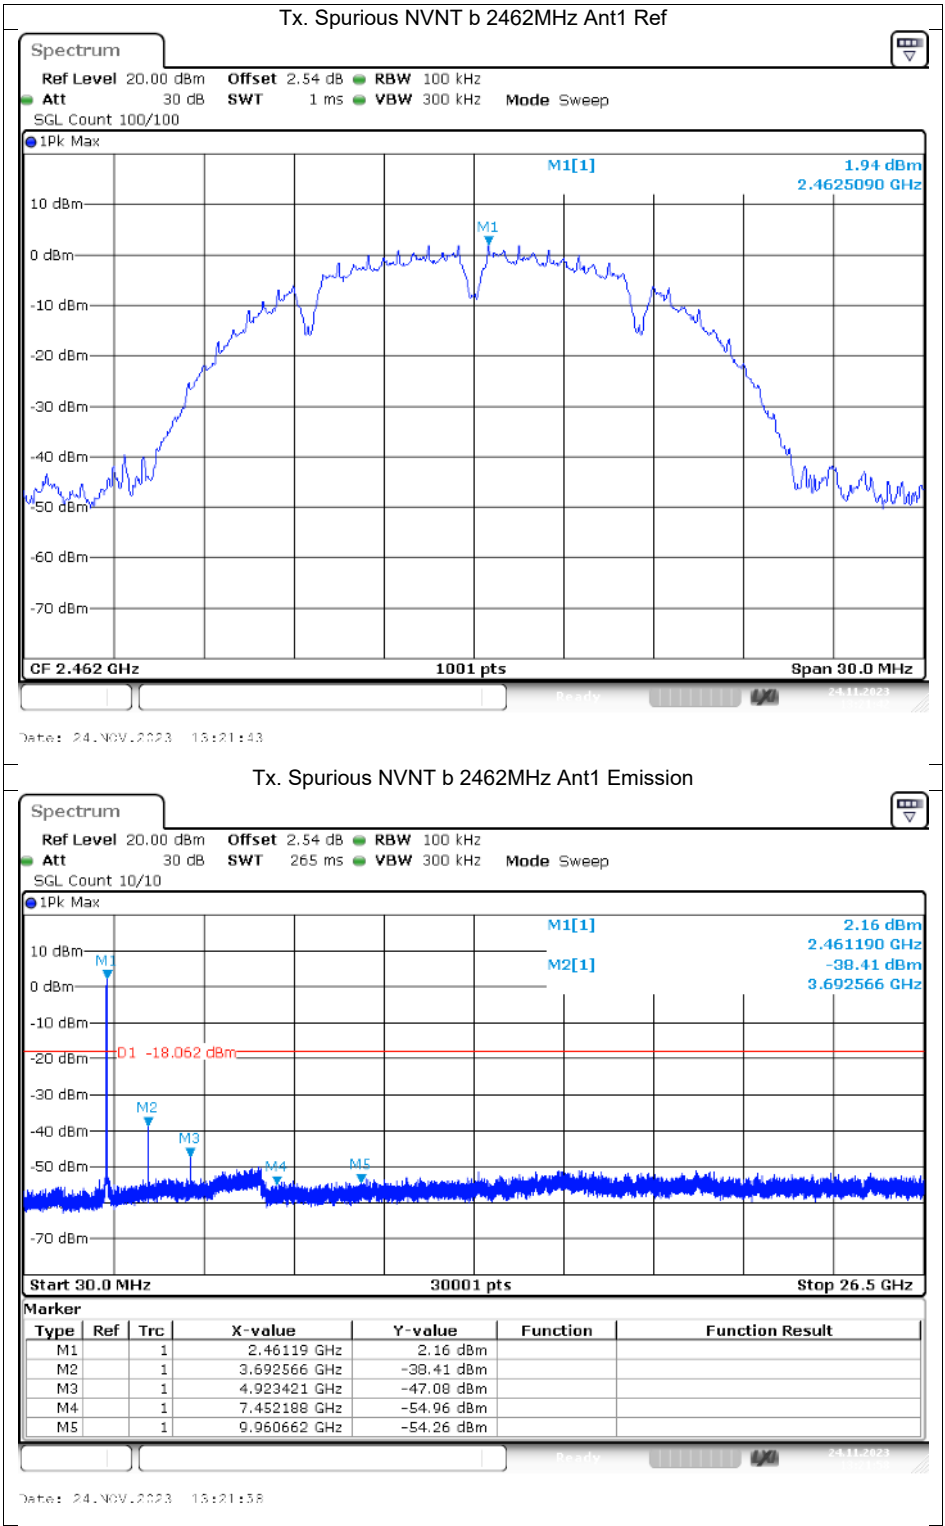


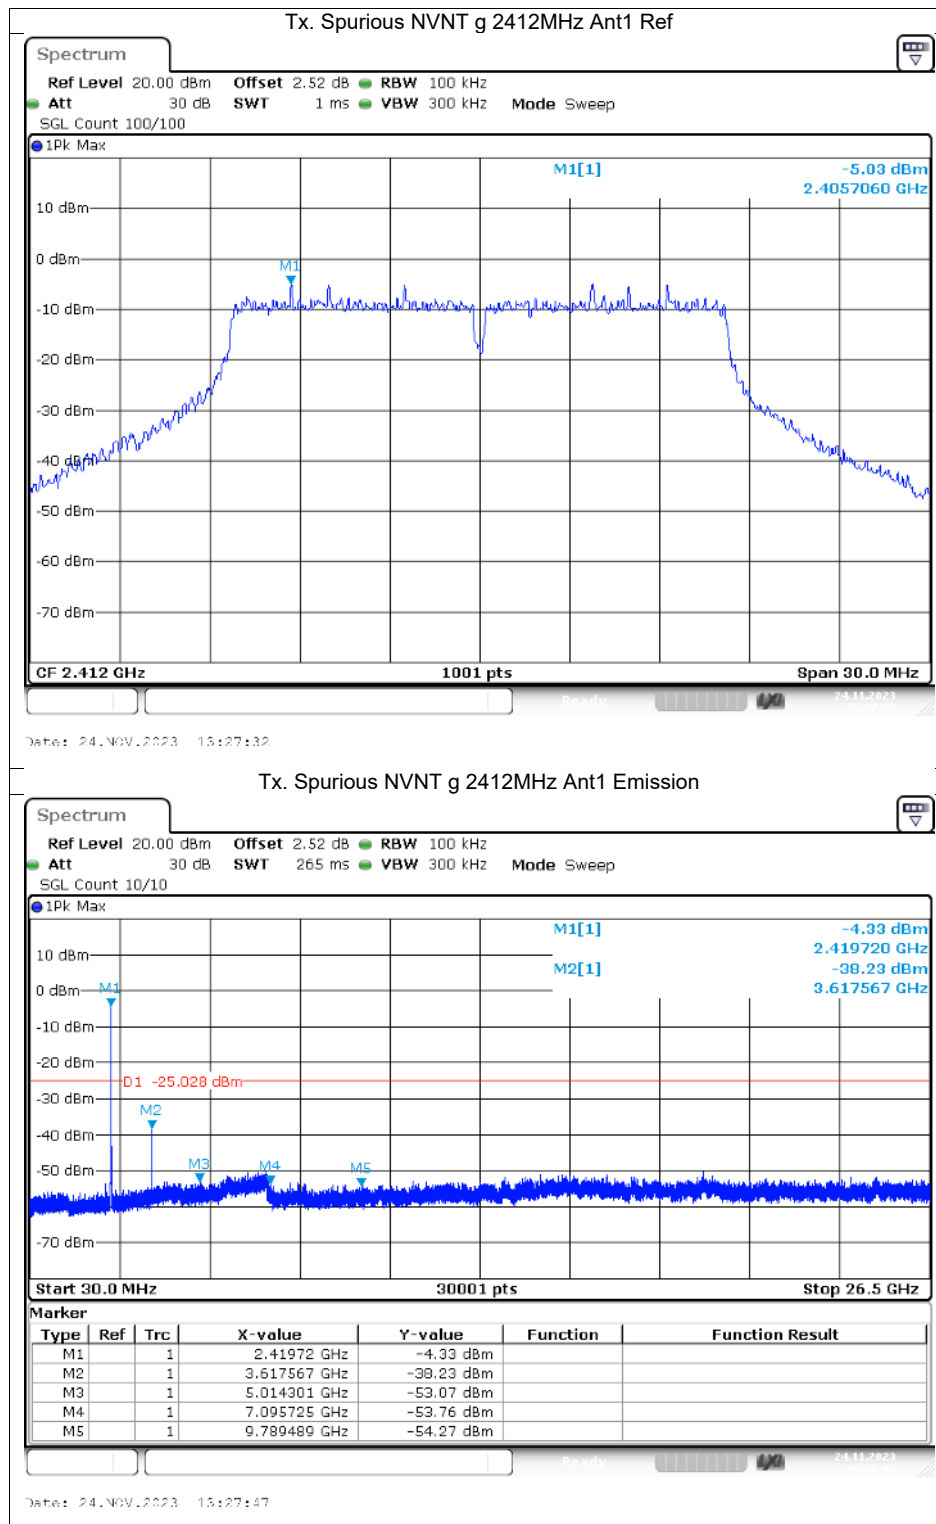


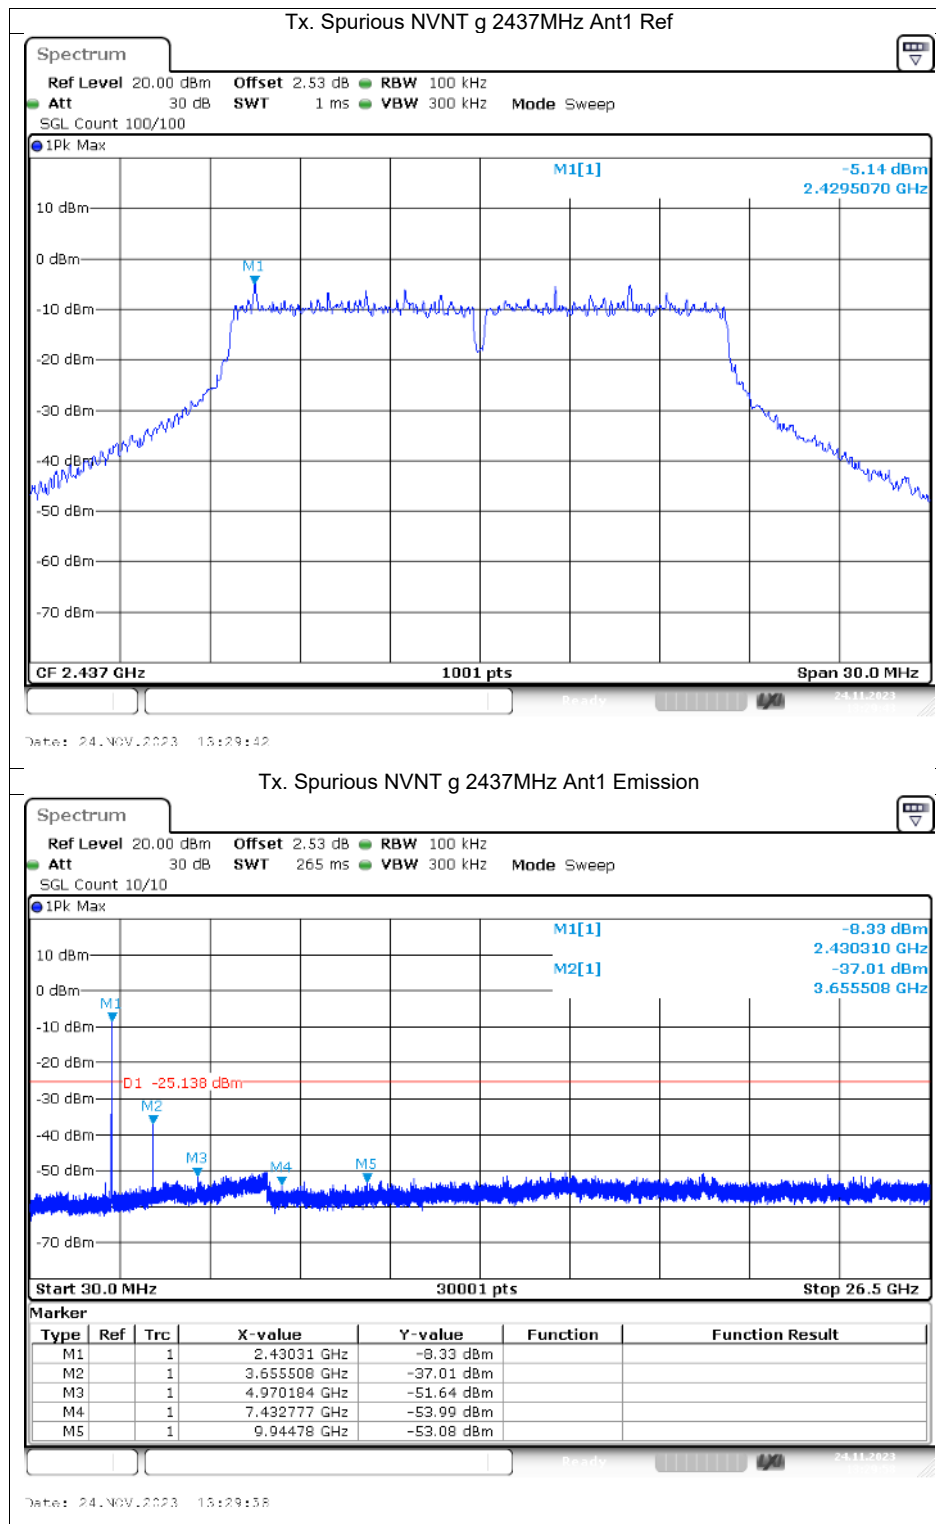


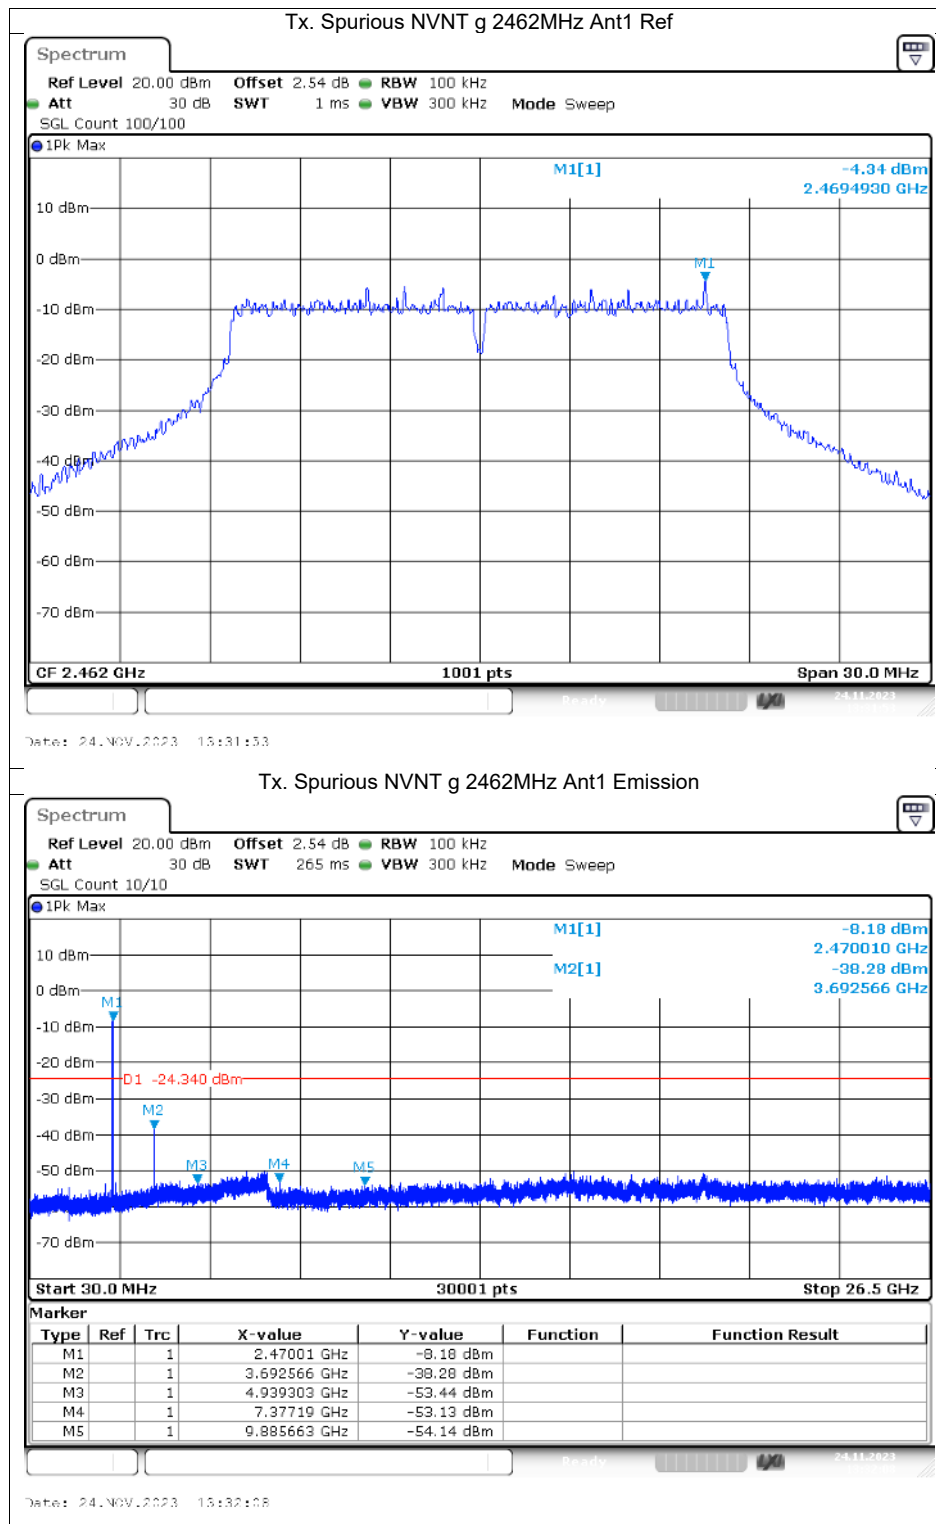


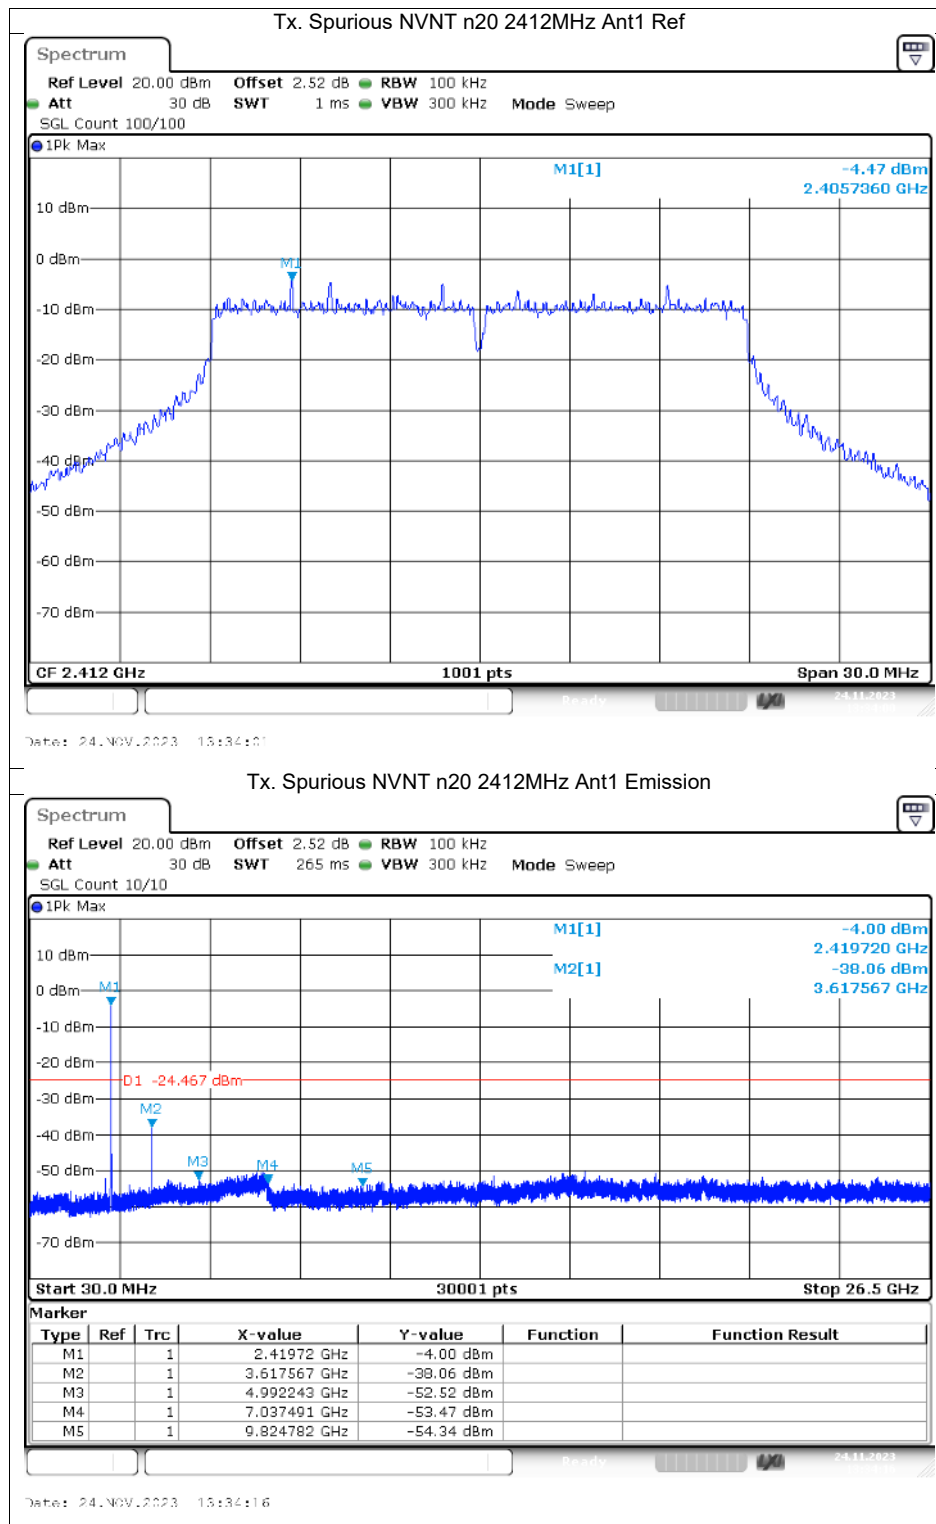


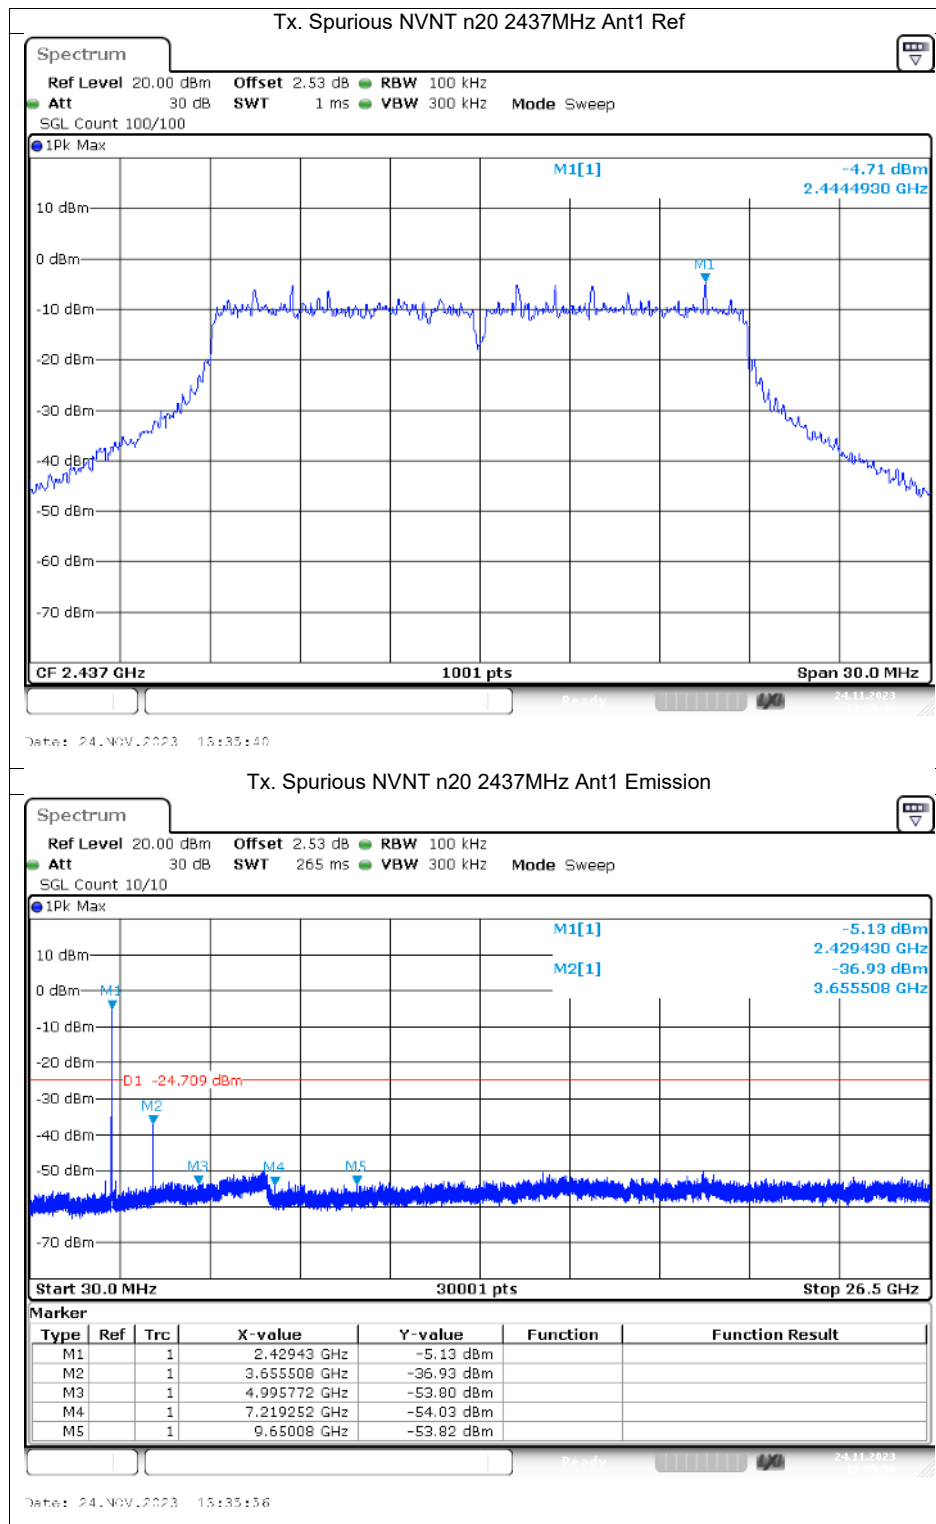

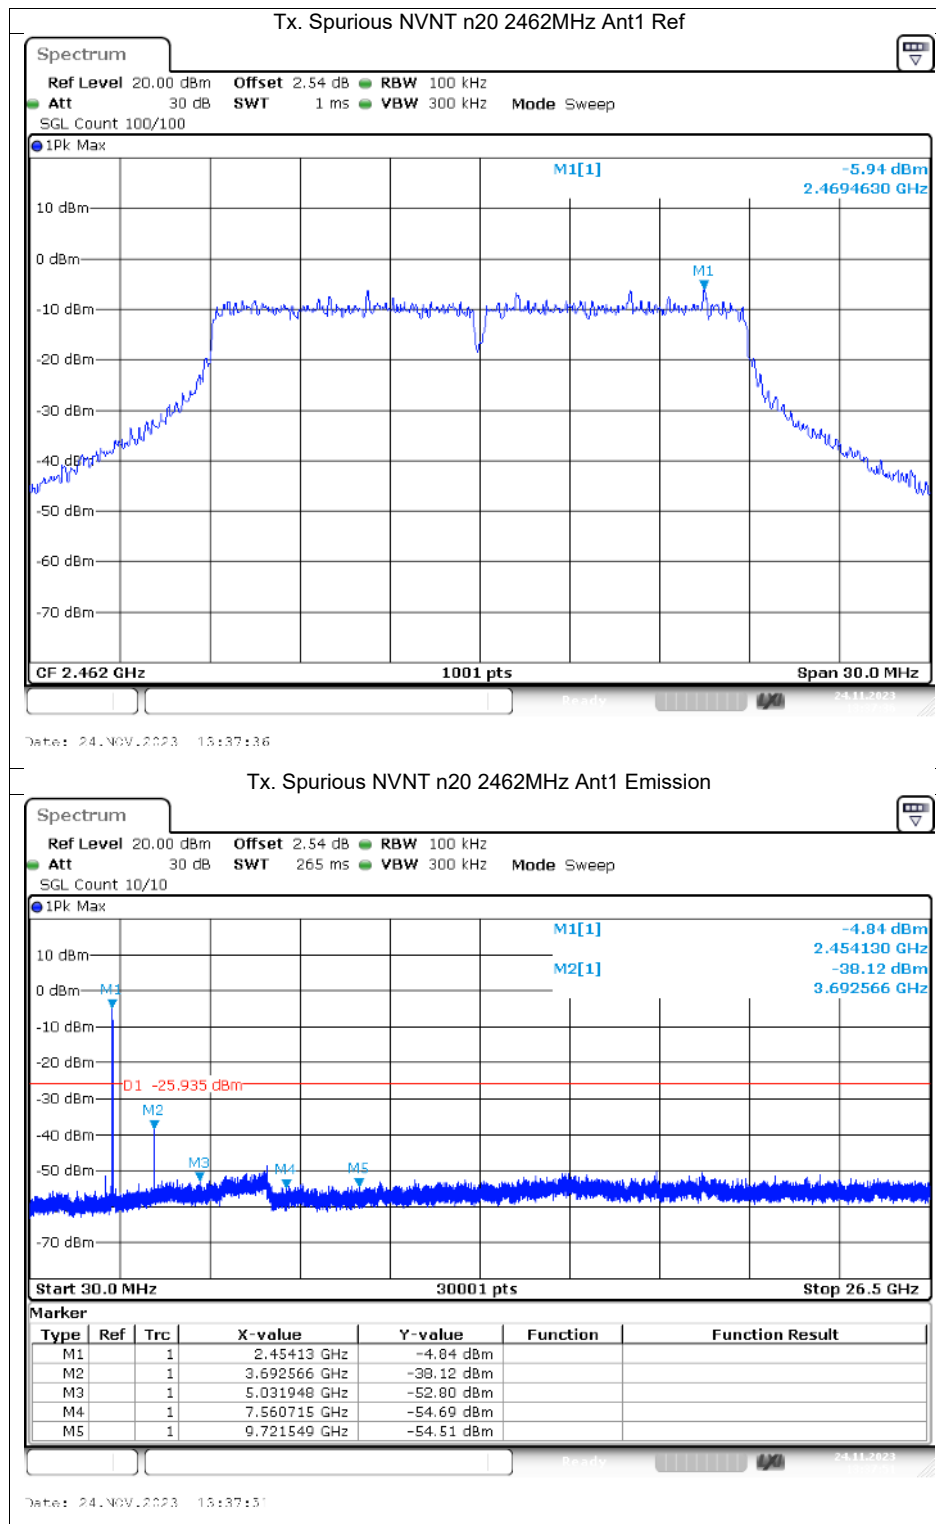

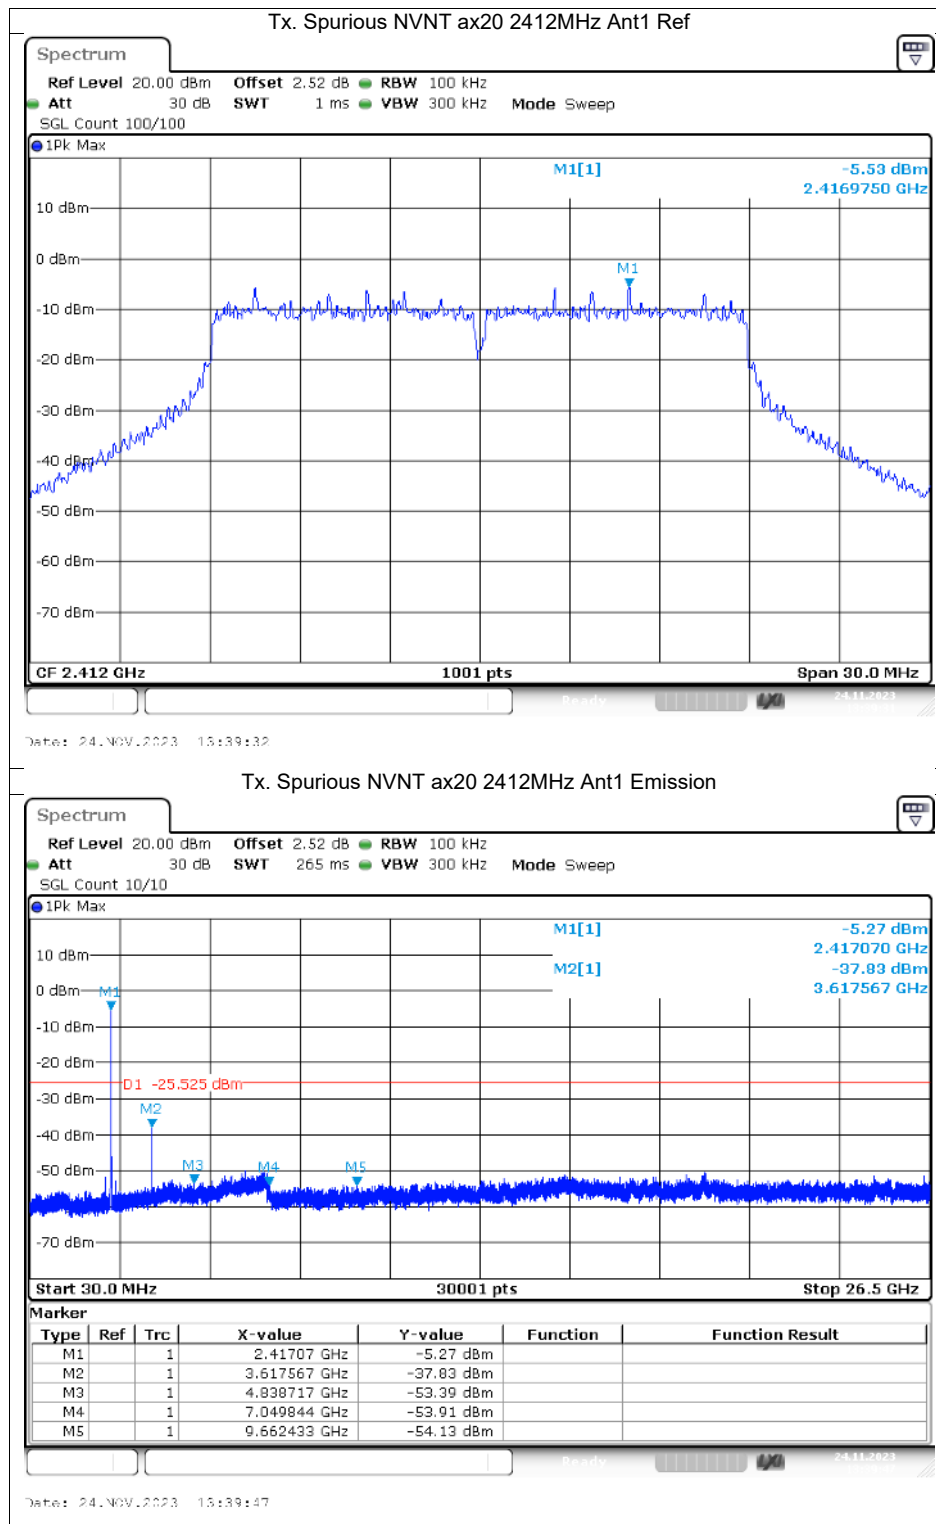


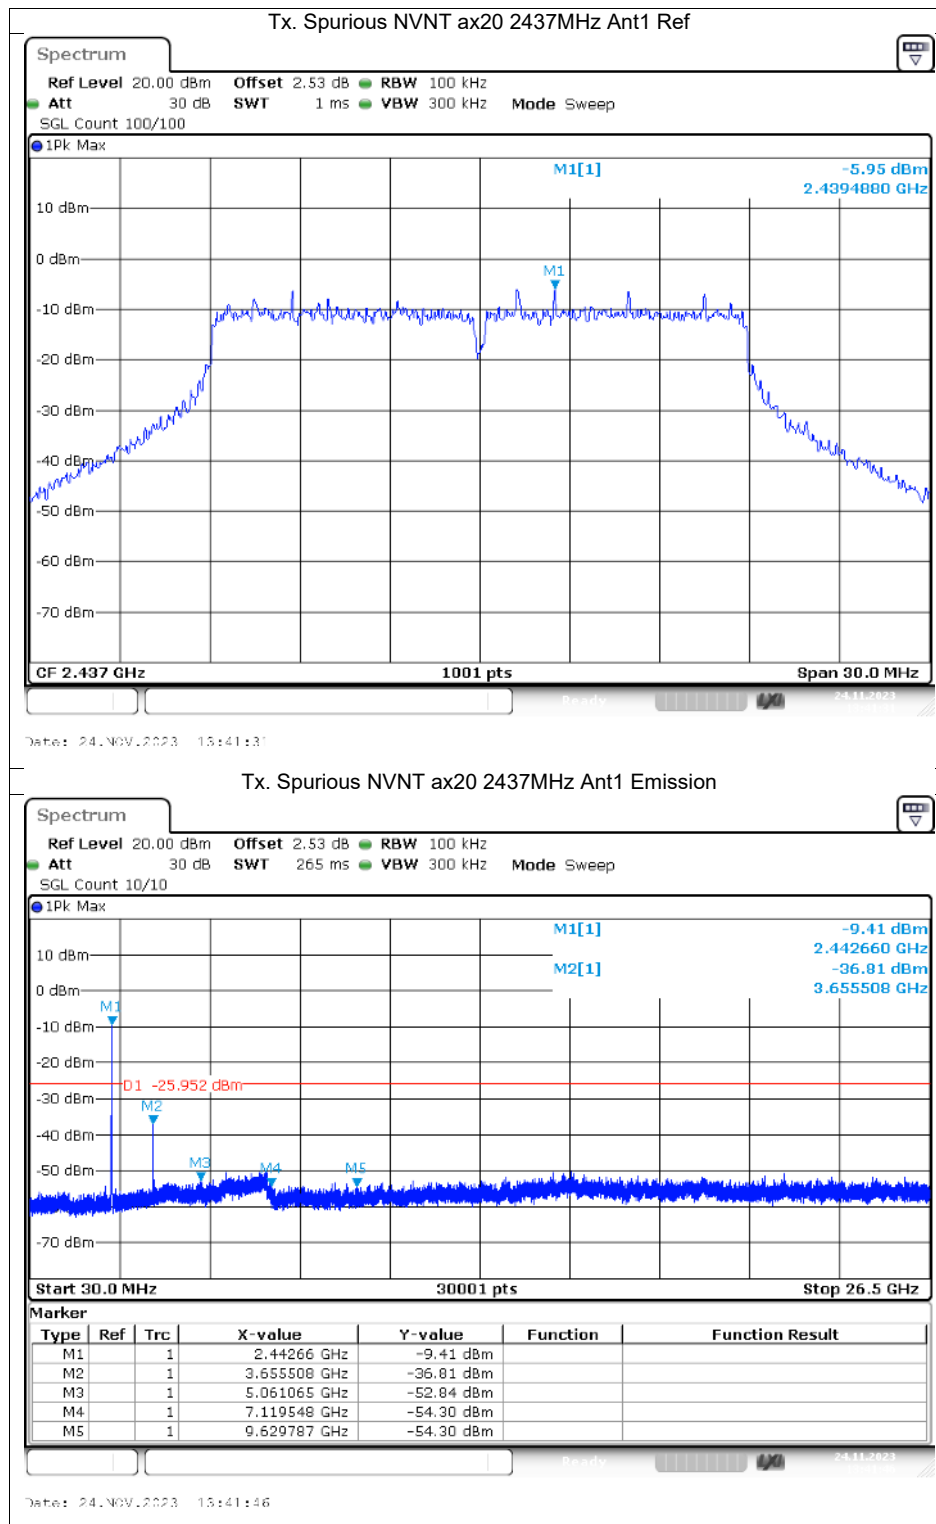

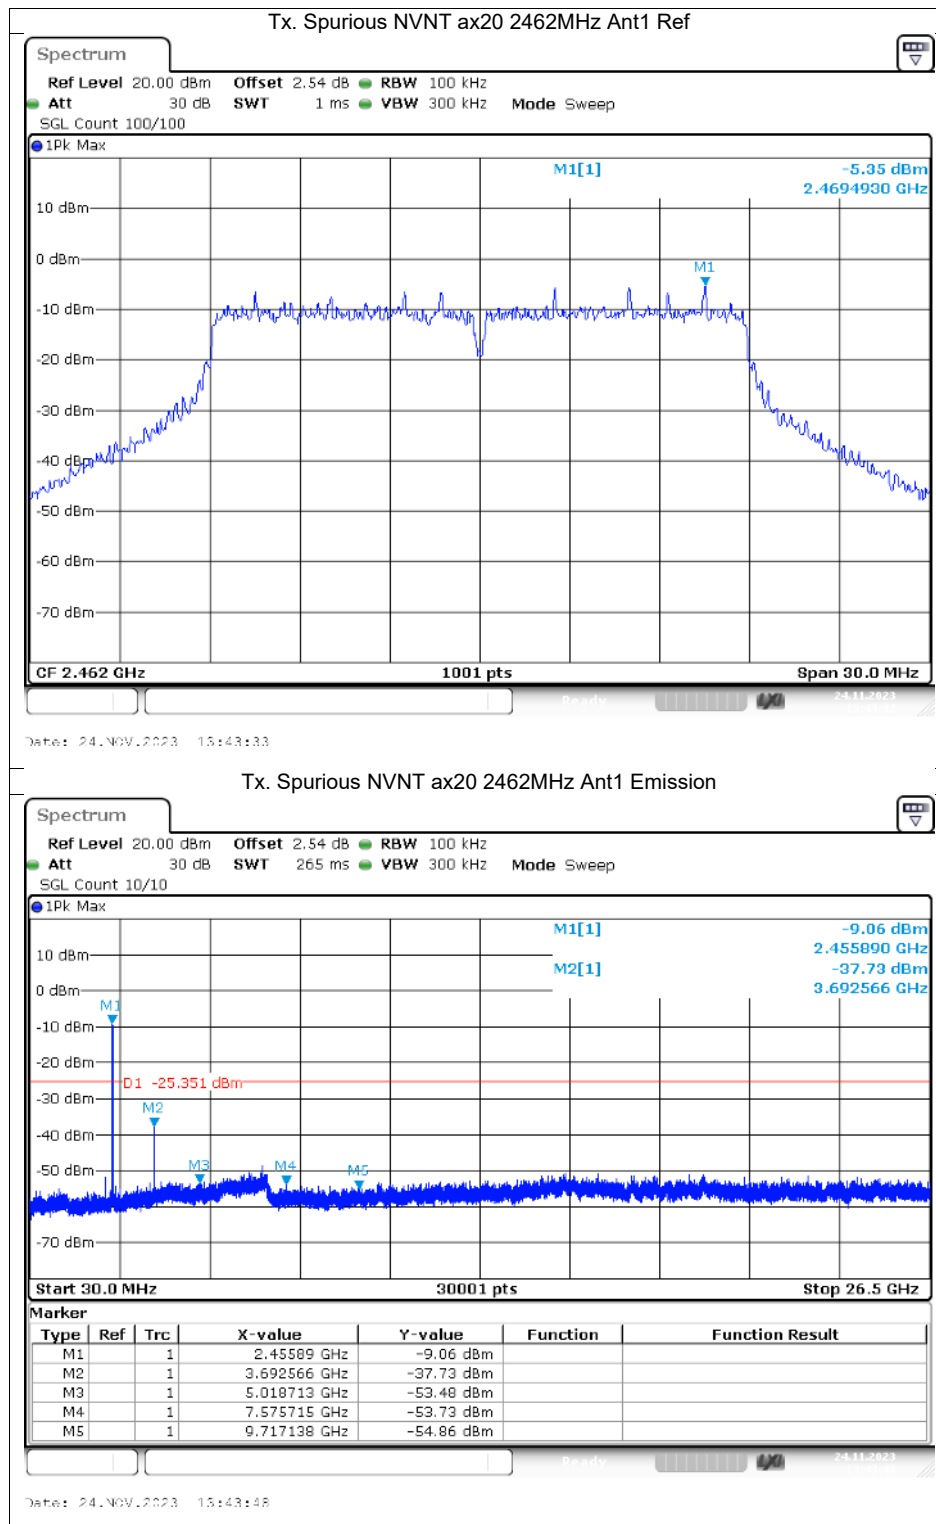



APPENDIX: PHOTOGRAPHS OF TEST CONFIGURATION

AC Power Line Conducted Emission

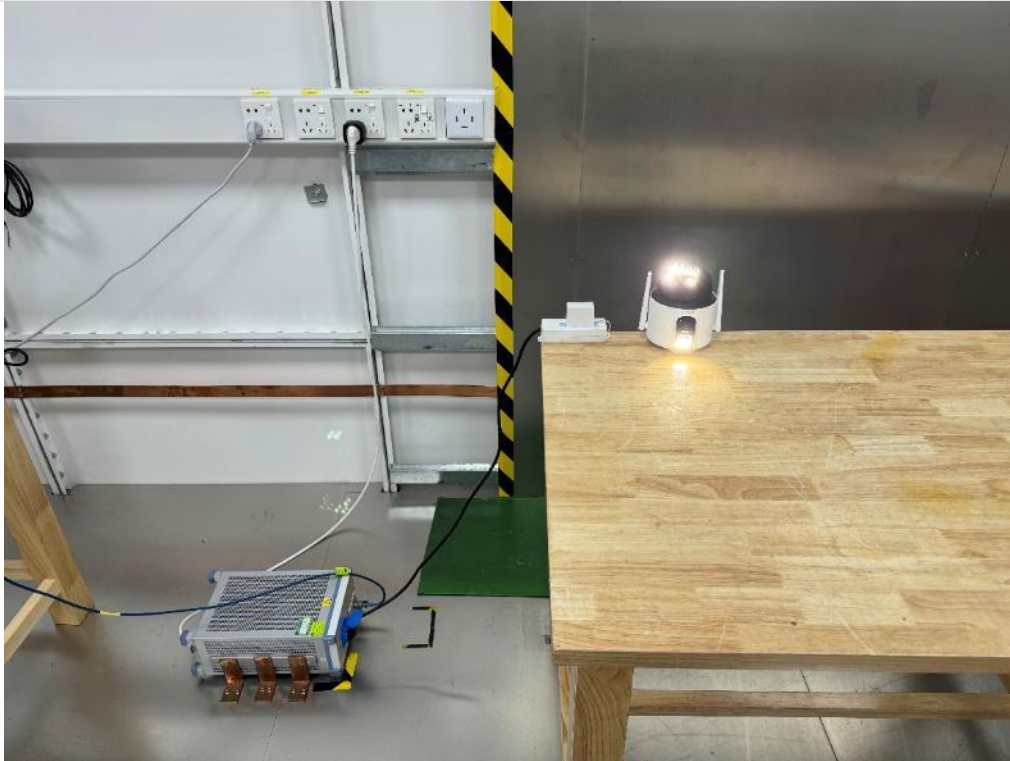


Radiated Band edge and Spurious Emission

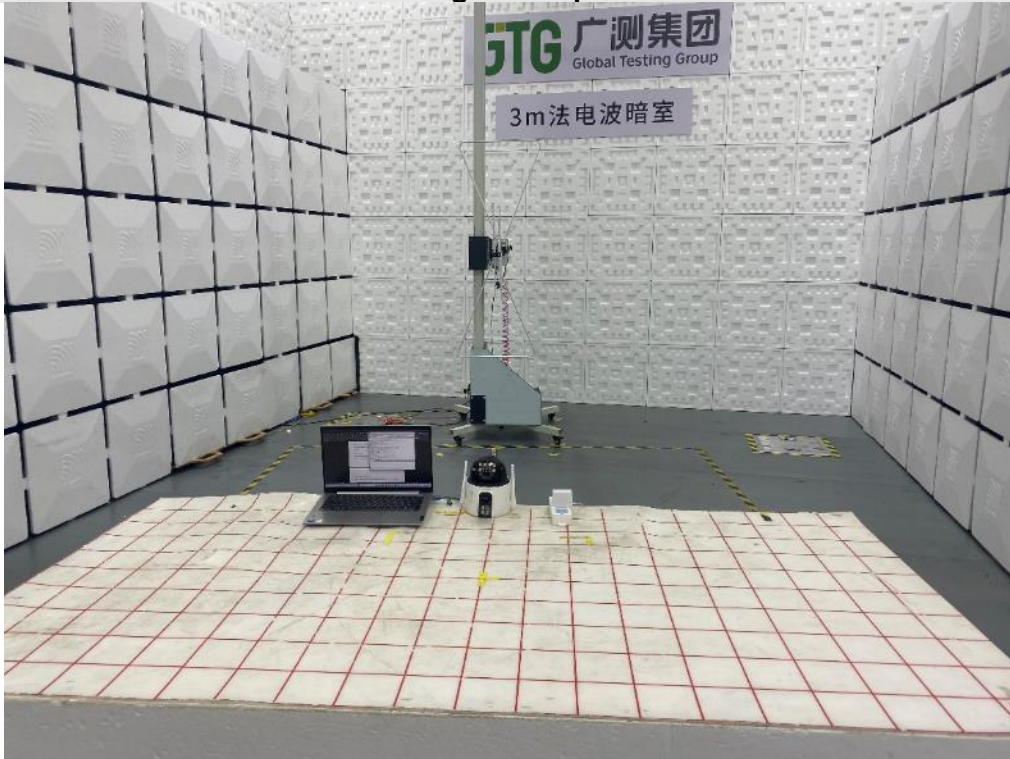


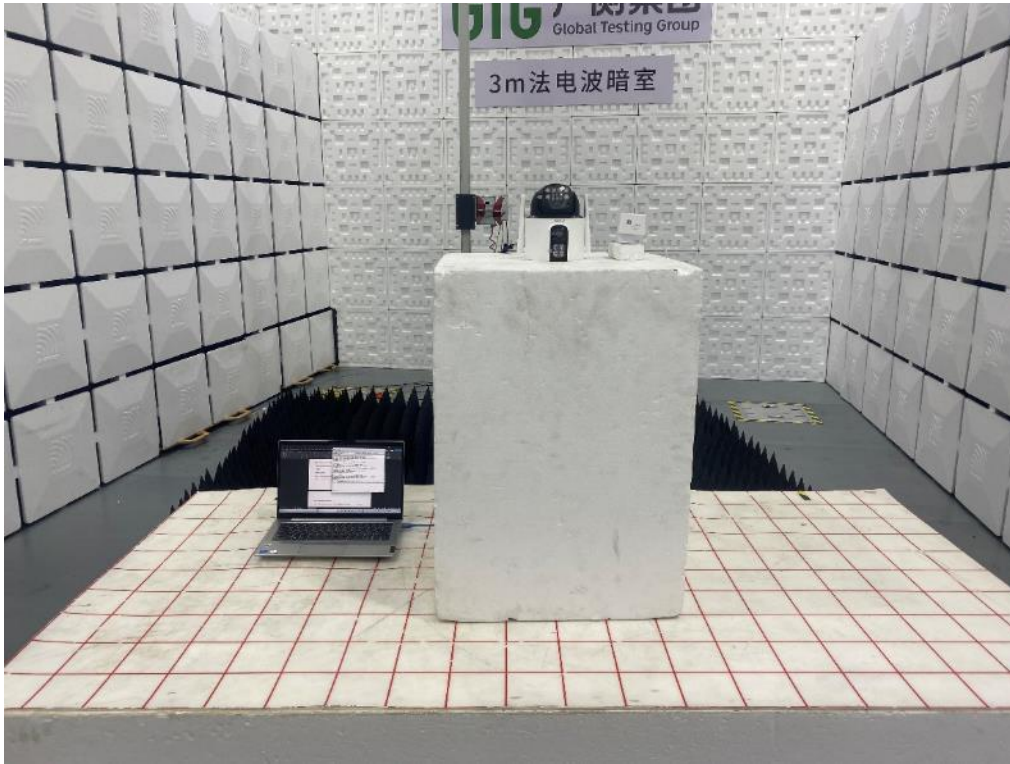

APPENDIX: PHOTOGRAPHS OF THE EUT


External

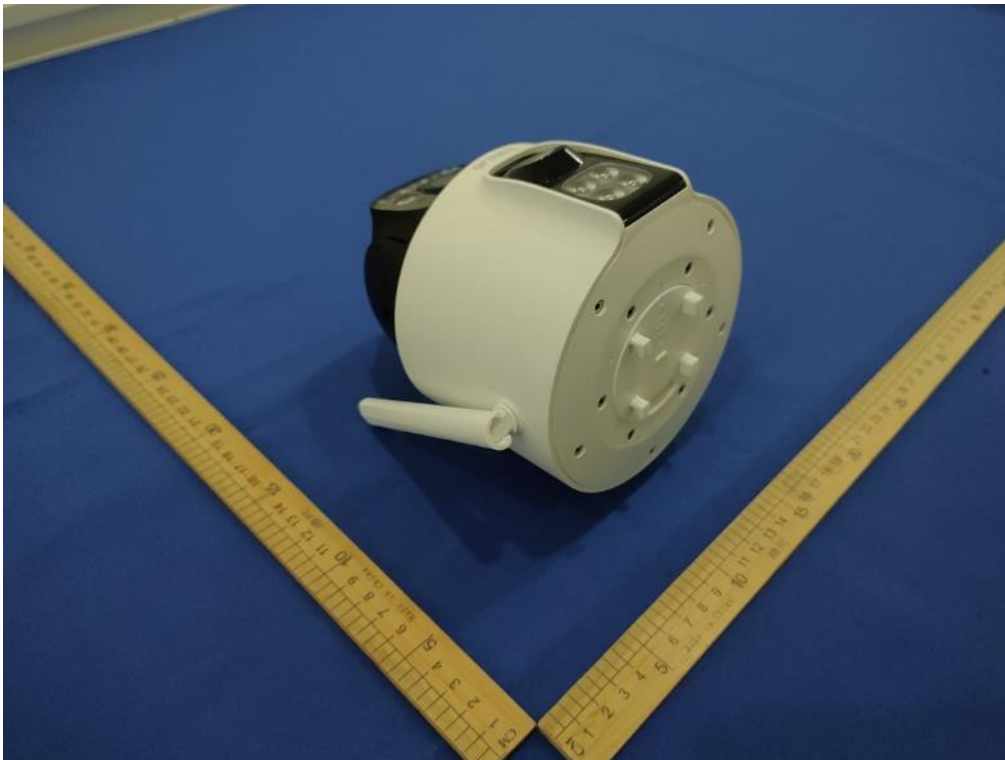


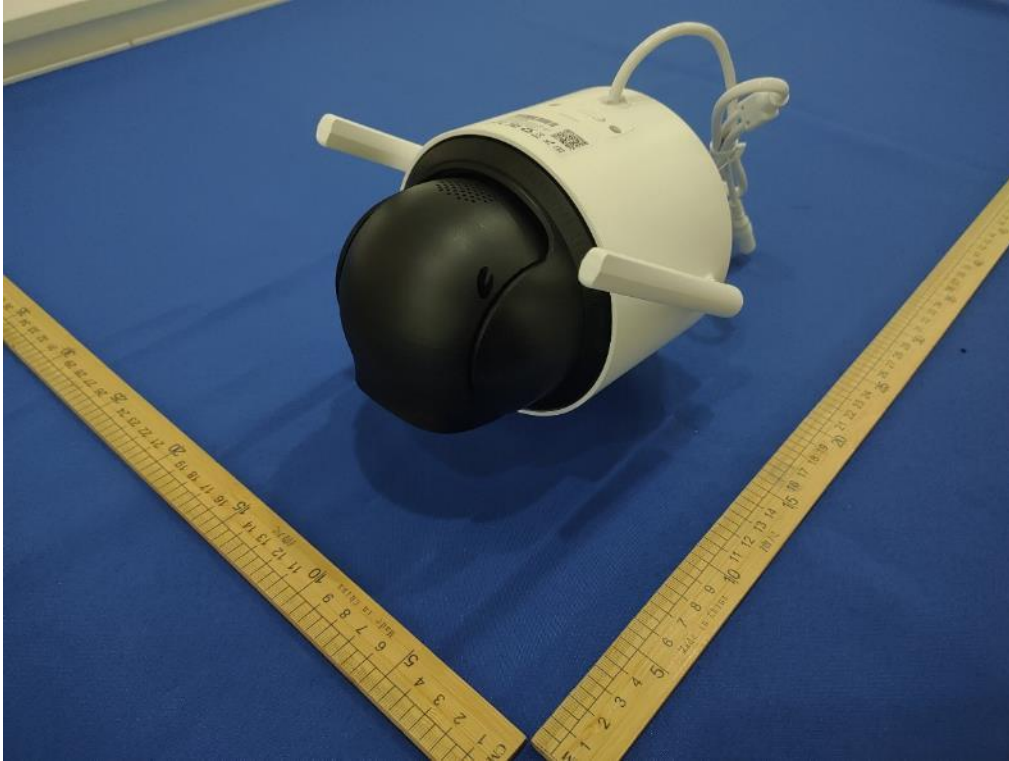











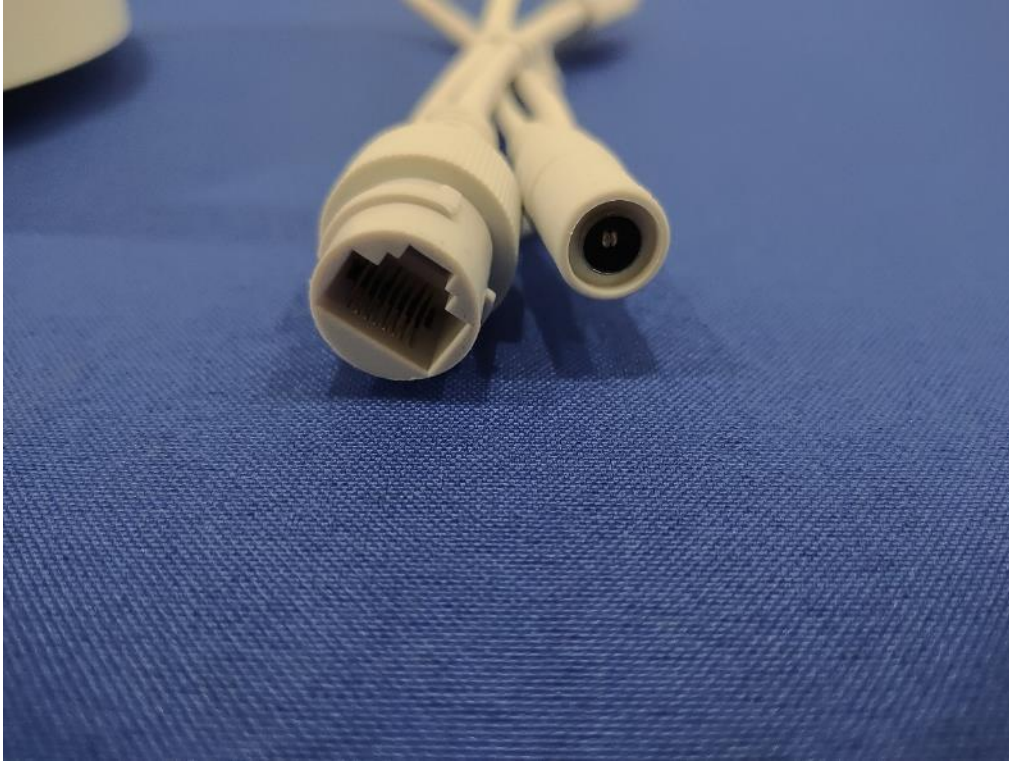




Internal

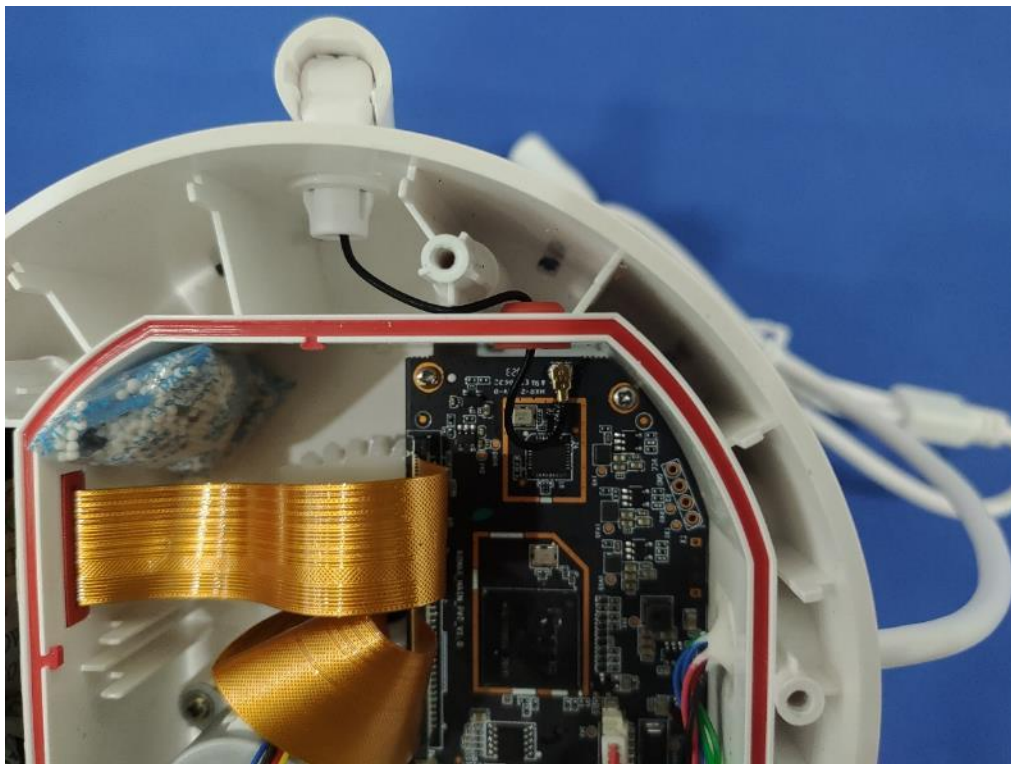
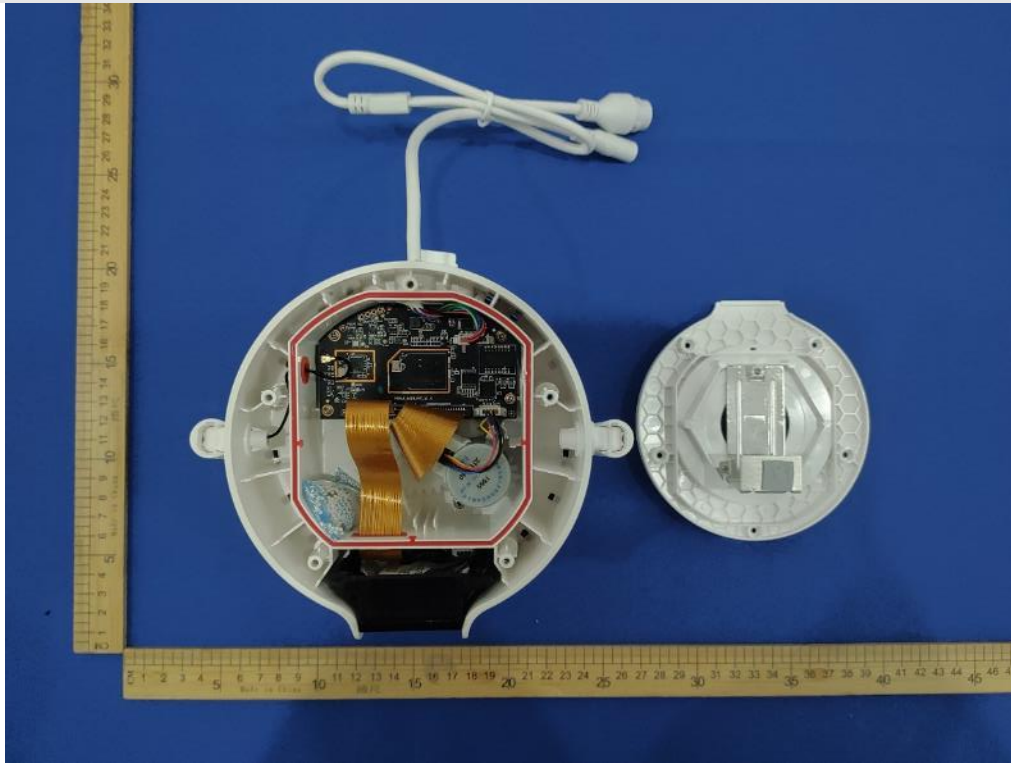


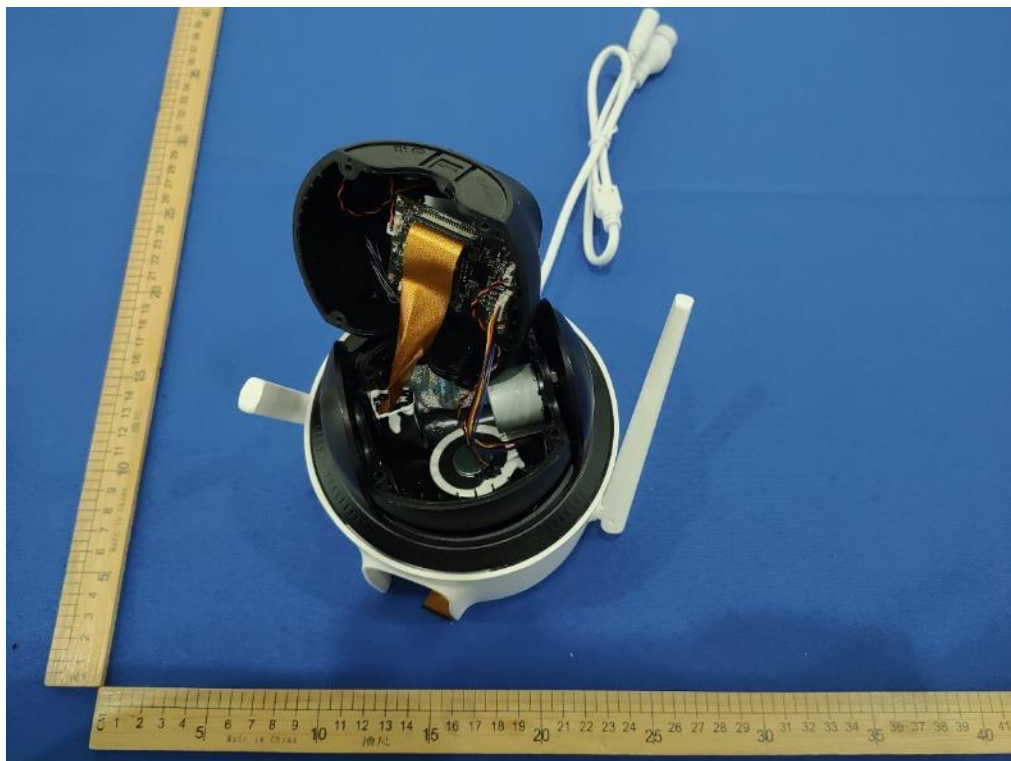
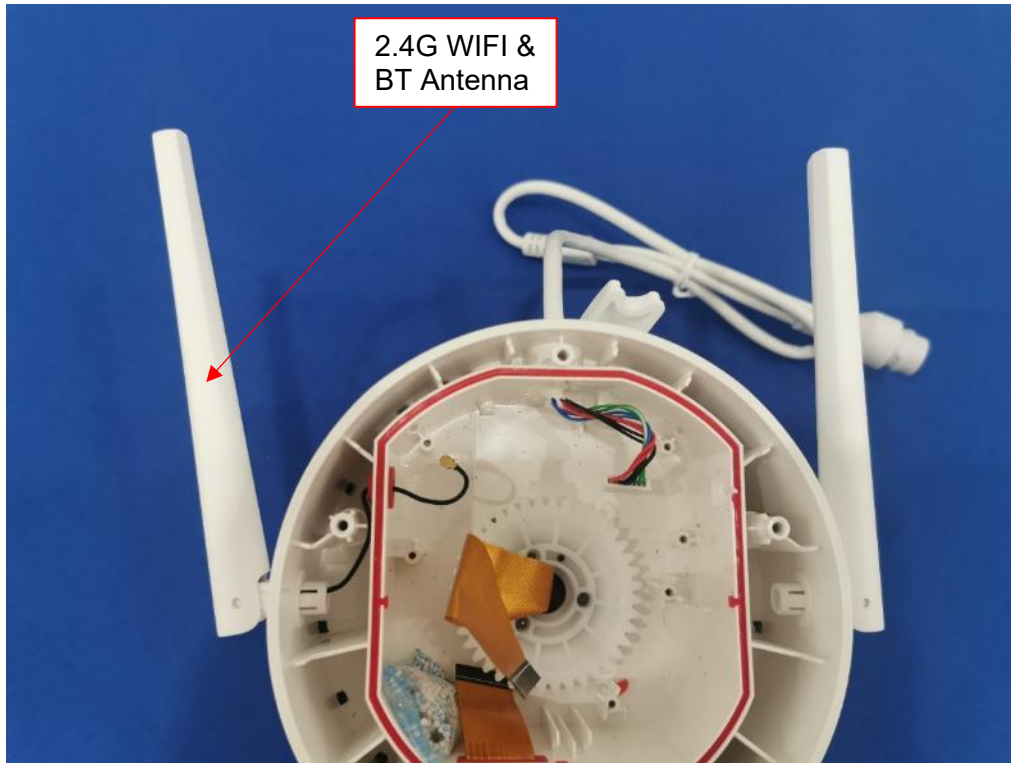


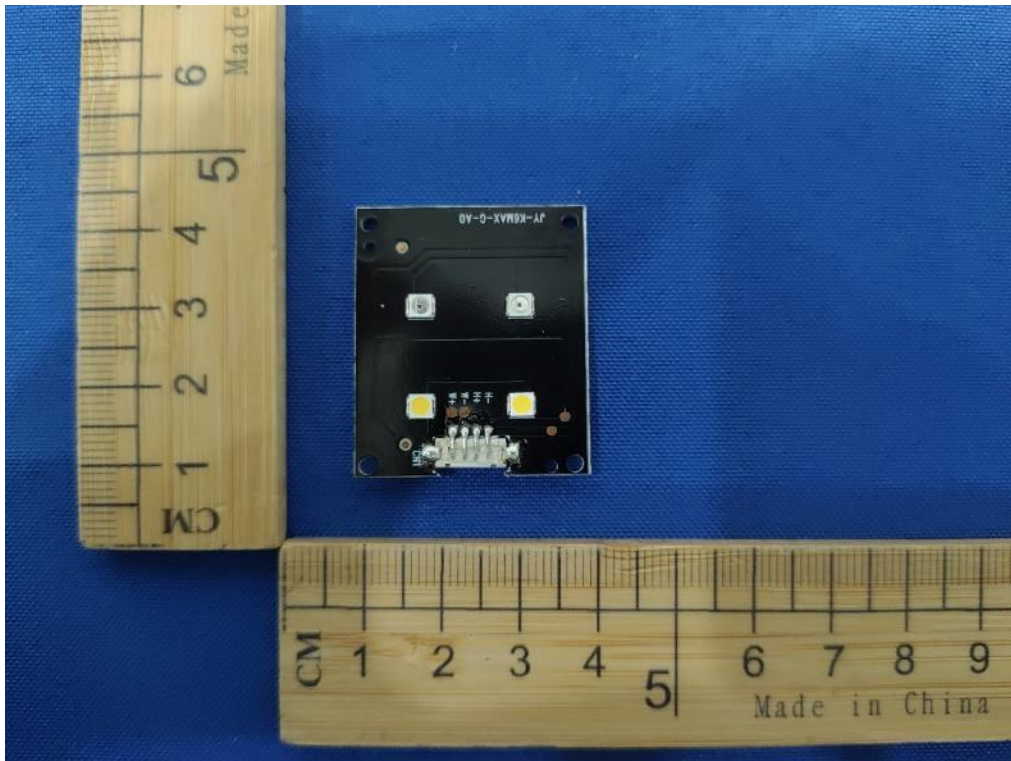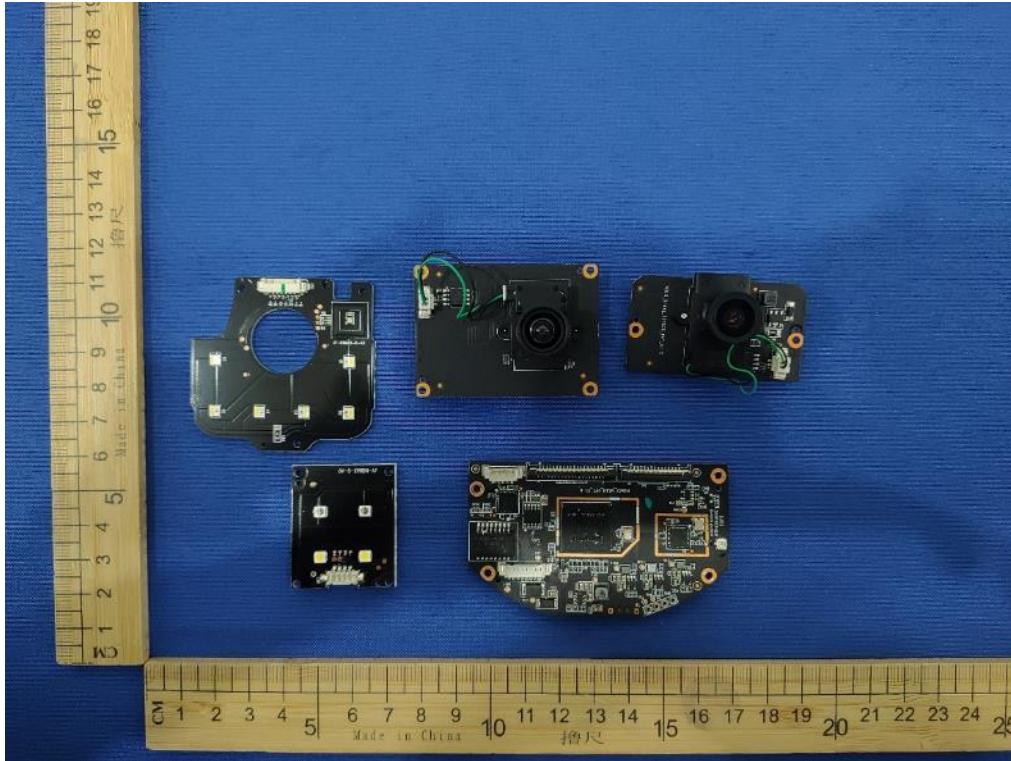


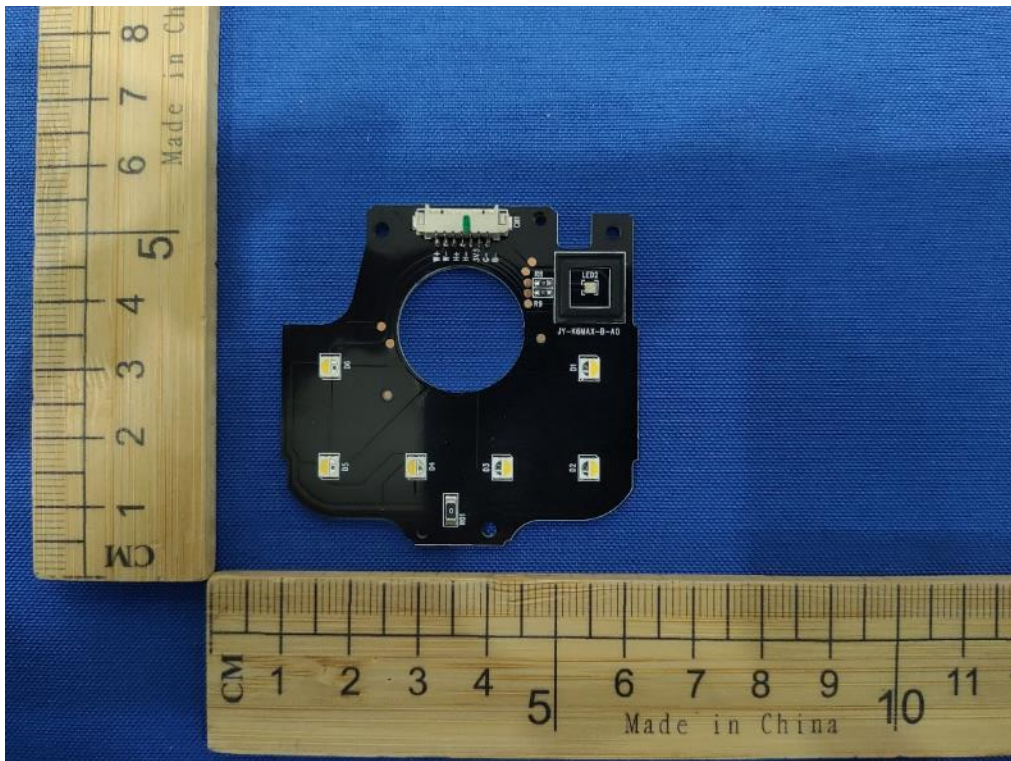
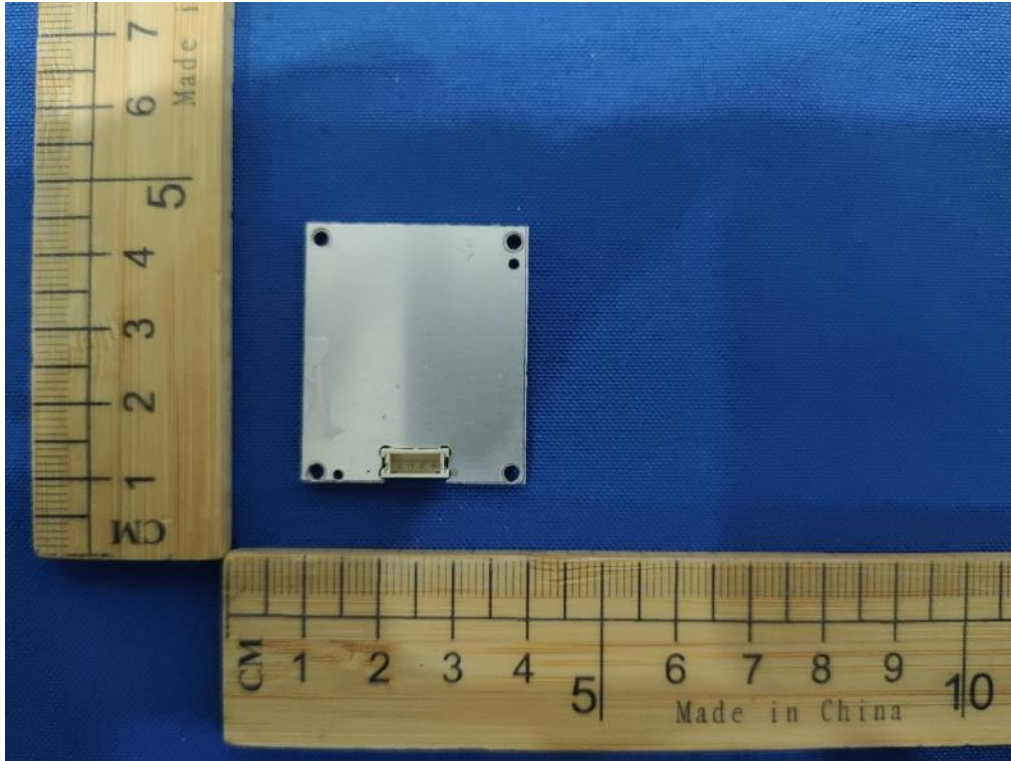


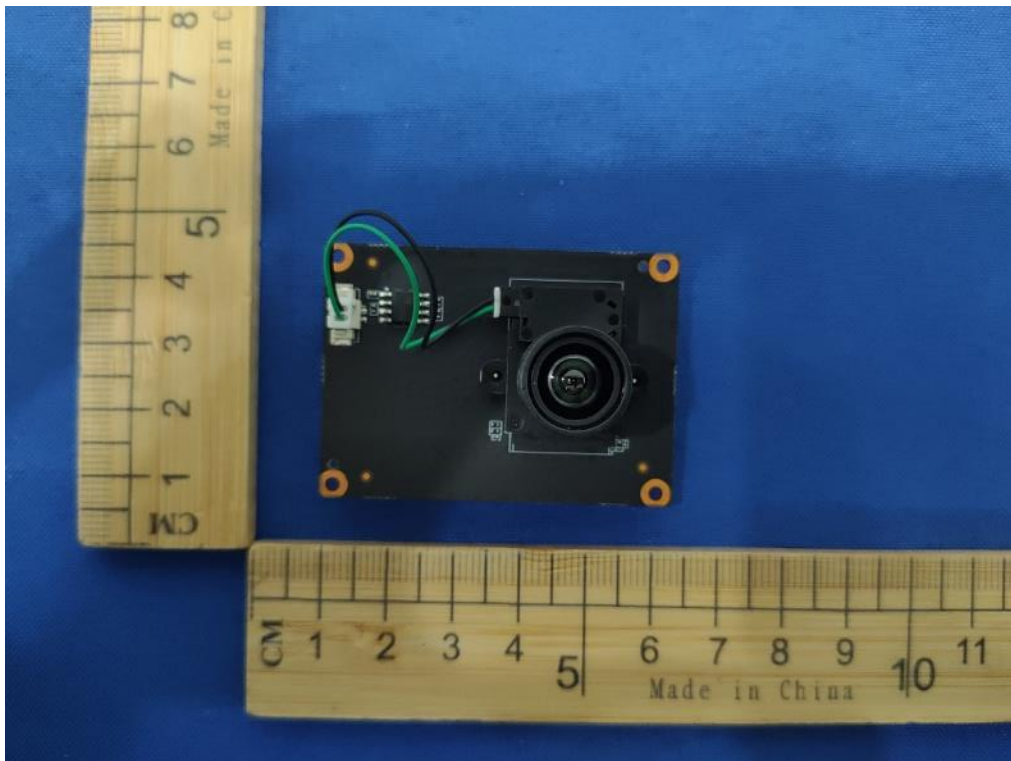
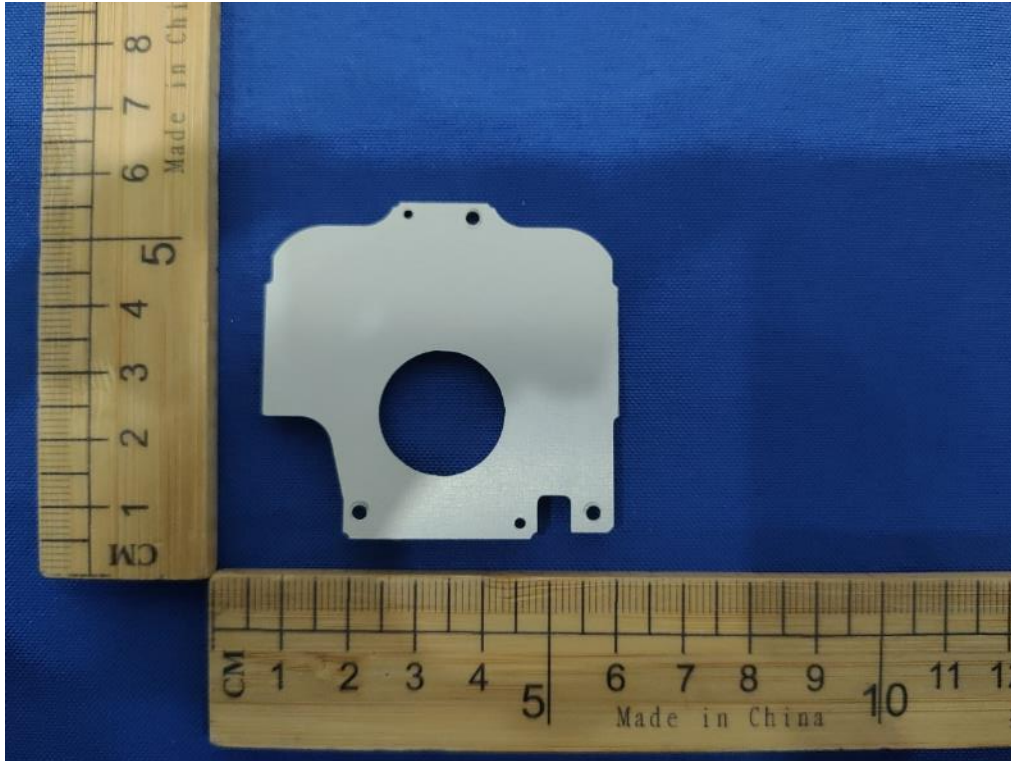


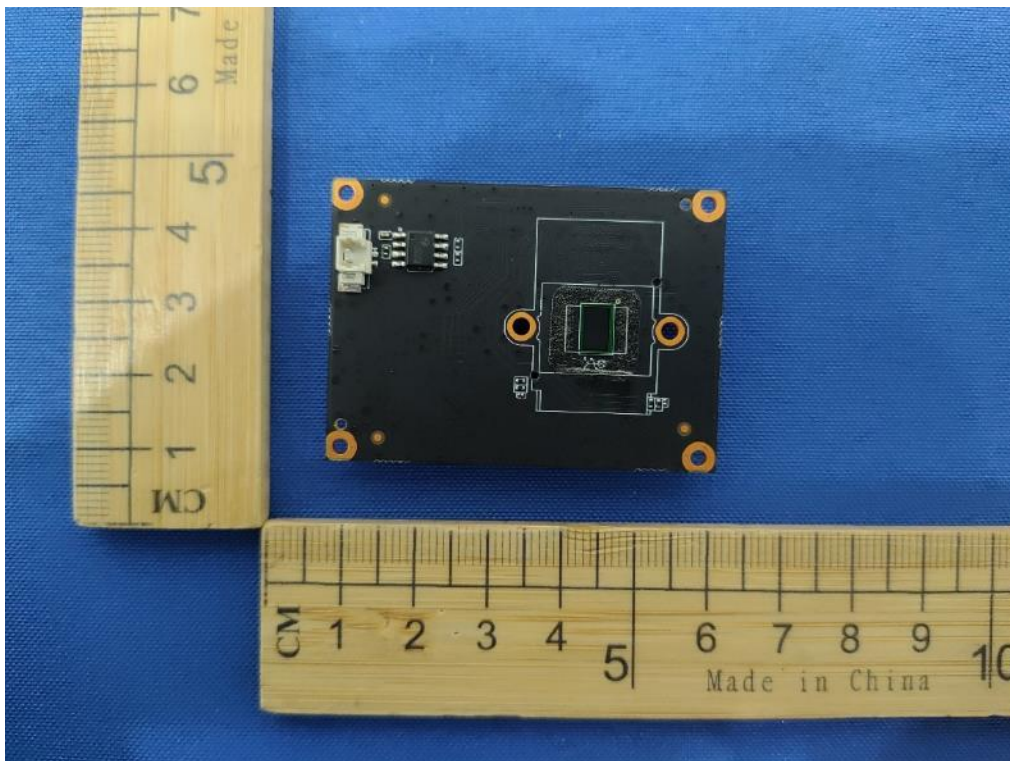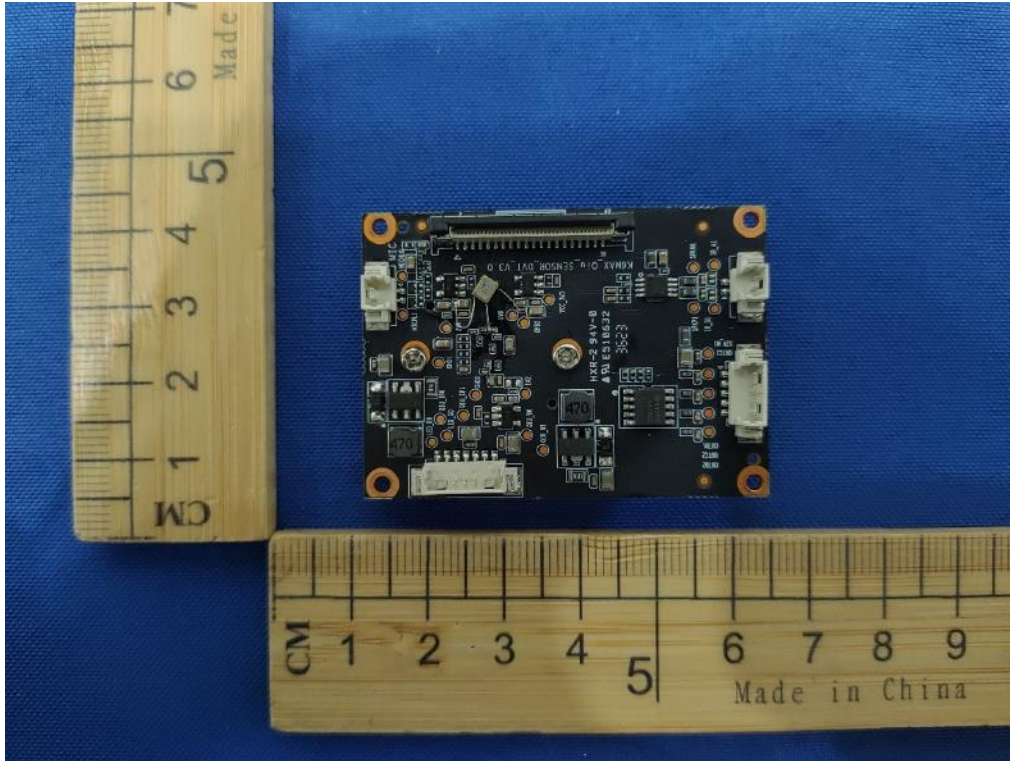


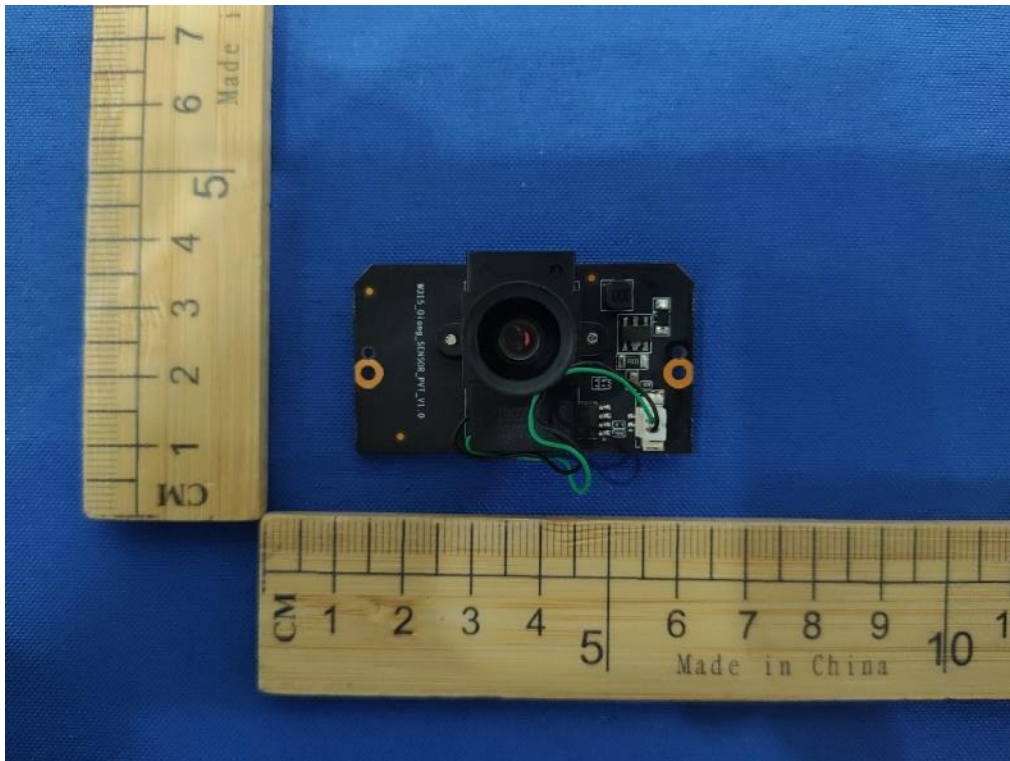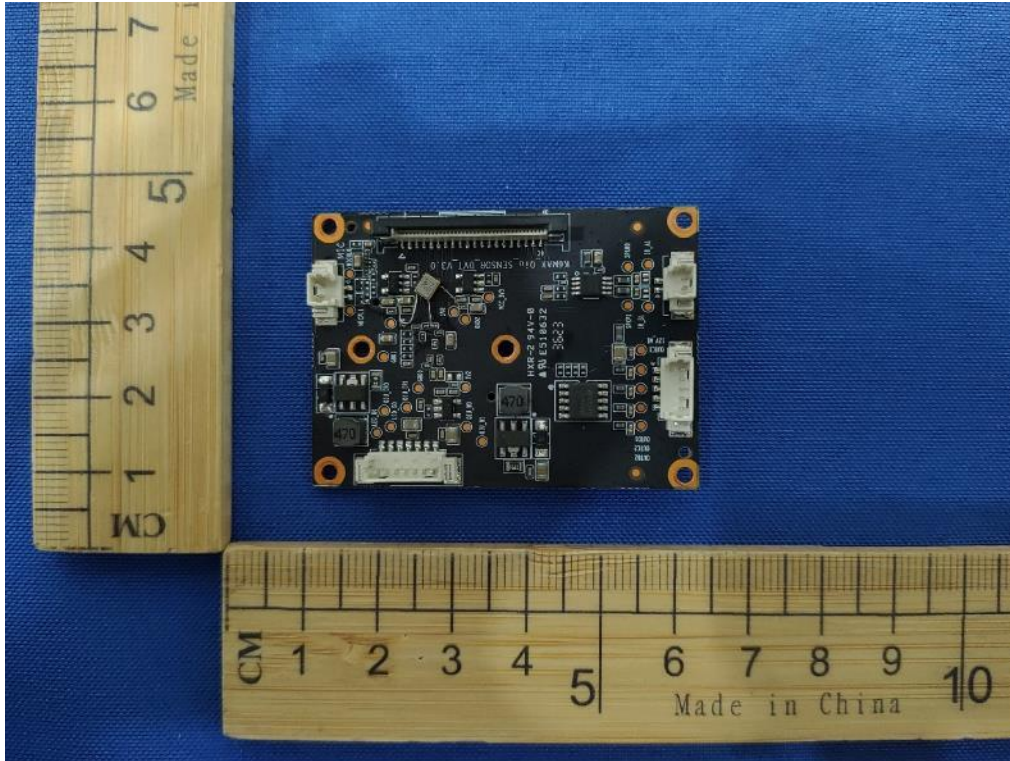

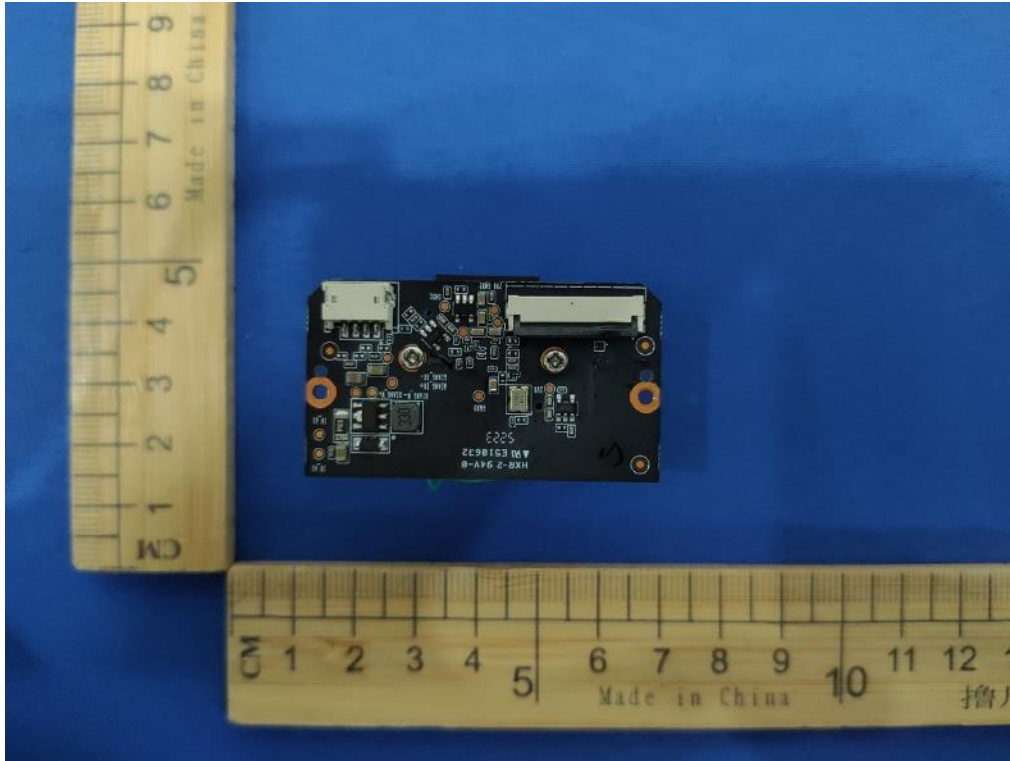

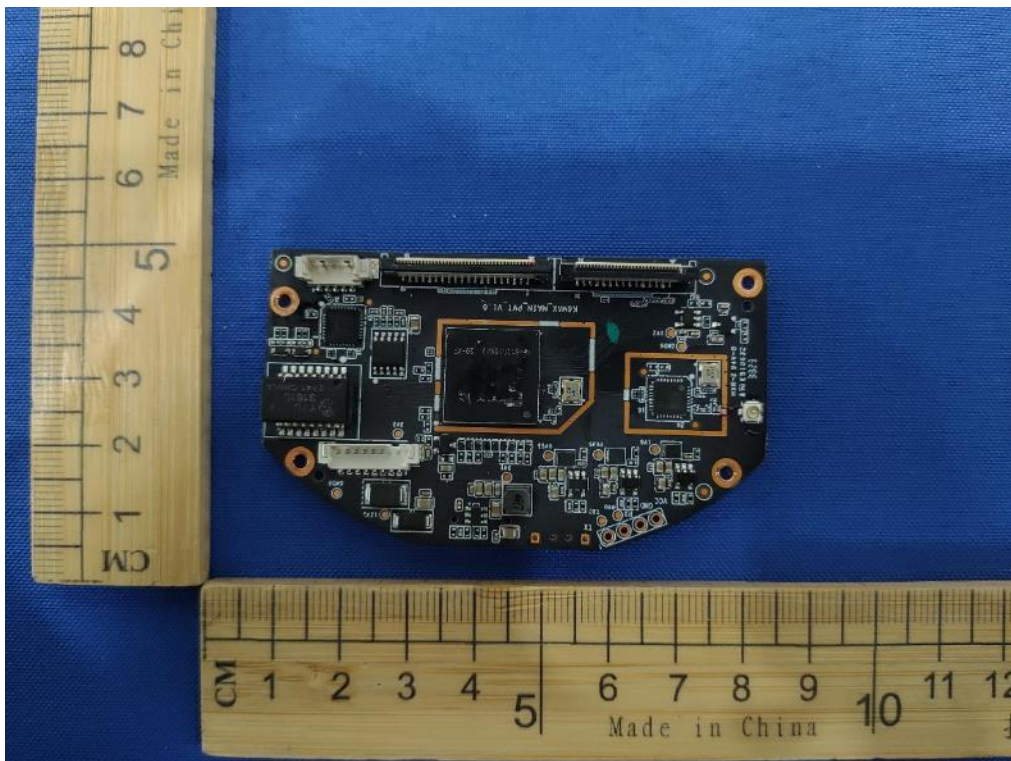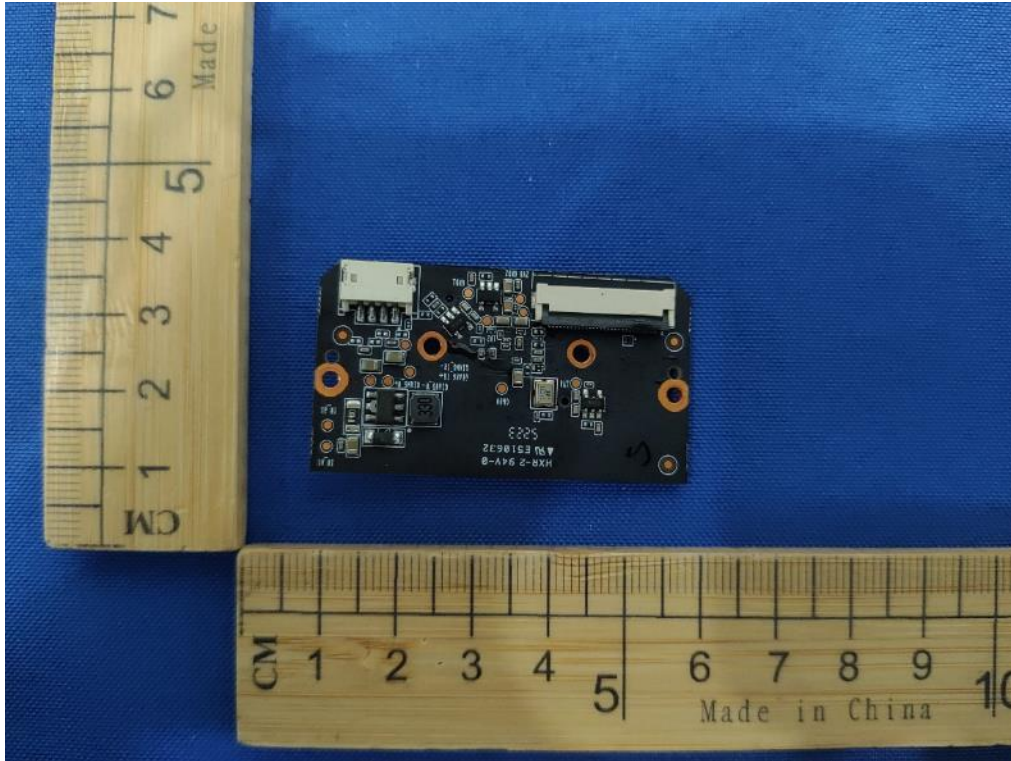

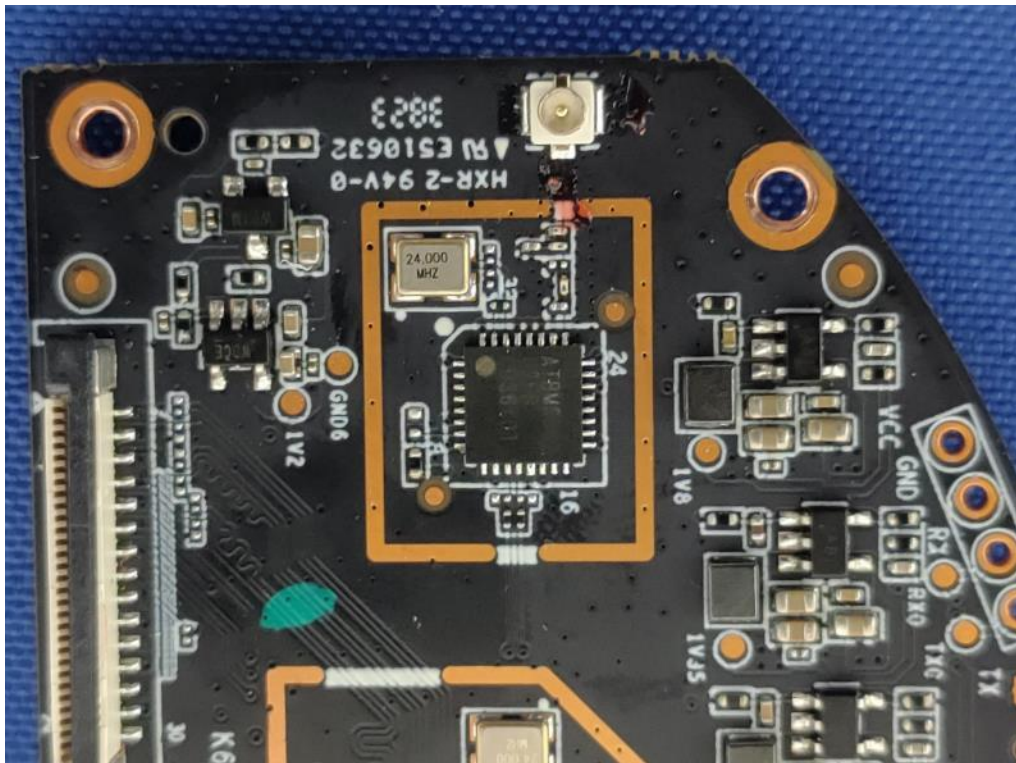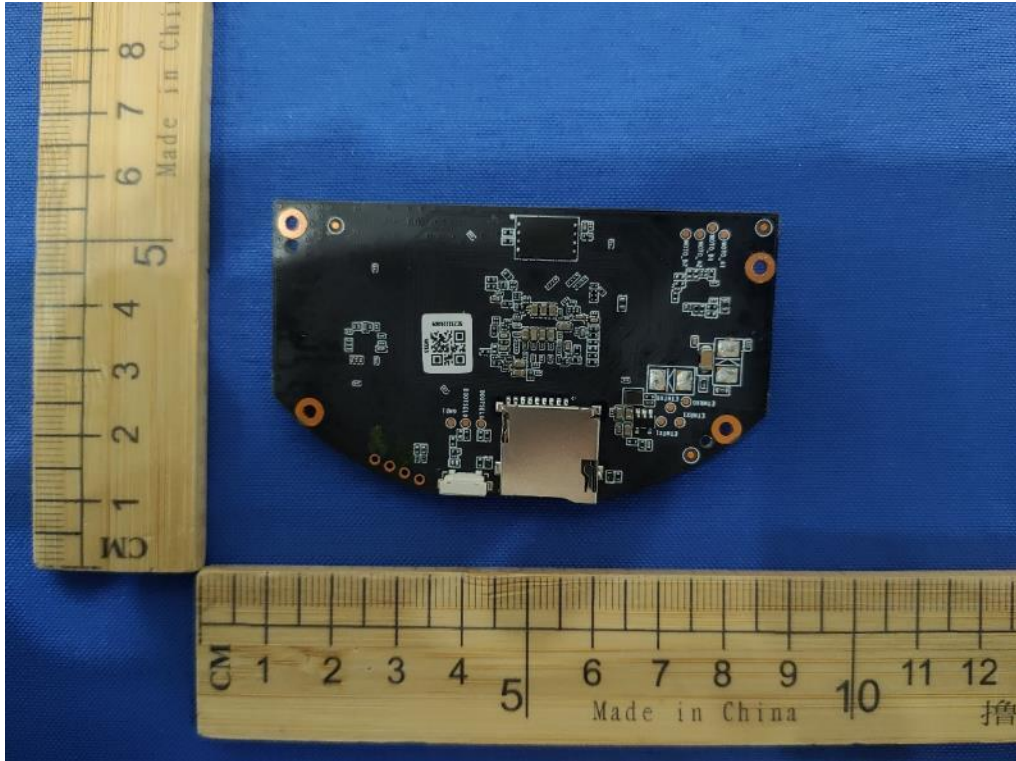

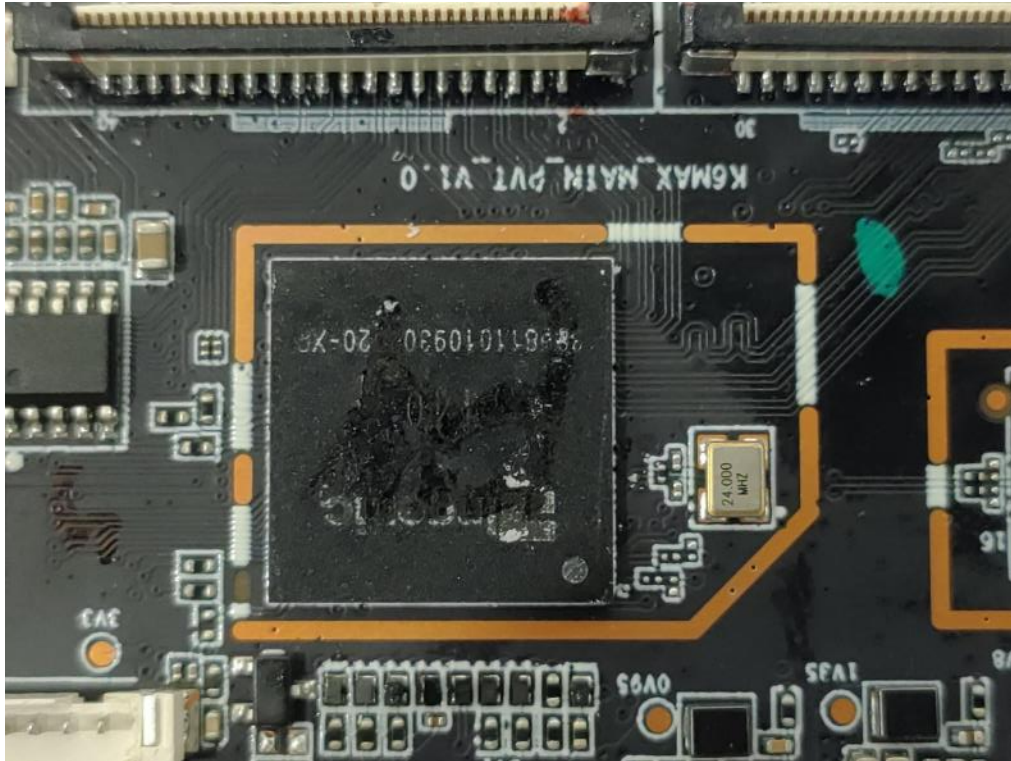

END OF REPORT