



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#7


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 03:04:57

Humidity: 59.0 %

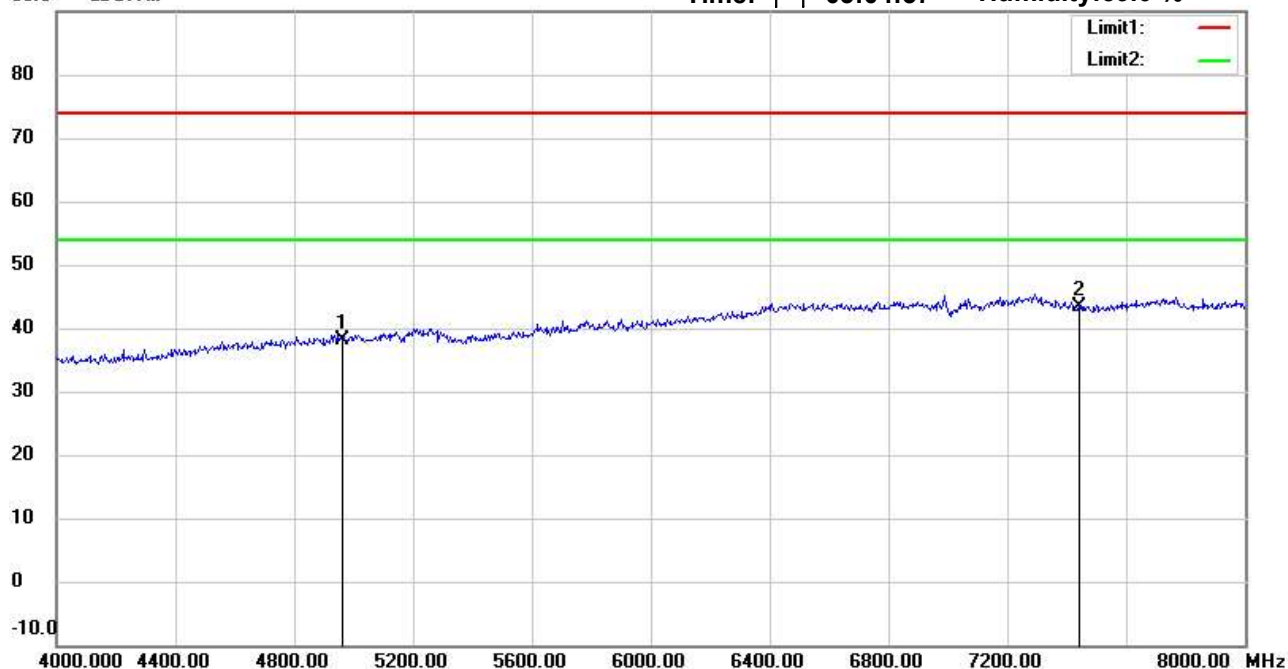

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2480MHz

Note :

Polarization: **Vertical**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	4960.000	32.53	peak	5.53	38.06	74.00	150	14	-35.94	
*	7440.000	31.93	peak	11.41	43.34	74.00	150	323	-30.66	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #3


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 03:02:46

Humidity: 59.0 %

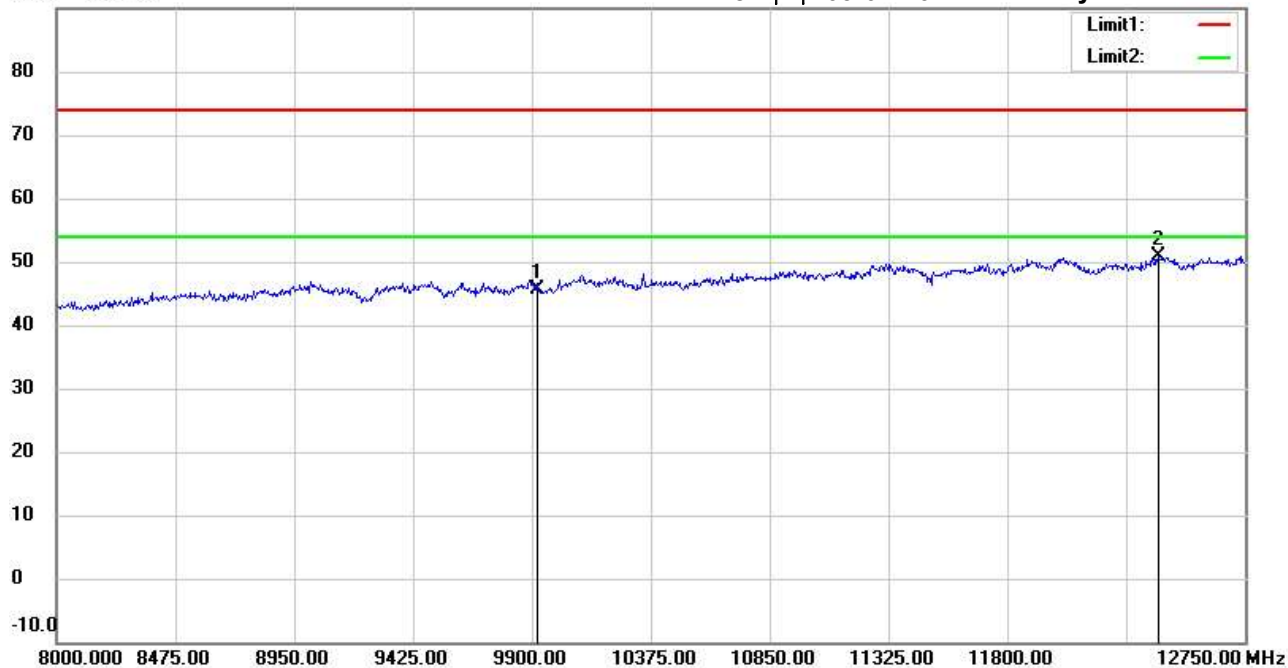

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2480MHz

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	9920.000	31.56	peak	14.00	45.56	74.00	150	254	-28.44	
*	12400.000	33.27	peak	17.55	50.82	74.00	150	140	-23.18	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #8


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 03:05:45

Humidity: 59.0 %

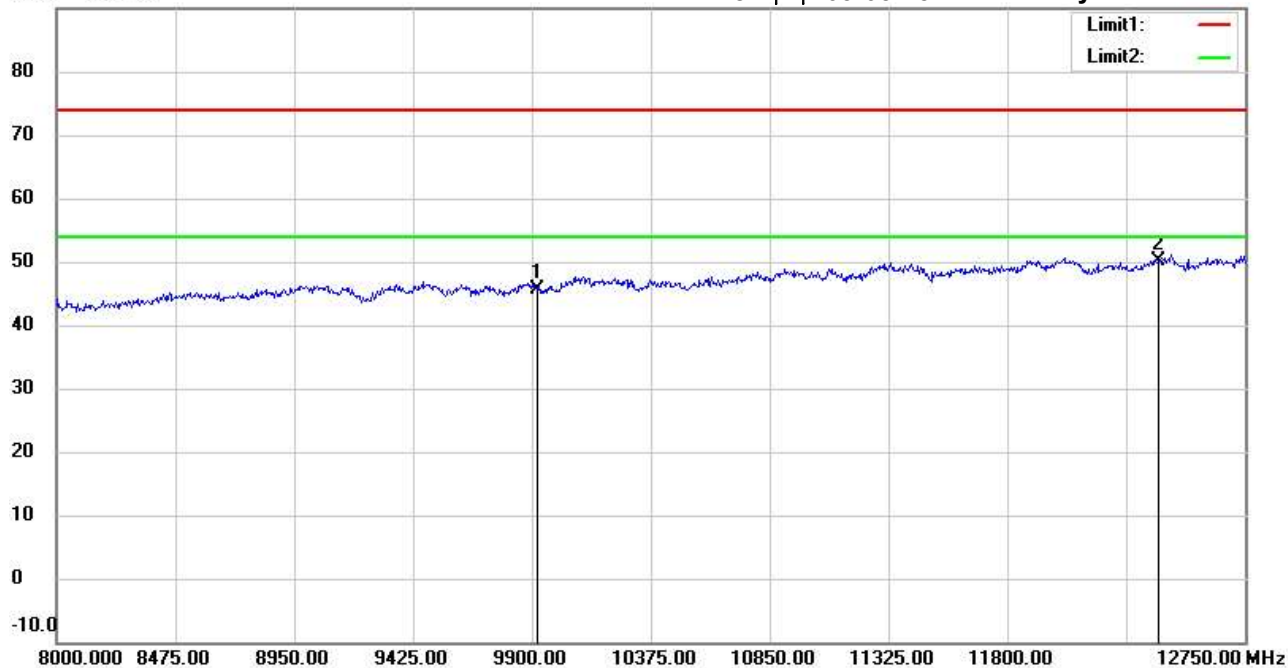

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2480MHz

Note :

Polarization: Vertical

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	9920.000	31.73	peak	14.00	45.73	74.00	150	206	-28.27	
*	12400.000	32.52	peak	17.55	50.07	74.00	150	5	-23.93	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#4


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 03:03:03

Humidity:59.0 %

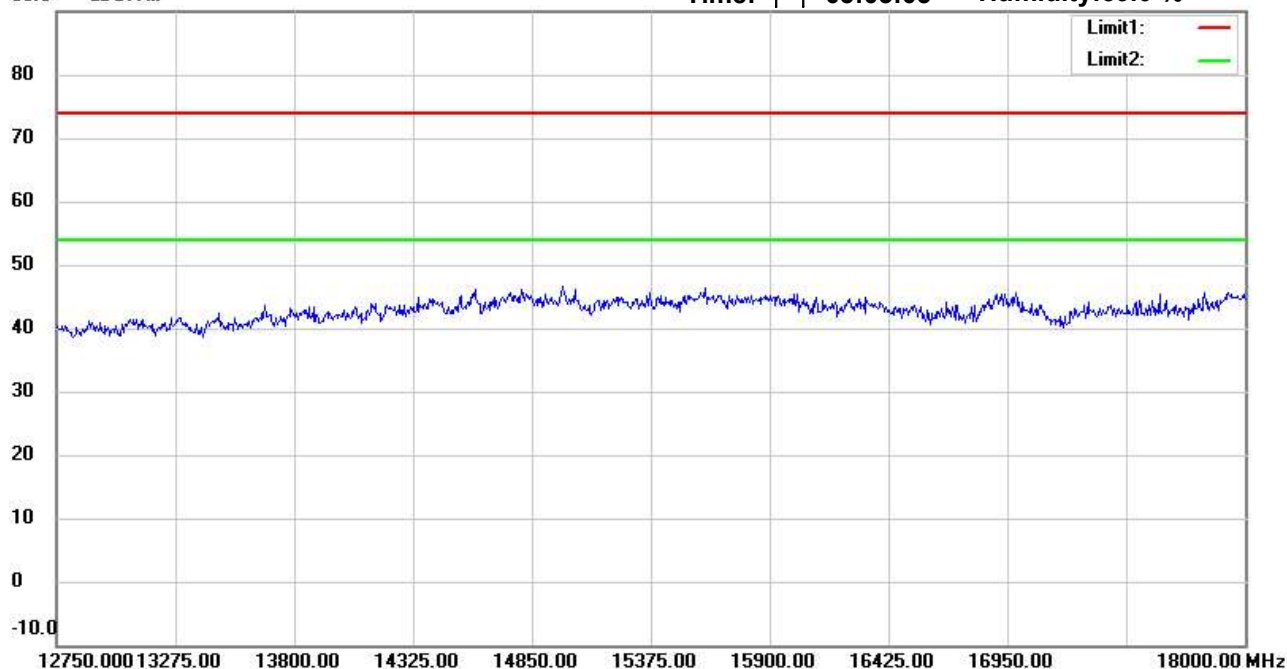

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2480MHz

Note :

Polarization: Horizontal

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#9


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 03:06:02

Humidity:59.0 %

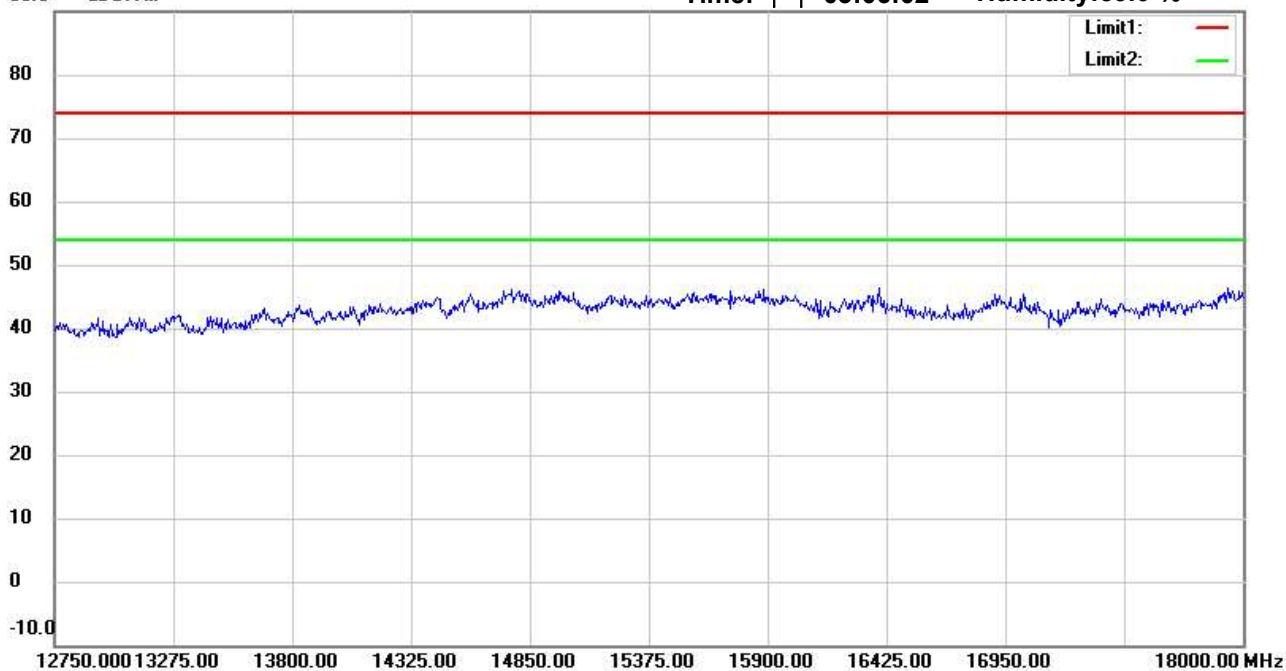

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2480MHz

Note :

Polarization: **Vertical**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#5


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 03:03:14

Humidity:59.0 %

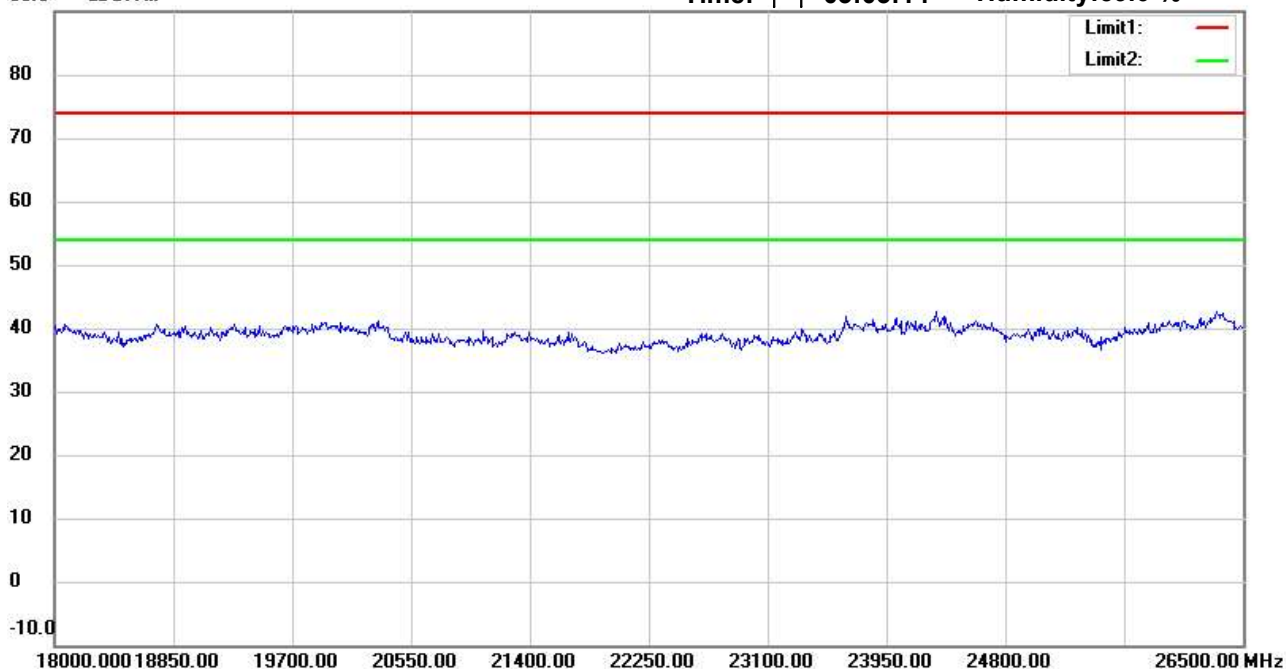

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2480MHz

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#10


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 03:06:13

Humidity:59.0 %

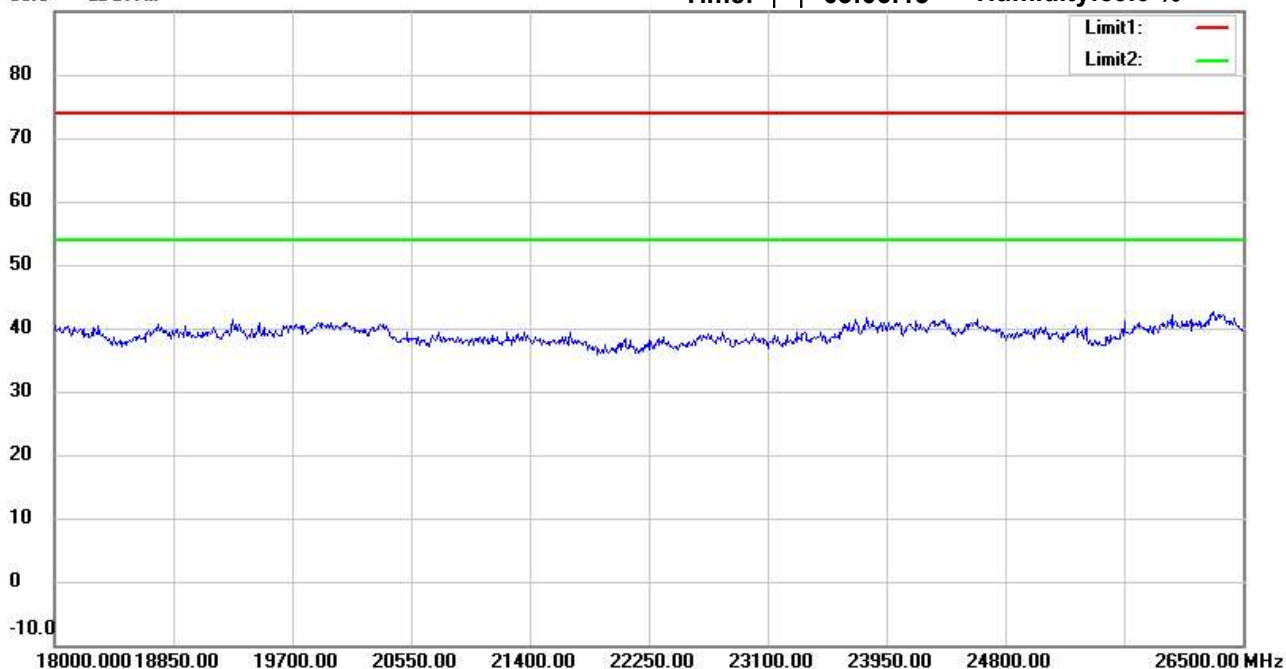

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2480MHz

Note :

Polarization: **Vertical**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Radiated Emission Measurement

Operator: Kai

File : 1_BLE(1M)_TX 2402MHz Data : #1


Date: 2023/11/29

Temperature: 23.4 °C

80.0 dBuV/m

Time: 下午 05:29:44

Humidity: 59.0 %

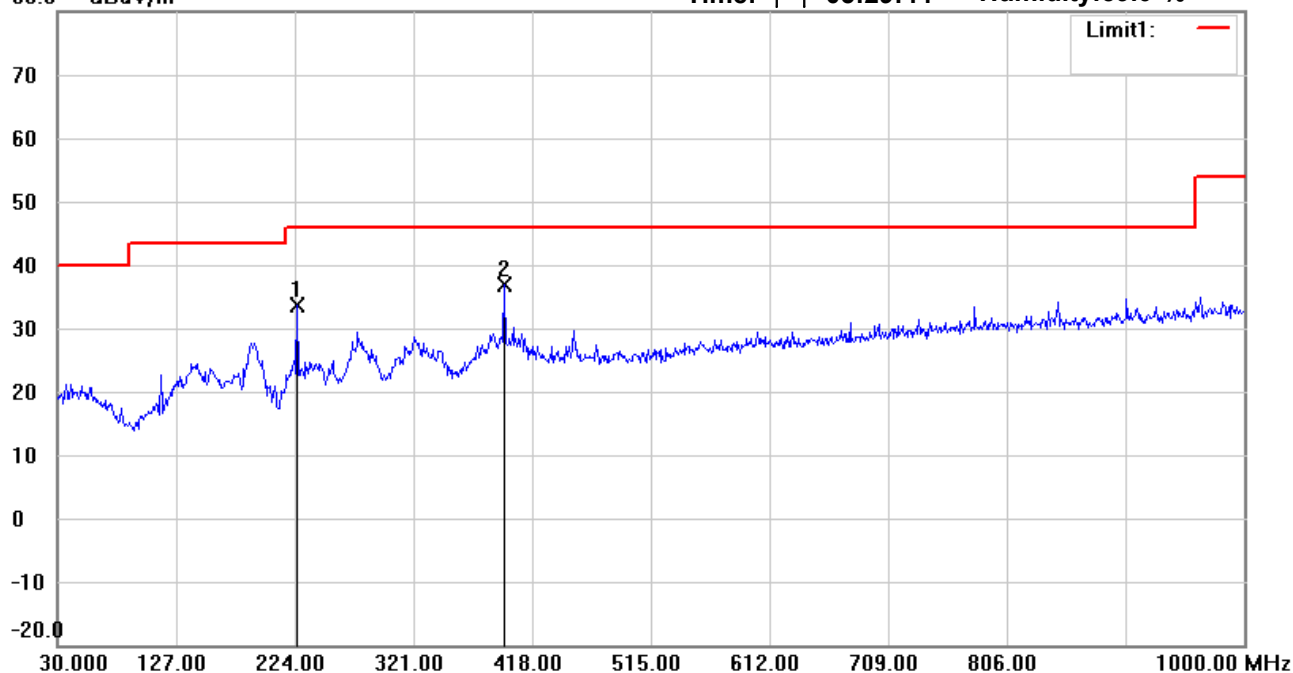

Site : Chamber

Condition : FCC_part 15 RE-Class C_30-1000MHz

Polarization: *Horizontal*

EUT : W6M22311-23090

Power : 120 Va.c.

M/N:

Distance: 3m

Test Mode : TX 2402MHz

Note :

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	225.9400	47.68	peak	-14.13	33.55	46.00	100	358	-12.45	
*	395.2050	45.64	peak	-8.85	36.79	46.00	100	337	-9.21	



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, NeiHu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 1_BLE(1M)_TX 2402MHz Data : #2


Date: 2023/11/29

Temperature: 23.4 °C

80.0 dBuV/m

Time: 下午 05:30:34

Humidity: 59.0 %

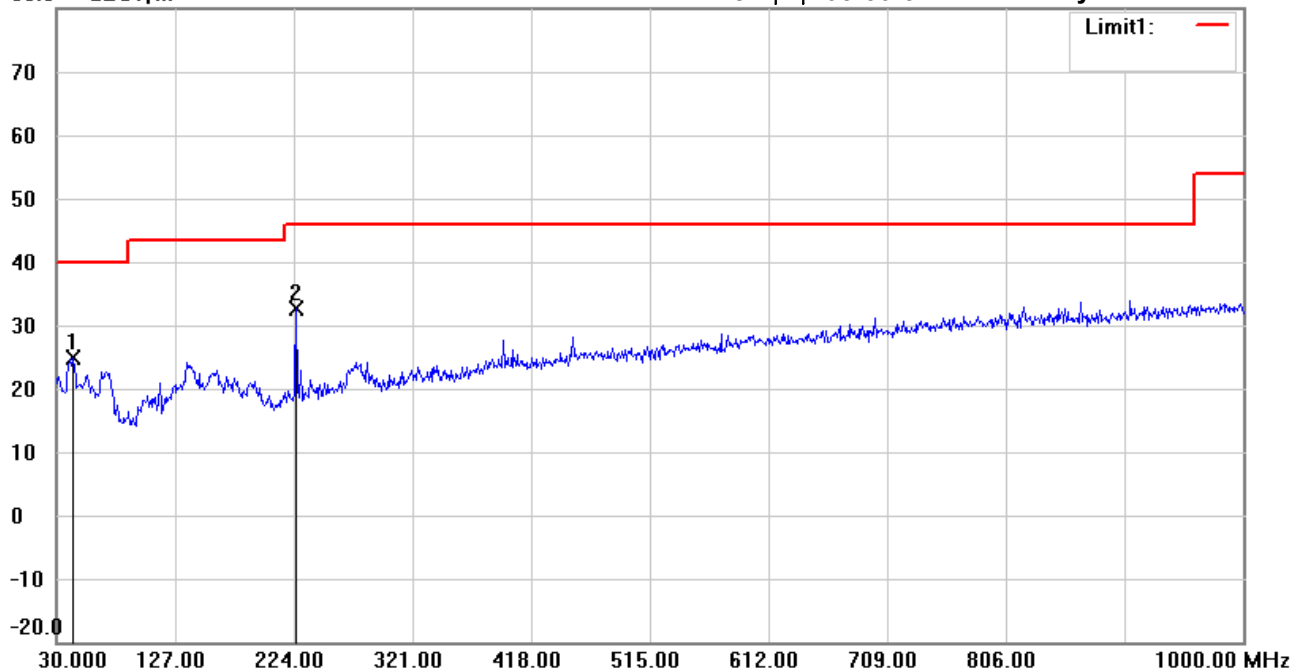

Site : Chamber

Condition : FCC_part 15 RE-Class C_30-1000MHz

Polarization: Vertical

EUT : W6M22311-23090

Power : 120 Va.c.

M/N:

Distance: 3m

Test Mode : TX 2402MHz

Note :

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	43.5800	37.26	peak	-12.44	24.82	40.00	100	339	-15.18	
*	225.9400	46.85	peak	-14.13	32.72	46.00	100	37	-13.28	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#1


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 03:09:55

Humidity:59.0 %

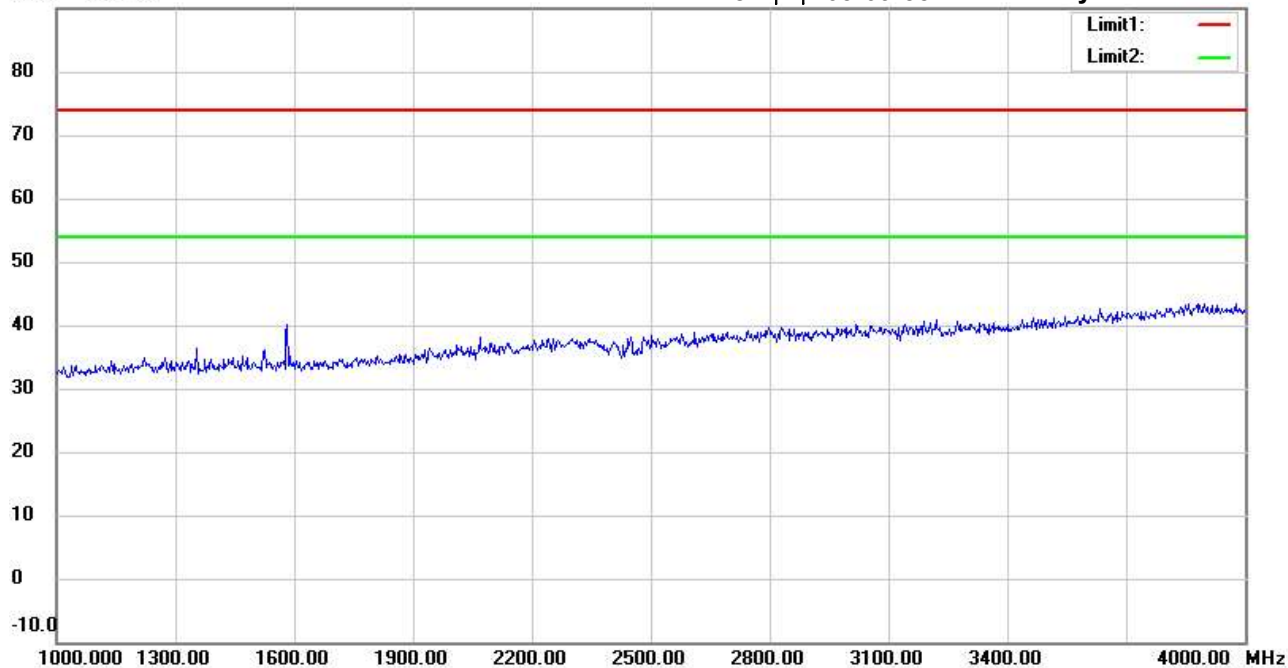

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2402MHz

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#6


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 03:13:00

Humidity:59.0 %

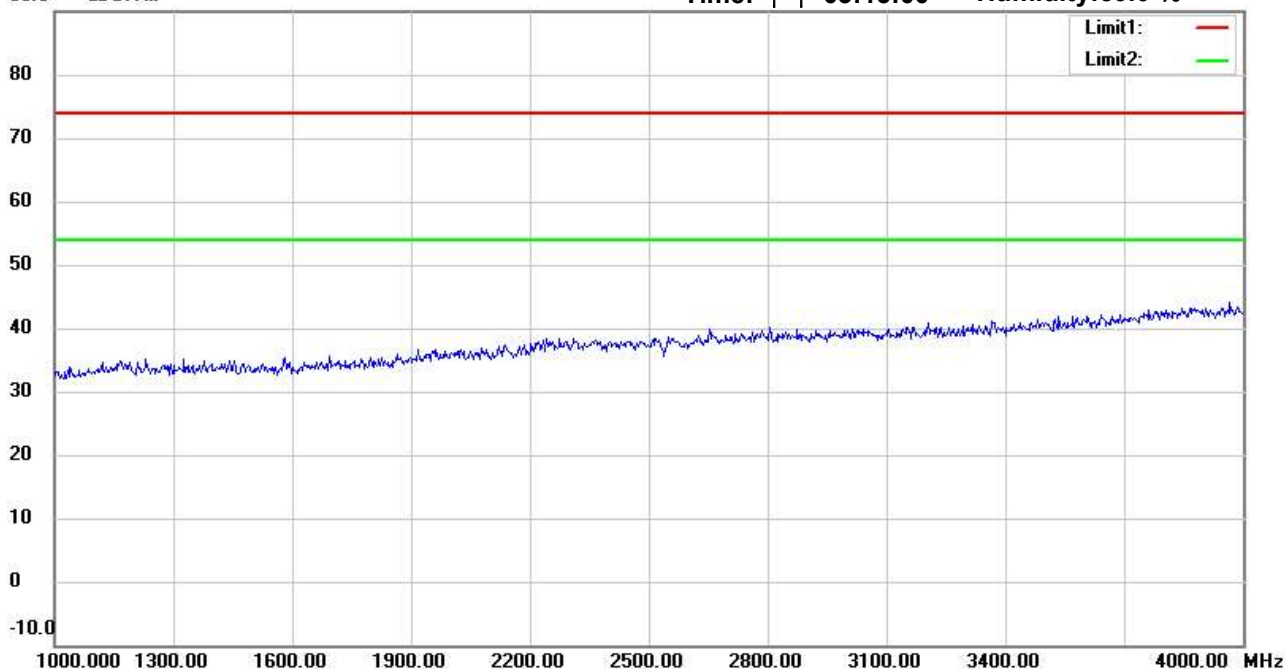

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2402MHz

Note :

Polarization: **Vertical**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#2


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 03:10:44

Humidity: 59.0 %

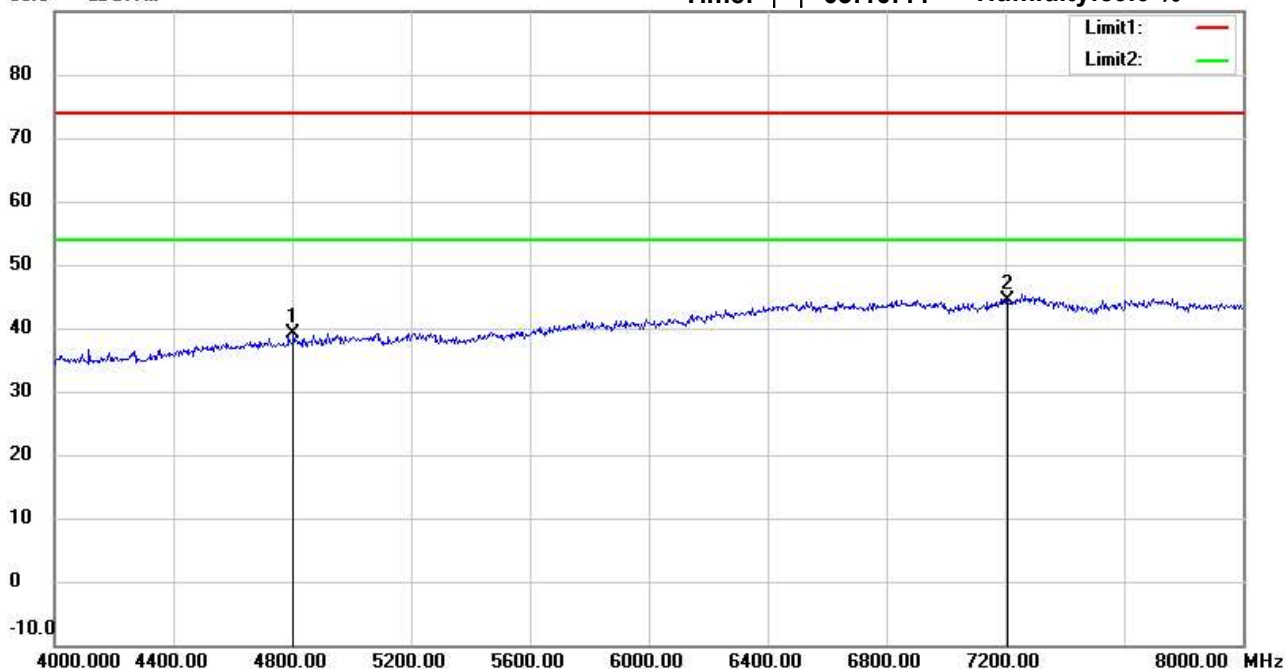

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2402MHz

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	4804.000	34.02	peak	5.03	39.05	74.00	150	36	-34.95	
*	7206.000	32.90	peak	11.38	44.28	74.00	150	210	-29.72	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#7


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 03:13:50

Humidity:59.0 %

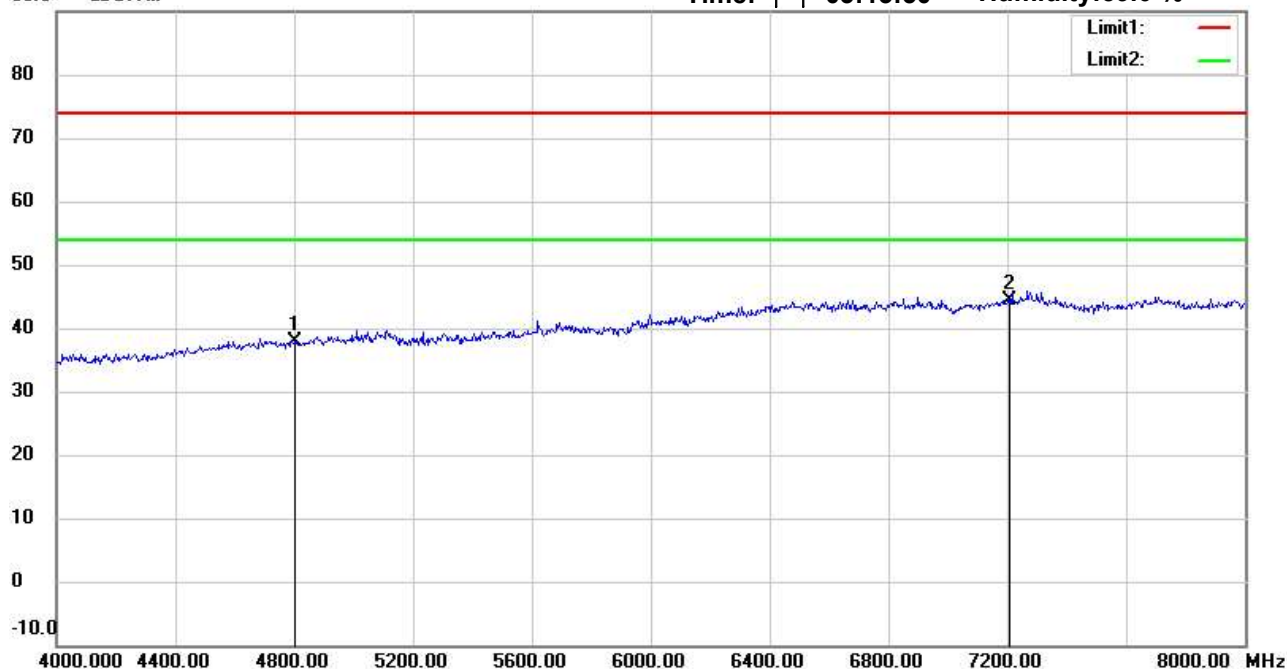

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2402MHz

Note :

Polarization: **Vertical**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	4804.000	32.82	peak	5.03	37.85	74.00	150	10	-36.15	
*	7206.000	33.07	peak	11.38	44.45	74.00	150	119	-29.55	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #3


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 03:11:40

Humidity: 59.0 %

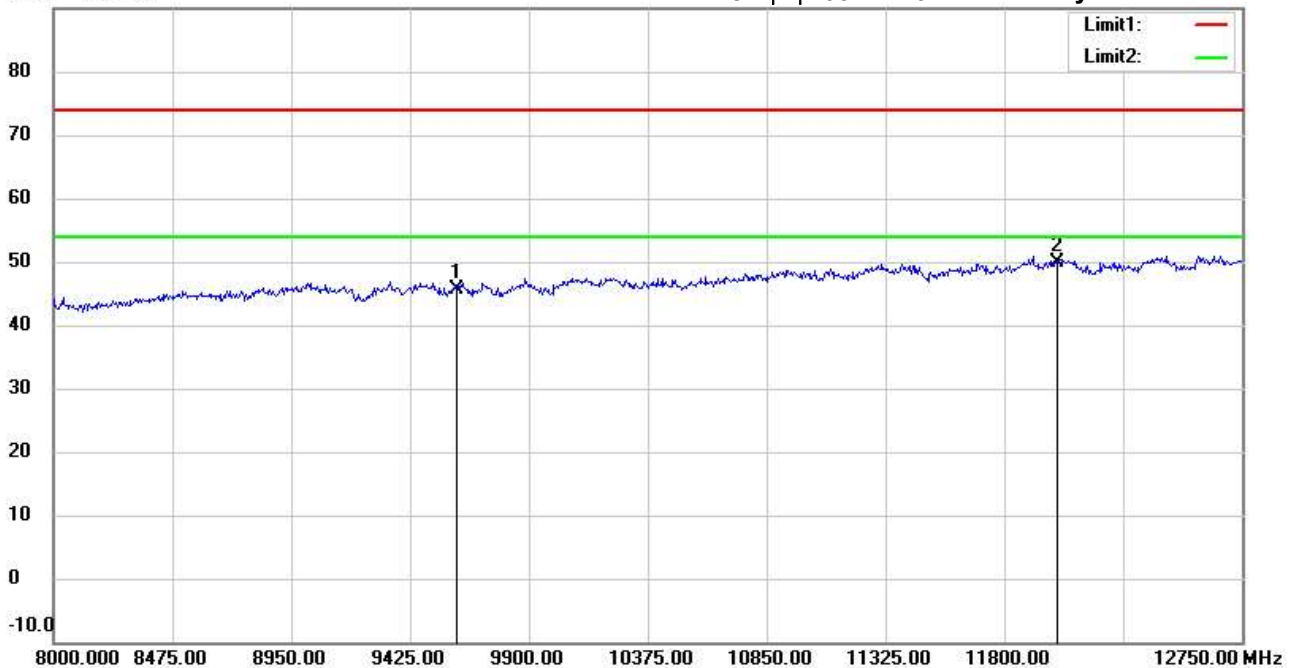

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2402MHz

Note :

Polarization: **Horizontal**

Power : 120 V.a.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	9608.000	32.12	peak	13.39	45.51	74.00	150	284	-28.49	
*	12010.000	32.51	peak	17.28	49.79	74.00	150	5	-24.21	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #8


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 03:14:38

Humidity: 59.0 %

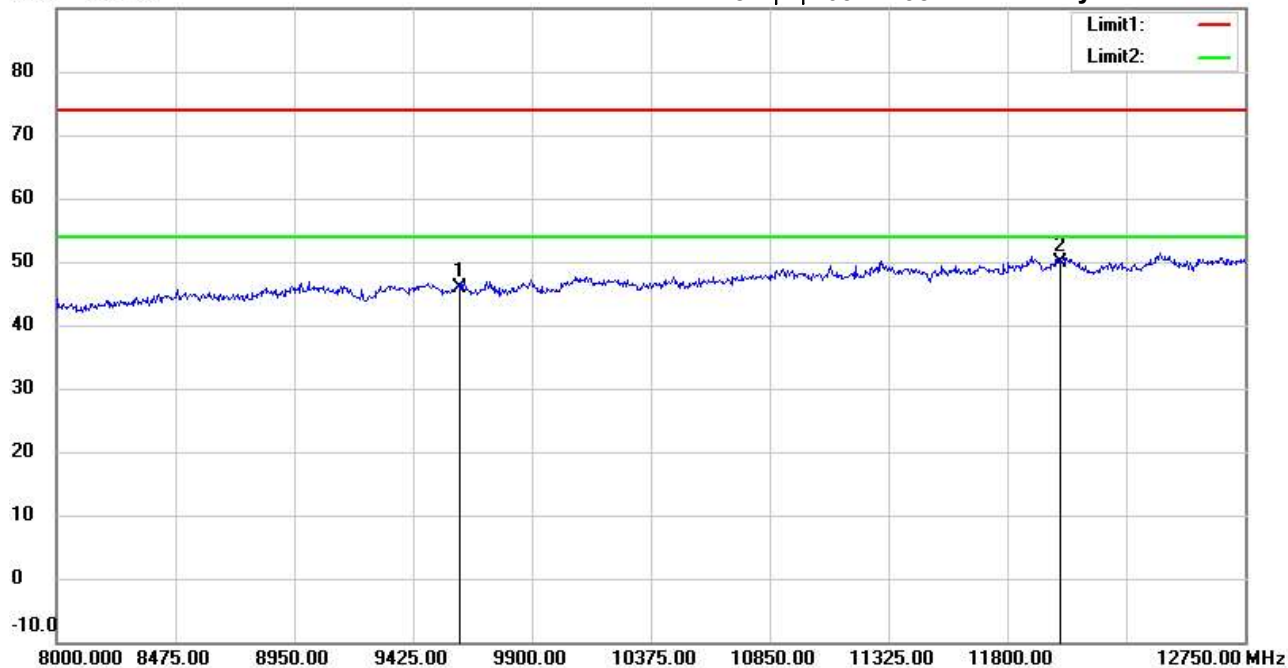

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2402MHz

Note :

Polarization: Vertical

Power : 120 V.a.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	9608.000	32.49	peak	13.39	45.88	74.00	150	222	-28.12	
*	12010.000	32.61	peak	17.28	49.89	74.00	150	5	-24.11	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#4


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 03:11:57

Humidity:59.0 %

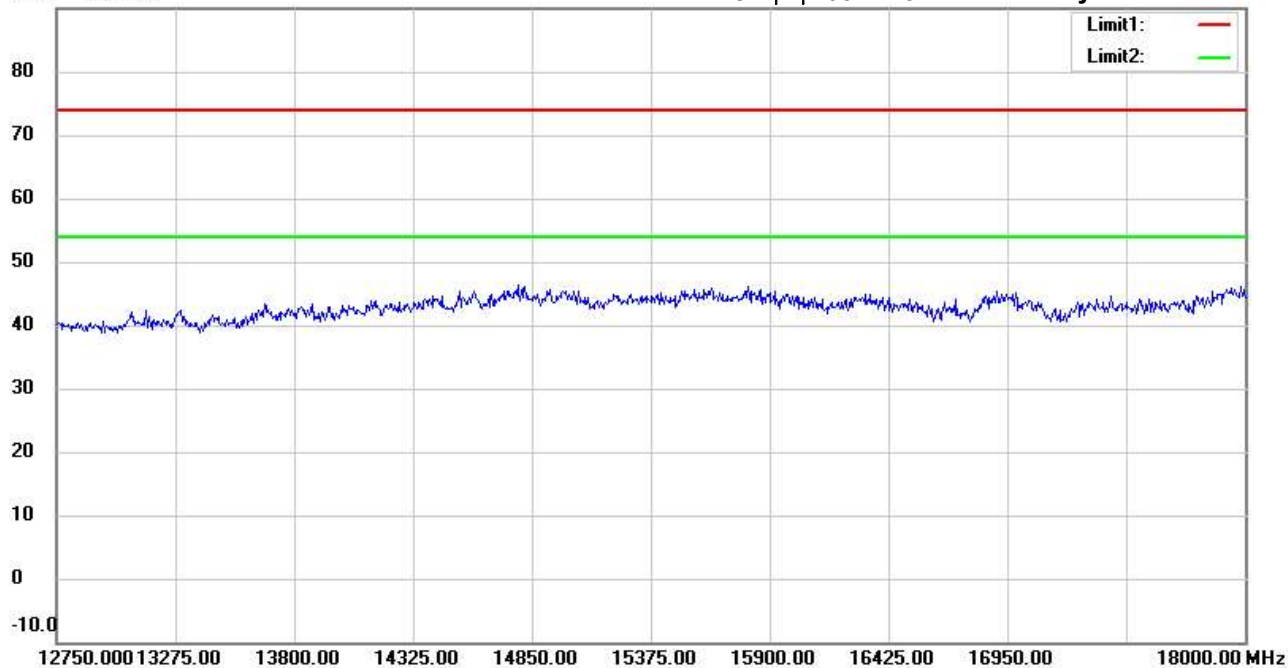

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2402MHz

Note :

Polarization: Horizontal

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #9


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 03:14:56

Humidity: 59.0 %

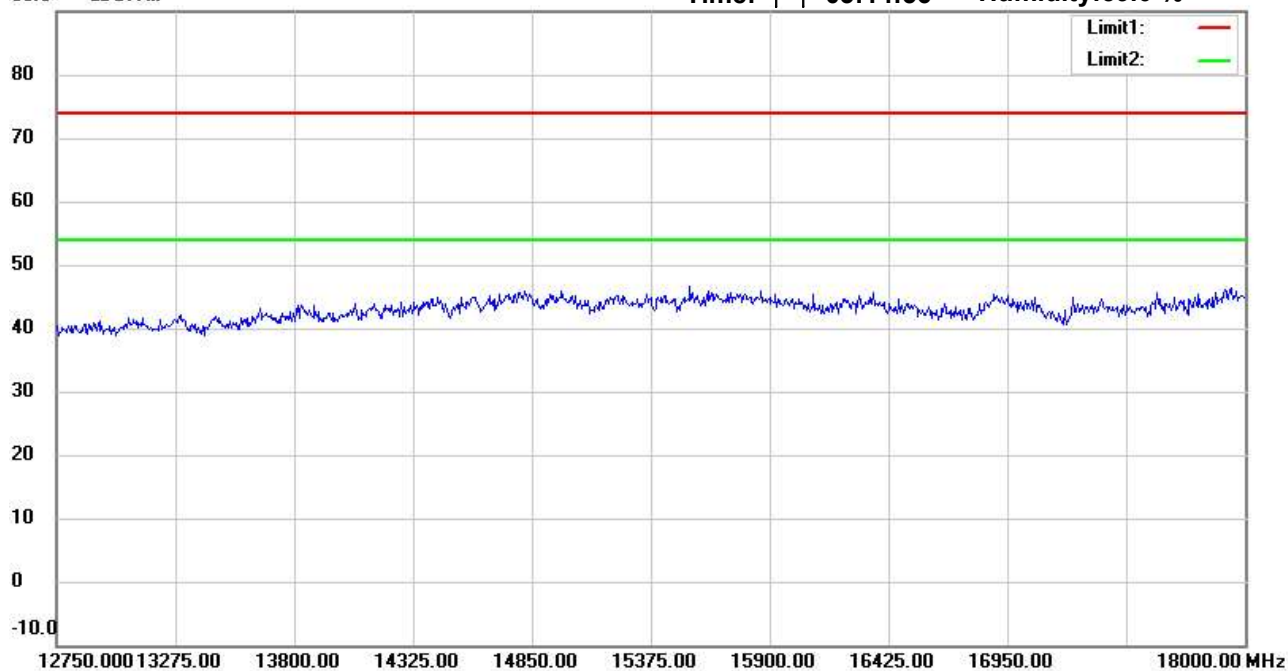

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2402MHz

Note :

Polarization: Vertical

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #5


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 03:12:08

Humidity: 59.0 %

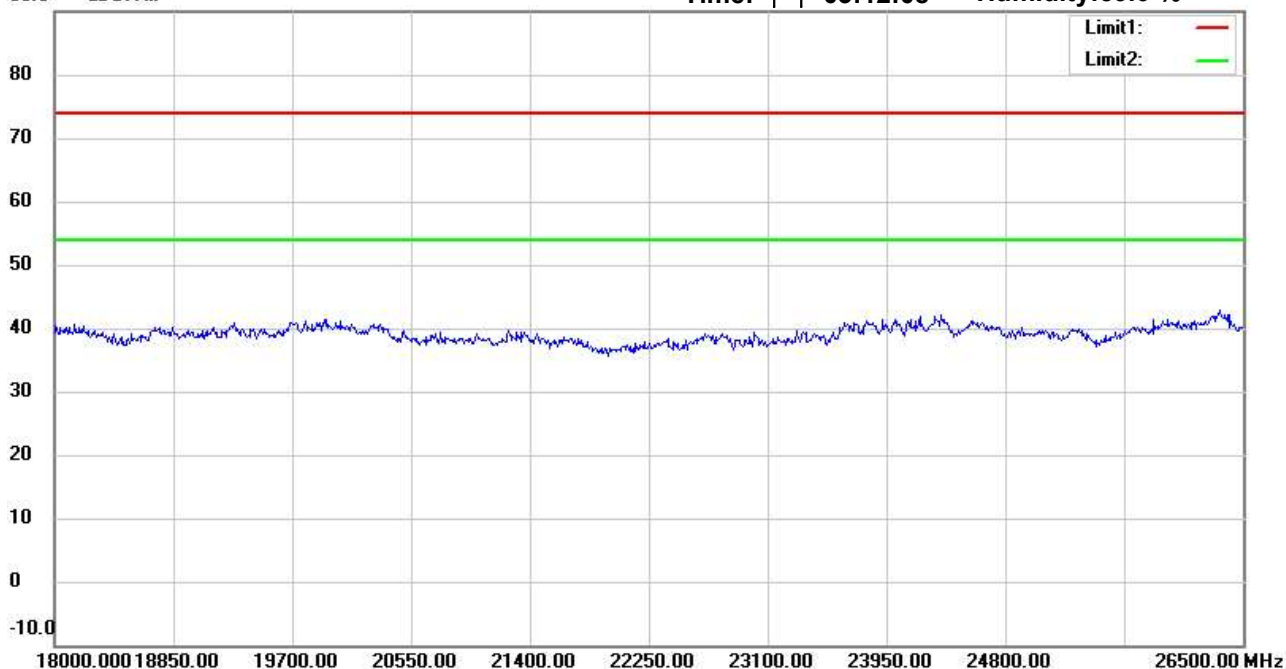

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2402MHz

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#10


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 03:15:06

Humidity:59.0 %

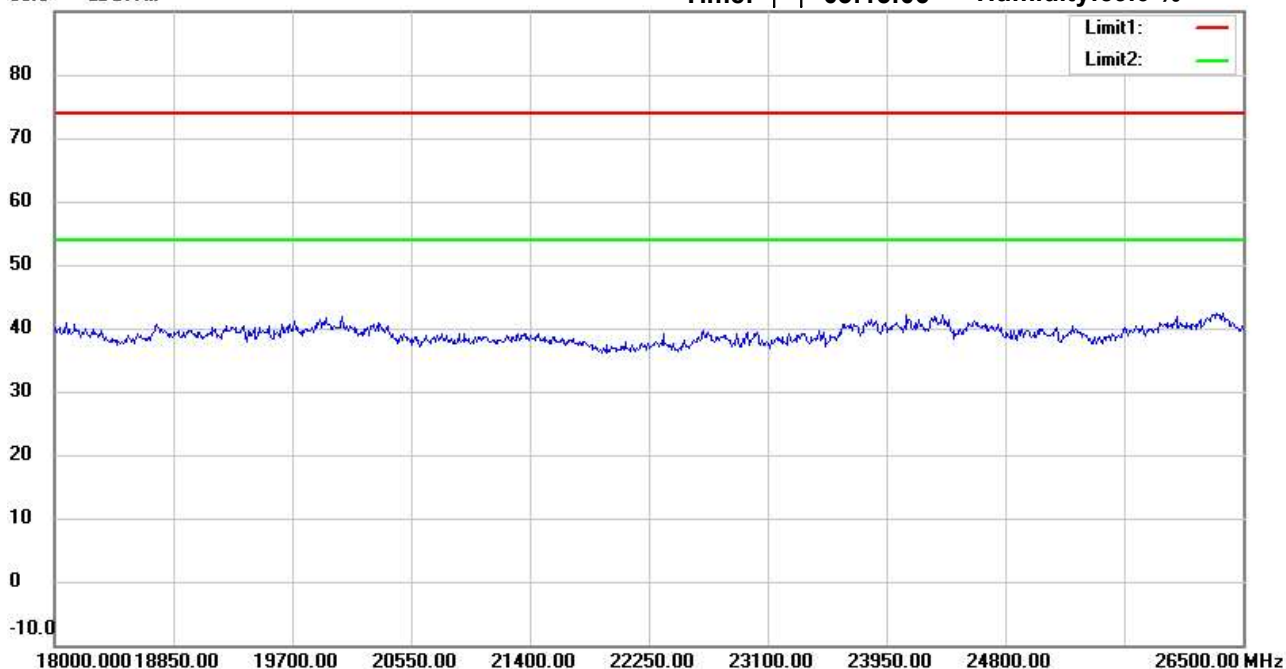

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2402MHz

Note :

Polarization: Vertical

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#1


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 03:18:40

Humidity:59.0 %

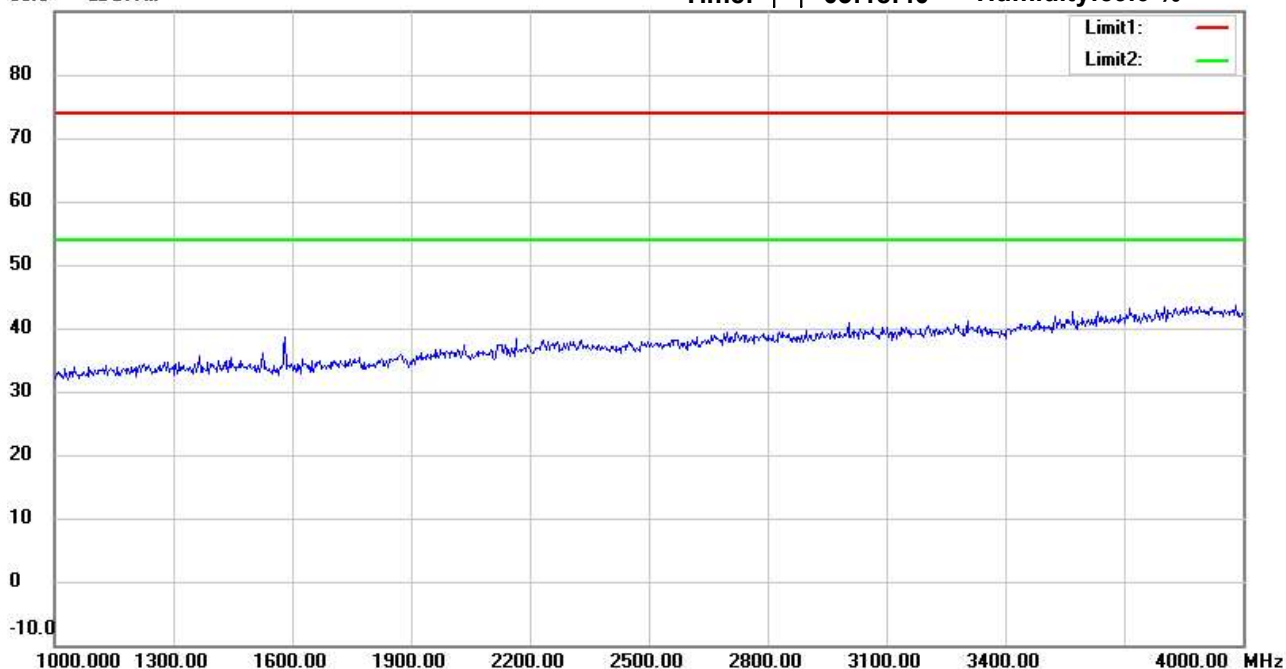

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2440MHz

Note :

Polarization: *Horizontal*

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#6


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 03:21:45

Humidity:59.0 %

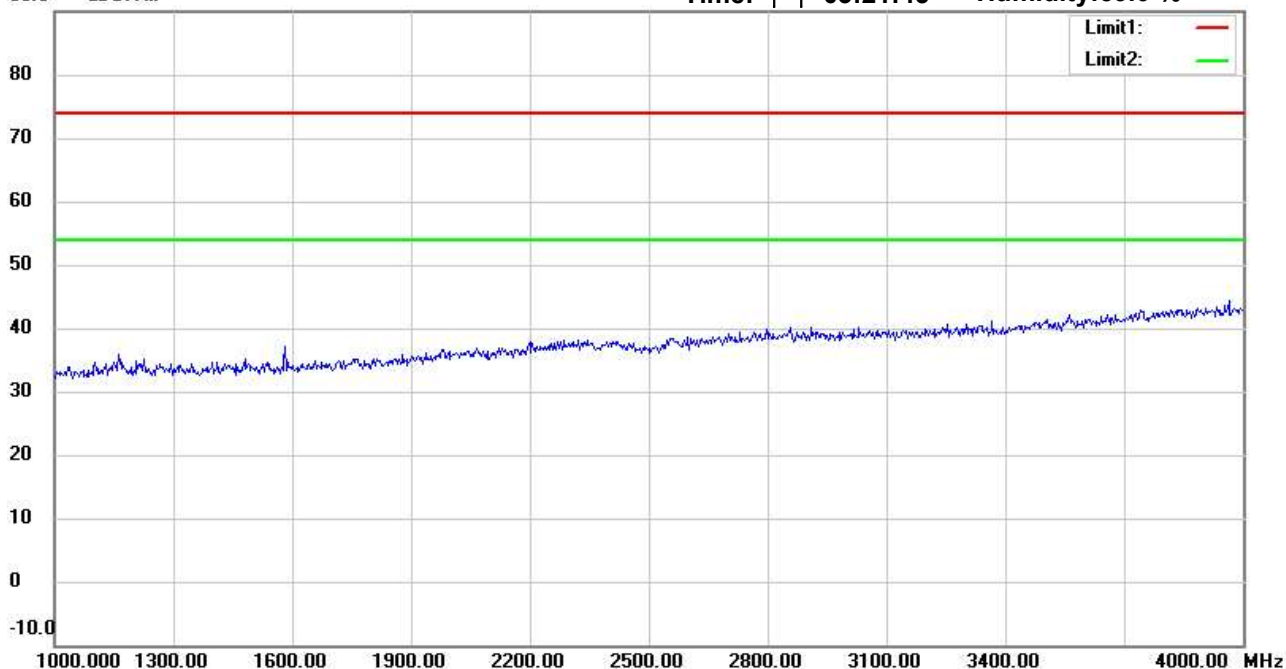

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2440MHz

Note :

Polarization: **Vertical**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #2


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 03:19:29

Humidity: 59.0 %

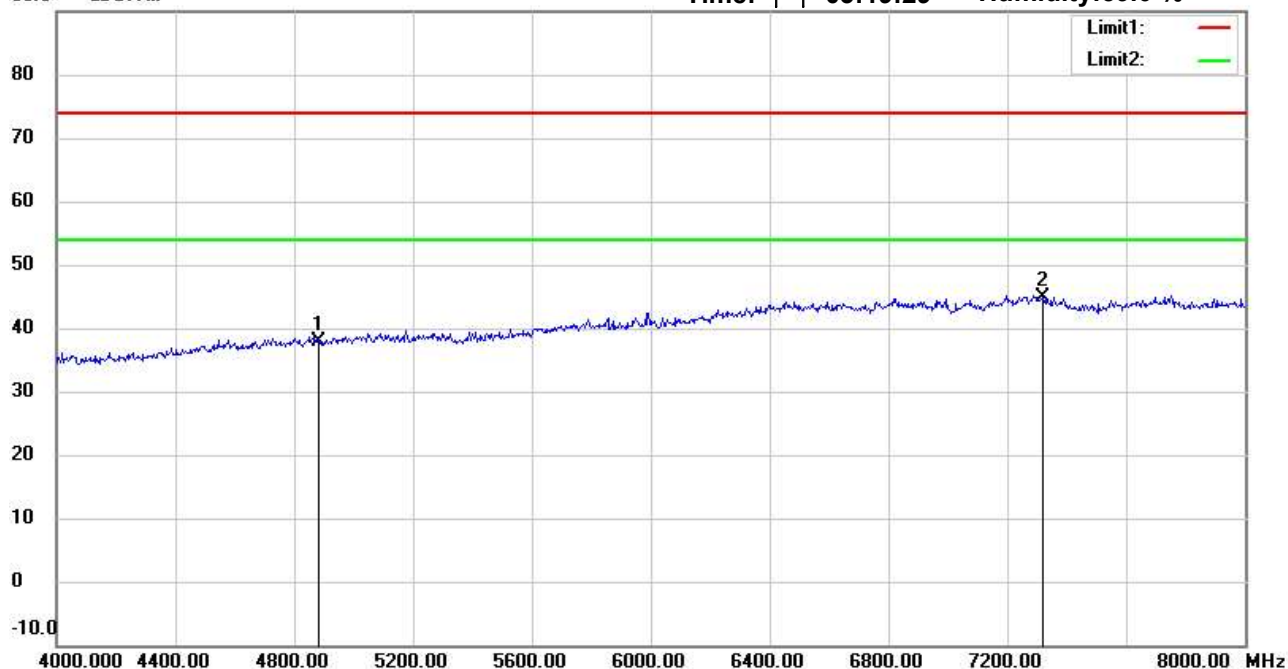

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2440MHz

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	4880.000	32.61	peak	5.23	37.84	74.00	150	355	-36.16	
*	7320.000	33.11	peak	11.67	44.78	74.00	150	133	-29.22	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#7


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 03:22:35

Humidity:59.0 %

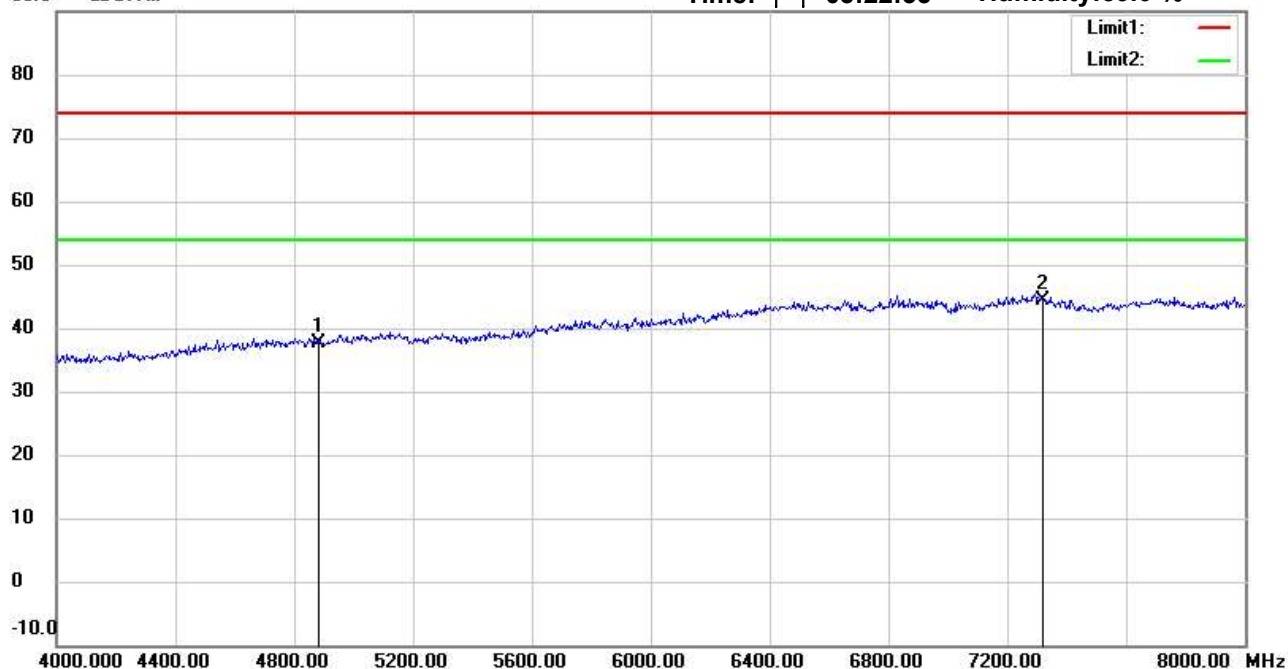

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2440MHz

Note :

Polarization: **Vertical**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	4880.000	32.50	peak	5.23	37.73	74.00	150	158	-36.27	
*	7320.000	32.74	peak	11.67	44.41	74.00	150	243	-29.59	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#3


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 03:20:25

Humidity: 59.0 %

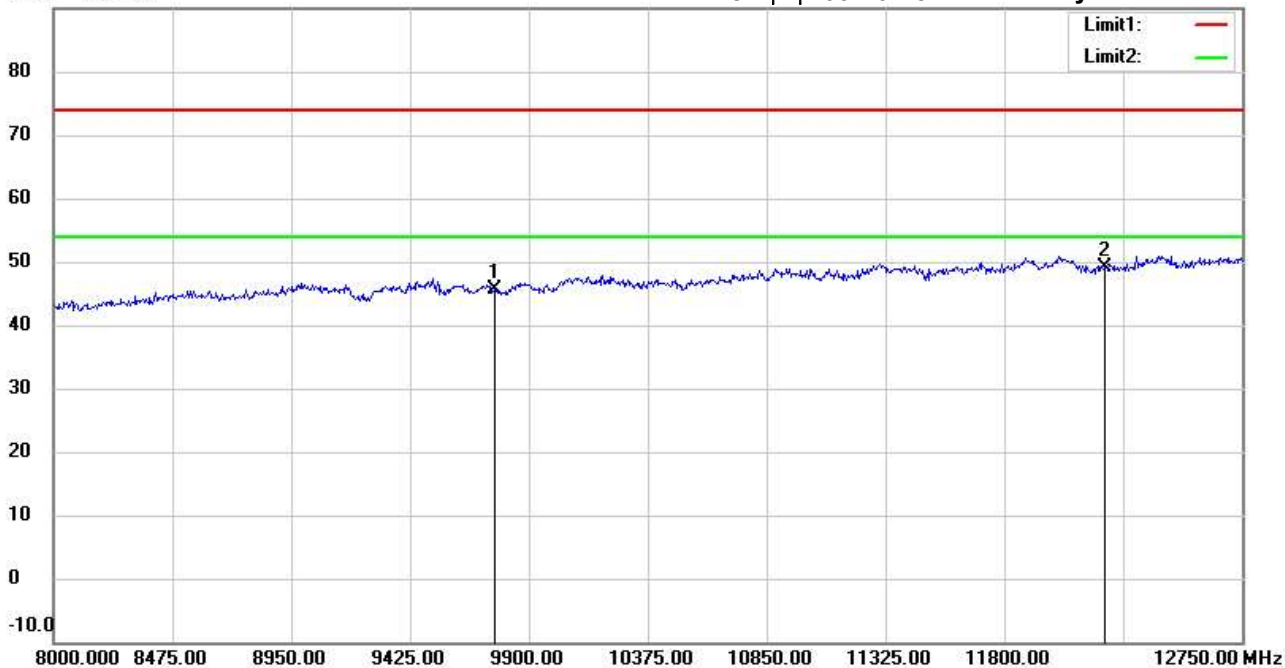

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2440MHz

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	9760.000	31.85	peak	13.75	45.60	74.00	150	211	-28.40	
*	12200.000	32.14	peak	17.03	49.17	74.00	150	315	-24.83	

*:Maximum data x:Over limit !:over margin



Address: 6F., No. 58, Ln 188, Ruey Kuang Rd, Neihu, Taipei
Tel: +886-2-6606-8877
Fax: +886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File : 3

Data : #8


Date: 2023/11/29

Temperature: 23.4 °C

90.0 dBuV/m

Time: 下午 03:23:23

Humidity: 59.0 %

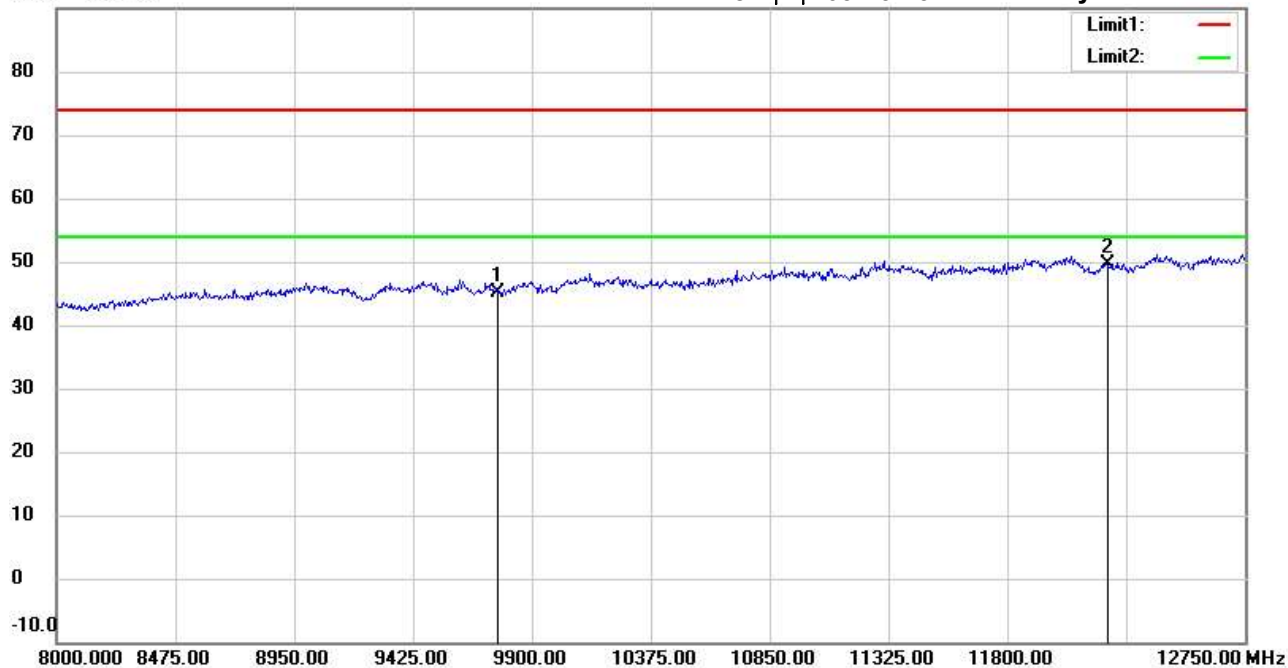

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2440MHz

Note :

Polarization: Vertical

Power : 120 V.a.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
	9760.000	31.50	peak	13.75	45.25	74.00	150	216	-28.75	
*	12200.000	32.50	peak	17.03	49.53	74.00	150	343	-24.47	

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#4


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 03:20:42

Humidity:59.0 %

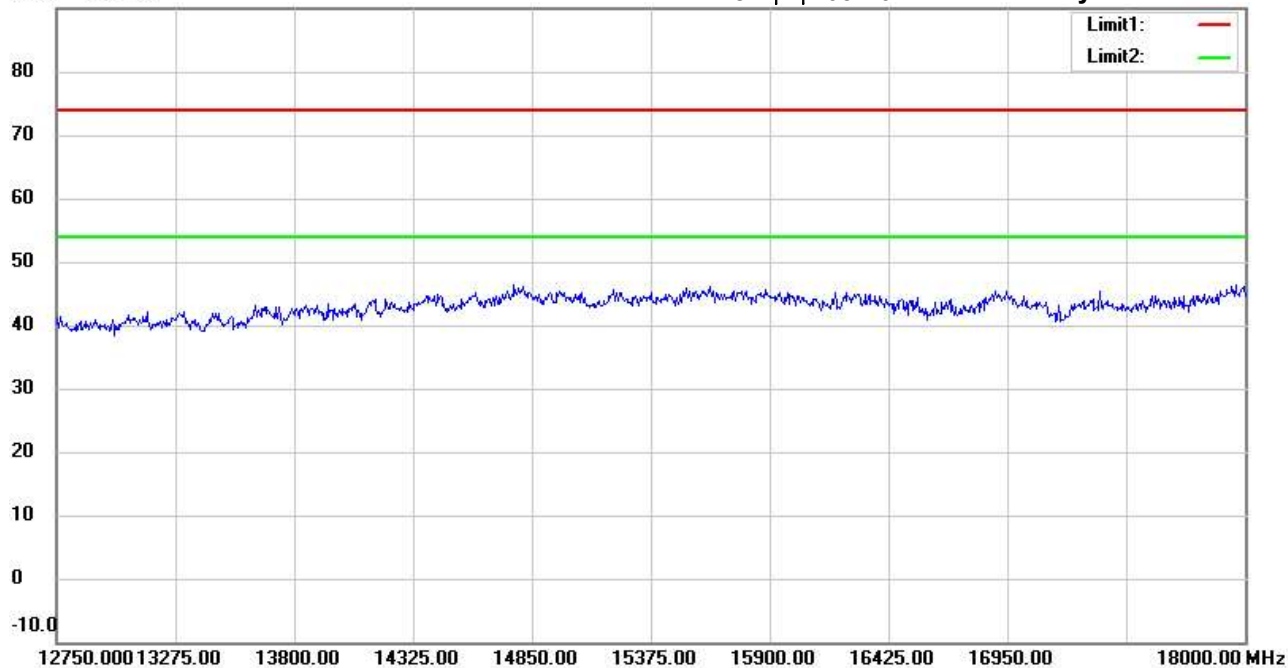

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2440MHz

Note :

Polarization: **Horizontal**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#9


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 03:23:41

Humidity:59.0 %

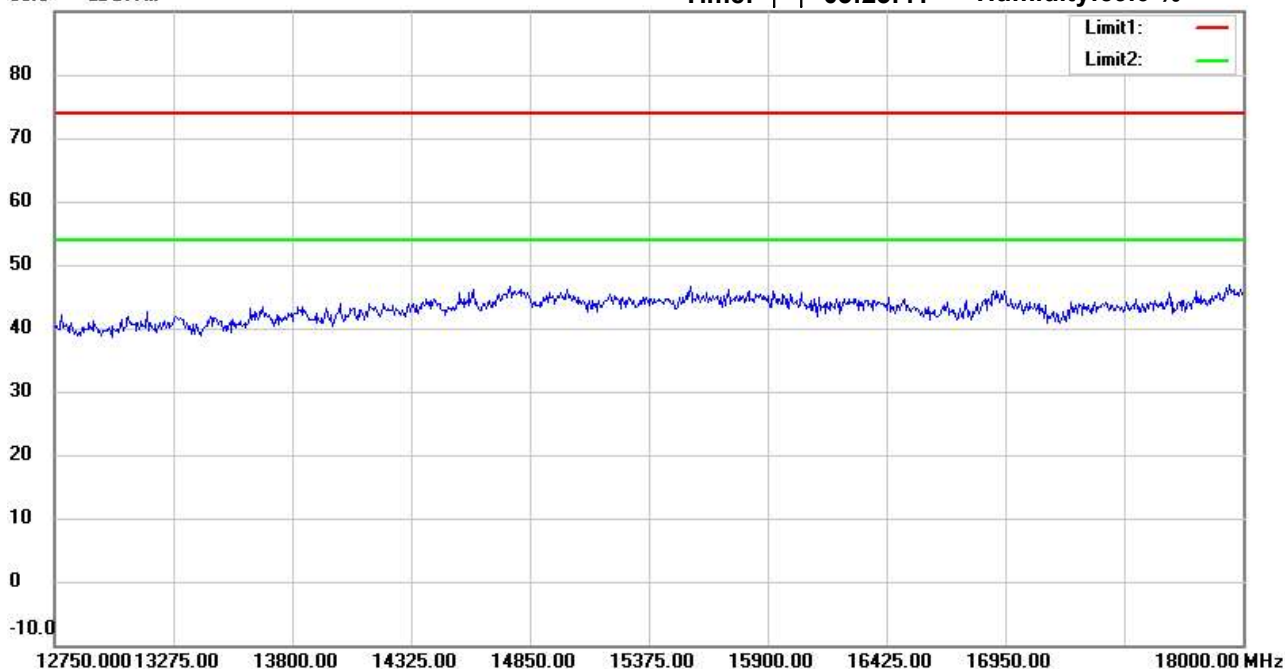

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2440MHz

Note :

Polarization: **Vertical**

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin



Address:6F.,No.58,Ln 188,Ruey Kuang Rd,Neihu,Taipei
Tel:+886-2-6606-8877
Fax:+886-2-6606-8875

Radiated Emission Measurement

Operator: Kai

File :3

Data :#5


Date: 2023/11/29

Temperature:23.4 °C

90.0 dBuV/m

Time: 下午 03:20:53

Humidity:59.0 %

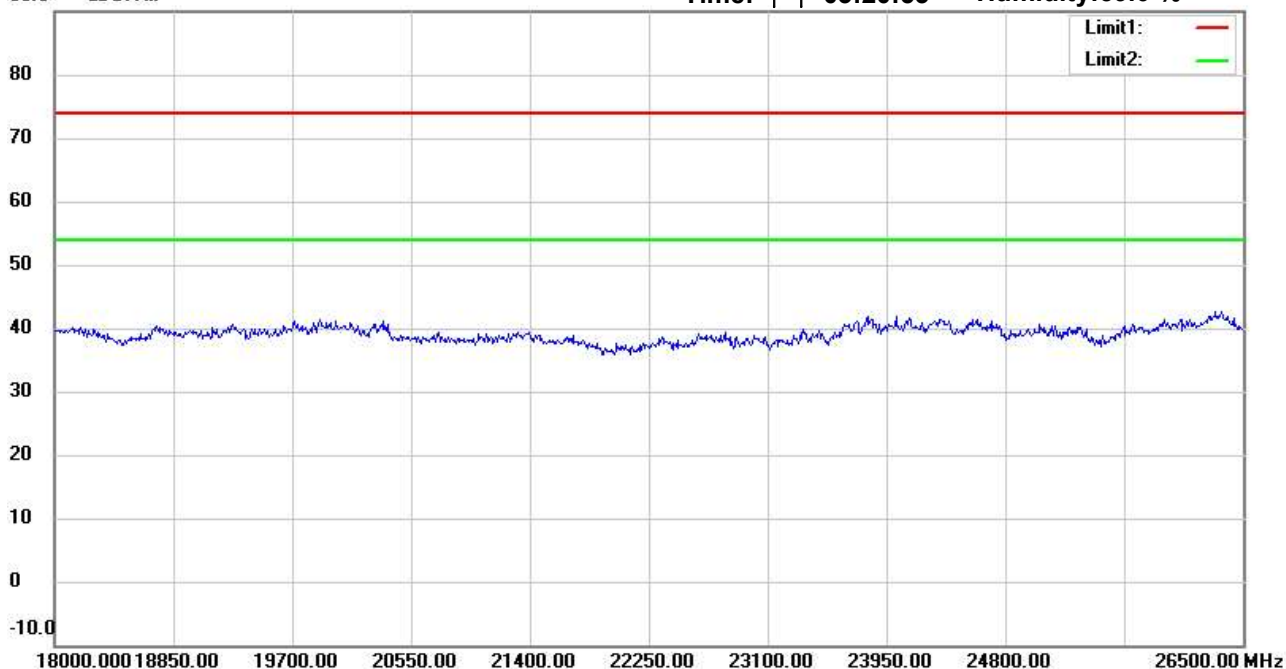

Site : Chamber

Condition : FCC_part 15 RE-Class C_Above 1GHz_PK

EUT : W6M22311-23090

M/N:

Test Mode : TX 2440MHz

Note :

Polarization: Horizontal

Power : 120 Va.c.

Distance: 3m

Mk.	Frequency (MHz)	Reading (dBuV)	Detector	Corr. factor (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Ant.Pos (cm)	Tab.Pos (deg.)	Margin (dB)	Comment
-----	-----------------	----------------	----------	---------------------	-----------------	----------------	--------------	----------------	-------------	---------

*:Maximum data x:Over limit !:over margin